

District I - (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II - (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III - (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87401  
District IV - (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM 87505

**ARTESIA DISTRICT OIL CONSERVATION DIVISION**  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-015-29078
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 647
7. Lease Name or Unit Agreement Name State 647 AC 711
8. Well Number 132
9. OGRID Number 370080
10. Pool name or Wildcat Artesia; Queen, Grayburg San Andres

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator Breitburn Operating LP

3. Address of Operator  
1111 Bagby Street, Suite 1600 Houston, TX 77002

4. Well Location

Unit Letter M: 660 feet from the South line and 990 feet from the West line

Section 27 Township 18S Range 28E NMPM Eddy County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
GR 3551'

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐  
CLOSED-LOOP SYSTEM ☐  
OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ P AND A ☒  
CASING/CEMENT JOB ☐  
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

11/08-11/09/2017: MIRUPU. Bleed well down, NDWH, unseat pump. POOH with rods and pump. NDWH, NU BOP, POOH with 2 3/8" tubing. Close well in. RDPU and move out.

11/13 - 11/14/2017: MIRUPU and plugging equipment, NDWH and NU BOP. RUWL, RIH with 5.5" gauge ring to 2800'. POOH to set CIBP. RIH and set 5.5" CIBP 2800'. RIH with tubing, tag CIBP at 2800'. Close well in, will spot cement on CIBP in the AM.

11/14 - 11/15/2017: Circulate 60 bbls of mud, spot 25 sx C cement 2800' to 2554'. POOH w/tubing. WOC. Tag TOC at 2541'. POOH and spot 25 sx C cement 820' to 574'. POOH and perforate at 438'. RIH and set packer at 100', squeeze with 45 sx C cement, displace to 300'. WOC. Tag TOC at 312'. POOH, ND BOP. Circulate cement from 60' to surface with 10 sx. No fall back. RDPU and plugging equipment. Weld on dry hole marker, cut off anchors and clean up location.

Spud Date:

09/05/1996

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

*Shelly Doescher*

TITLE: Agent

DATE: 10/17/2017

Type or print name Shelly Doescher

E-mail address shelly\_doescher@yahoo.com

PHONE: 505-320-5682

APPROVED BY:

*Staff*

TITLE

DATE 11-27-17

Conditions of Approval (if any):