Submit 1 Copy To Appropriate District Office	State of New Mexico	Form C-103
District I = (575) 393-6161	IL CONSERVATION and Natural Resources	Revised August 1, 2011 WELL API NO.
District II – (575) 748-1283	MAR QIÉ CONSERVATION DIVISION	30-015-04685
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178	1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460	RECEIVED Santa Fe, NM 87505	STATE FEE 6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	RECEIVED	B-2386-2
i e	CES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		State A 1
PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other		8. Well Number 1
Name of Operator Vanguard Operating, LLC		9. OGRID Number
3. Address of Operator		10. Pool name or Wildcat
5847 San Felipe St. Ste. 3000, Houston, TX 77057		Barber (Yates)
4. Well Location Unit Letter O:	1/4 feet from the SW line and	1/4 feet from the SE line
Section 17	Township 20S Range 30E	NMPM County Eddy
	11. Elevation (Show whether DR, RKB, RT, GR,	
And the second second second second second		
12. Check A	Appropriate Box to Indicate Nature of Notice	ce, Report or Other Data
NOTICE OF IN	TENTION TO:	UBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON REMEDIAL W	
TEMPORARILY ABANDON	<u>—</u>	DRILLING OPNS. P AND A
PULL OR ALTER CASING DOWNHOLE COMMINGLE	MULTIPLE COMPL CASING/CEM	JENI JOB
_	_	
OTHER:	OTHER:	and give pertinent dates including estimated date
of starting any proposed wo	ork). SEE RULE 19.15.7.14 NMAC. For Multiple	
proposed completion or rec	ompletion.	
Notify OCD 24 hrs prior to MIRU	P & A Equipment	
1. Notify OCD 24 hrs prior to MIRU P & A Equipment 2. Set CIBP @ 1393' RIH W/tbg tag CIBP circ hole W/mlf 3. Spot 25x's class "C" cmt F/1393'-1293' test csg & CIBP if doesn't test woc & tag 4. Perf @ 1135' sqz 55sx' 1135'-1035' (B.Salt) woc & tag 5. Perf @ 470' sqz 55x's 470'-370' (T.Salt & 8 5/8" shoe) woc & tag 6. Perf @ 100' size and to surface if 7" is 8 5/8" shoe) woc & tag 7. Perf @ 100' size and to surface if 7" is 8 5/8" shoe) woc & tag 8. Perf @ 100' size and to surface if 7" is 8 5/8" shoe) woc & tag		
 Spot 25x's class "C" cmt F/1393'- Perf @ 1135' sqz 55sx' 1135'-10 	1293' test csg & CIBP if doesn't test woc & tag	el. Salt + 1135'-380')
5. Perf @ 470' sqz 55x's 470'-370' (T.Salt & 8 5/8" shoe) woc & tag	35 (cm, 11)
	7 / x 8 5/8 csg & 8 5/8 x 10 noie venity cmt @ surt inside	e 7" csg.
7. RD P&A equip, cut anchors, welli	head and cleaned location, Install dry hole marker	
Spud Date:	Rig Release Date:	
X See Attache	COA'S MILES	ot be Placed by 3-19-19
I hereby certify that the information	above is true and complete to the best of my knowl	
	()	
SIGNATURE /	TITLE Agent	DATE 3/08/18
Type or print name Jimmy Bagley	E-mail address: sunsetwellservio	ce@yahoo.com PHONE: 432-561-8600
For State Use Only	D man address.	1 HONE.
APPROVED BY:	S TITLE STAFF M.	DATE 3-19-18
Conditions of Approval (if any).	1111/11/19	DATE 3 / J 10

STATE AI No. 001 LEASE/WELL: LOCATION 330' FNL & 1980' FEL GR NA UT O, SW1/4, SE 1/4, SEC 17, T 20S, R 30E SPUDDED 1937' WICHITA SPUDDER EDDY COUNTY, NM 1937' NEIL WILLS etal CO/ST: COMPLETED 30-015-04685 API NO. FIELD: BARBER (YATES) STATE LEASE B-2386-2 BEFORE PEA TOC 8 5/8" CALC @ 103' 10" HOLE 8 5/8" 28 PPF used 420 1/29/1938 W/50X "SALT" AT 420-1,085' TOC 7" CALC 902' 8" HOLE 7" 20 PPF LAPWELD new 1443' 2/17/1938 W/50 X 1,476' OTD 2/23/1938 EST 6 1/2' OH 1,575' DDTD 1/2/1942

CMB 03-06-18

LEASE/WELL:

STATE A1 No. 001

LOCATION

330' FNL & 1980' FEL

UT O, SW1/4, SE 1/4, SEC 17, T 20S, R 30E

GR NA

CO/ST:

EDDY COUNTY, NM

SPUDDED COMPLETED

1937' 1937'

WICHITA SPUDDER NEIL WILLS etal

API NO.

30-015-04685

FIELD:

BARBER (YATES)

STATE LEASE

B-2386-2

PERFELOD'CIRC EMTTOSURF VIA7"x85/8 CSG ANN \$ 85/8 x 10" HOLE VERIFY CMT @SURF INSIDE 7"ESG

10" HOLE

8 5/8" 28 PPF used

W/50X

PERFC 470'502 55 5x's WOC +TAG @ 370'

PERFE 1135' SQZ 55 5x'S WOCATAGE 1035'

8" HOLE

7" 20 PPF LAPWELD new

W/50 X

EST 6 1/2' OH

255x's cmT F/1393-1293' CIBPE 1393

1443' 2/17/1938

1,476' OTD 2/23/1938

1,575' DDTD 1/2/1942

CMB 03-06-18

CONDITIONS FOR PLUGGING AND ABANDONMENT

District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.

- A notice of intent to plug and abandon a wellbore is required to be approved before plugging
 operations are conducted. A cement evaluation tool is required in order to ensure isolation of
 producing formations, protection of water and correlative rights. A cement bond log or other
 accepted cement evaluation tool is to be provided to the division for evaluation if one has not
 been previously run or if the well did not have cement circulated to surface during the original
 casing cementing job or subsequent cementing jobs.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If the well is not plugged within 1
- 7. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 8. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 9. Produced water will not be used during any part of the plugging operation.
- 10. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 11. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 12. Class 'C' cement will be used above 7500 feet.
- 13. Class 'H' cement will be used below 7500 feet.
- 14. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 15. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow

. . .

- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)