Submit 1 Copy To Appropriate District State of New Mexico	Form C-103
District I – (575) 393-6161 Energy, Minerals and Natural Resources District II – (575) 748-1283	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM (38240) District II – (575) 748-1283	WELL API NO. 30-015-03575
811 S First St Artesia NM 88210 , ONVOIL CONSERVATION DIVISION	5. Indicate Type of Lease
District III - (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM PAR District IV - (505) 476-3460 C.D. Santa Fe, NM 87505	STATE STATE
District IV - (505) 476-3460	6. State Oil & Gas Lease No.
District IV - (505) 476-3460 1220 South St. Francis Dr. District IV - (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505 SUMARY NOTICES AND REPORTS ON WELLS	
87505 SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name of Omt Agreement Name
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	Continental State
PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other	8. Well Number
1. Type of went. On went 🖾 Gas went 🗋 Other	005
2. Name of Operator	9. OGRID Number
EOG M Resources Inc.	15445
3. Address of Operator	10. Pool name or Wildcat
105 South Fourth St, Artesia, NM 88210	Turkey Track 7 Rvrs Qn GB SA
4. Well Location	
Unit Letter M : 330 feet from the South line and 330	feet from the West line
Section 10 Township 19S Range 29E	NMPM County Eddy
11. Elevation (Show whether DR, RKB, RT, GR, etc.	
3362' GL	
12. Check Appropriate Box to Indicate Nature of Notice,	Report or Other Data
	,
NOTICE OF INTENTION TO: SUE	BSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WOR	
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DR	ILLING OPNS.
PULL OR ALTER CASING DIMULTIPLE COMPL CASING/CEMEN	IT JOB
DOWNHOLE COMMINGLE	
CLOSED-LOOP SYSTEM	_
OTHER: OTHER:	
OTHER: OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and	
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co	
OTHER: OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and	
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co	
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co	
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion.	
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 4/05/18—Notify OCD of move in.	
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'.	empletions: Attach wellbore diagram of
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @	1494' CTOC @ 1347' Tag @ 1330'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'.	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 13	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, an of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 124/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'.	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'.	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'.	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO.	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'.	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO.	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO. Spud Date: Rig Release Date:	ompletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO.	ompletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO. Spud Date: Rig Release Date:	ompletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO. Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledge	mpletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO. Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledge	mpletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO. Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledge	mpletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 4/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO. Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledges SIGNATURE TITLE Agent Type or print name Chris Romero E-mail address:	mpletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 14/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO. Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledge SIGNATURE TITLE Agent Type or print name Chris Romero E-mail address: Muddax for State Use Only	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40 ge and belief.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 14/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO. Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledge SIGNATURE TITLE Agent Type or print name Chris Romero E-mail address: M_MUMXC	ampletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40 ge and belief.
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion. 4/05/18—Notify OCD of move in. 4/06/18—Set 7" CIBP @ 1894' cap w/ 60 sxs CTOC @ 1550' Tag @ 1520'. 4/09/18—Perf @ 1447' set pkr @ 1146' press up OCD ok'd to spot 30 sxs @ 14/10/18—Perf @ 1283' set pkr @ 760' press up OCD ok'd to spot 65 sxs @ 12 4/11/18—Found holes from 120'-90' OCD ok'd to sqz 130 sxs @ 120' Tag @ sxs @ 40' Tag @ 6'. 4/13/18—Pump 15 sxs from 6' – surface verified RDMO. Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledge SIGNATURE TITLE Agent Type or print name Chris Romero E-mail address: M_MUMXC	mpletions: Attach wellbore diagram of 1494' CTOC @ 1347' Tag @ 1330'. 330' CTOC @ 983' Tag @ 930'. 90', spot 50 sxs @ 90' Tag @ 40'. Spot 40