Submit I Copy To Appropriate District State of New Mexico	Form C-10		
Office Distriction (575) 393-6161 Linergy Minerals and Natural Resources	Revised July 18, 201		
2623 N. French Dr., Hobbs, NM 88240 JUN & L 2018	WELL API NO.		
District II – (575) 748-1283 811 S. First St., Artesia, NM 88210 DISTRICT INCLOSERVATION DIVISION	30-015-10811		
Bill S. First St., Artesia, NM 88210 District III – (505) 334-6178 1000 Bio Brazos Rd. Azter, NM 87410	5. Indicate Type of Lease		
Santa Fe NM 87505	6. State Oil & Gas Lease No.		
District IV - (505) 476-3460 Salita I C, INIVI 87505 1220 S. St. Francis Dr., Santa Fe, NM 87505	B-255		
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	 7. Lease Name or Unit Agreement Name GJ West Coop Unit 8. Well Number 46 9. OGRID Number 229137 		
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			
1. Type of Well: Oil Well 🛛 Gas Well 🗌 Other			
2. Name of Operator COG Operating, LLC			
3. Address of Operator	10. Pool name or Wildcat		
600 W. Illinois Ave, Midland, TX 79701	GJ; 7Rvs-Qn-Grbg-Glorieta-Yeso 97558		
4. Well Location			
	980 feet from the E line		
Section 21 Township 17S Range 29E 11. Elevation (Show whether DR, RKB, RT, GR, etc.	NMPM County Eddy		
3550' GR			
12. Check Appropriate Box to Indicate Nature of Notice	Report or Other Data		
	•		
	BSEQUENT REPORT OF:		
PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMEN			
CLOSED-LOOP SYSTEM	Г		
OTHER: L OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, a			
	nd give pertinent dates including estimated d		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co	nd give pertinent dates, including estimated d ompletions: Attach wellbore diagram of		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion.	nd give pertinent dates, including estimated d ompletions: Attach wellbore diagram of		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.	ompletions: Attach wellbore diagram of		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods &	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg.		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 1/2" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 31/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf' V. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LC	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 31/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd V. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cli		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCM C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd N'. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cl Tag. Pump'd 75 sx class C cmt w/ 4 sx CAC		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LC	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf' V. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cl Fag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCL C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Ta displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cla Sag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCL C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Ta displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cla Sag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCL C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Ta displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cla Sag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCI C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Ta displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs & 36'. WOC. No Tag. into perfs @ 36', established circulation. *Continued on 2 nd page*	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cla Sag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCL C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Ta displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cla Sag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCI C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Ta displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs & 36'. WOC. No Tag. into perfs @ 36', established circulation. *Continued on 2 nd page*	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cla Sag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Co proposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cm 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCI C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Ta displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs & 36'. WOC. No Tag. into perfs @ 36', established circulation. *Continued on 2 nd page*	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 31/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cl Fag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25 Pump'd 3 sx mud, 2 sx LCM, 1 sx cotton se		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Corproposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cmt 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCC C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No Ta & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Tag displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs & 36'. WOC. No Tag. into perfs @ 36', established circulation. *Continued on 2 nd page* Spud Date: Rig Release Date: Rig Release Date:	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 31/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cl Fag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25 Pump'd 3 sx mud, 2 sx LCM, 1 sx cotton se		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Corproposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cmt 140'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCC C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No Ta & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Tag displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs & 36'. WOC. No Tag. into perfs @ 36', established circulation. *Continued on 2 nd page* Spud Date: Rig Release Date: Rig Release Date:	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 31/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cl Fag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25 Pump'd 3 sx mud, 2 sx LCM, 1 sx cotton se		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Corproposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sq2'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sq2'd 100 sx class C cmt 4 0'. Perf'd csg @ 140'. Sq2'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sq2'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H20 into perfs, lost circulation. Pump'd H2O w/ 2 sx LCI C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T & 10 sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Tag displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs & 36'. WOC. No Tag. into perfs @ 36', established circulation. *Continued on 2 nd page* Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowled SIGNATURE	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd '. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cl 'ag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25 Pump'd 3 sx mud, 2 sx LCM, 1 sx cotton se 		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Corproposed completion or recompletion. 05/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sqz'd 40 sx class C cmt & 22% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sqz'd 100 sx class C cr 40'. Perf'd csg @ 140'. Sqz'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sqz'd 50 sx class C cmt & displaced to 40 @ 46'. Pump'd 30 bbls H2O into perfs, lost circulation. Pump'd H2O w/ 2 sx LCC C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No Tag. E to sx LCM & displaced into perfs @ 36'. WOC. 06/06/18 No Tag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Tag displaced into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs & 36'. WOC. No Tag. into perfs @ 36', established circulation. *Continued on 2 nd page* Spud Date: I hereby certify that the information above is true and complete to the best of my knowled SIGNATURE SIGNATURE Type or print name KUNICIA (ASTIN) E-mail address/W.STI/WWA	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. \$1/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd' Y. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd' M into perfs. Waited 1 hour. Sqz'd 25 sx class Cag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25 Pump'd 3 sx mud, 2 sx LCM, 1 sx cotton se		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Corproposed completion or recompletion. D5/29/18 MIRU Plugging Equipment. ND well head, NU BOP. Began working rods & 4 ½" CIBP @ 225'. Circ'd hole w/ MLF. Spot'd 25 sx class C cmt @ 2205-1833'. 05/3 Perf'd 4 ½" csg @ 930'. Broke circulation & sq2'd 40 sx class C cmt & 2% CACL @ BOP. Perf'd csg @ 391'. Pump'd into perfs & lost circulation. Sq2'd 100 sx class C cmt 40'. Perf'd csg @ 140'. Sq2'd 25 sx class C cmt w/ 2% CACL & 1 sx LCM & displace @ 46'. Pump'd into perfs, lost circulation. Sq2'd 50 sx class C cmt & displaced to 40 csg @ 36'. Pump'd 30 bbls H20 into perfs, lost circulation. Pump'd H2O w/ 2 sx LCI C cmt w/ 2% CACL & 2 sx LCM & displaced into perfs @ 36'. WOC. 06/05/18 No T ag. Pump'd MLF & sx class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs @ 36'. WOC. No Tag. Signatch into perfs @ 36'. 06/07/18 Pump'd 3 sx MLF, 2 sx cotton seed, & 1 sx LCM class C cmt w/ 2% CACL & 1 sx LCM & displaced into perfs & 36'. WOC. No Tag. into perfs @ 36', established circulation. *Continued on 2 nd page* Spud Date: SIGNATURE SIGNATURE	ompletions: Attach wellbore diagram of & pump free. 05/30/18 POH w/ rods & tbg. 81/18 Pressured up on 8 5/8" csg to 200 PSI 930-700'. WOC. Tag'd plug @ 674'. ND mt @ 391-100'. WOC. 06/01/18 Tag'd plug ced to 100'. WOC. Tag'd plug @ 46'. Perf'd '. WOC. 06/04/18 Tag'd plug @ 36'. Perf'd M into perfs. Waited 1 hour. Sqz'd 25 sx cl 'ag. Pump'd 75 sx class C cmt w/ 4 sx CAC & 7 sx LCM into perfs @ 36'. WOC. Sqz'd ag. Pump'd 10 sx of LCM & 5 sx MLF & 1 into perfs @ 36'. Waited 1 hour. Sqz'd 25 Pump'd 3 sx mud, 2 sx LCM, 1 sx cotton se 		

Conditions	of	Approval	(if	'any)
------------	----	----------	-----	-------

(06/07/18 continued) Sqz'd 120 sx class C cmt @ 36' & circulated to surface. 06/08/18 Verified cmt to surface. Rigged down and moved off. 06/11/18 Moved in backhoe and welder. Dug out cellar. Cut off well head. Welded on "Above Ground Dry Hole Marker". Backfilled cellar. Cut off deadmen. Cleaned location, moved off.