 
e - 9							
Form 3160-5 UNITED STATES						FORM APPROVED	
DEPARTMENT OF THE INTERIOR BUREAU OF LAND MAN Carisbad Field						OMB No. 1004-0137 ispires: July 31, 2010	
SUNDRY		Caris	dad fi	ield (	OLL D63622		
Do not use this	form for proposals	to drill or	NED A	rtesi	6. If Indian, Allottee	or Tribe Name	
abandoned well.	Use Form 3160-3 (	APD) for si	uch proposa	als.			
SUBMIT IN TRIPLICATE - Other instructions on peace 2.					7. If Unit of CA/Agre	ement. Name and/or No.	
l Type of Well							
Cil Well Gas Well Other					8. Well Name and No. TENNECO FEDERAL 001		
2. Name of Operator WS OIL AND GAS OPERATING, LLC				9. API Well No. 30-015-05794			
3a. Address P.O. BOX 5375	3b. Phone No	. (include area code) 10. Field and Pool or Exploratory Area					
432-242-45 4. Location of Well (Footage, Sec., T., R., M. or Survey Description)			29490: HACKBERRY;YATES-7RVRS,NORTH			RY;YATES-7RVRS,NORTH	
<ol> <li>Cocation of Well (<i>Poolage, Sec., T.,</i></li> <li>330 FNL 330 FWL, UL D SEC 28 T19S R31E</li> </ol>	11 Country or Parish, State						
					EDDY, NM		
	THE APPROPRIATE B	DX(ES) TO INI	DICA TENATUI	RE OF NOT	FICE, REPORT OR OTH	ER DATA	
TYPE OF SUBMISSION	TYPE OF .				CTION		
Notice of Intent		🔽 Dee		Pro	oduction (Start/Resume)	Water Shut-Off	
	Alter Casing		ture Treat	🔲 Re	clamation	Well Integrity	
Subsequent Report	Casing Repair		Construction	<u> </u>	complete	Other	
Final Abandonment Notice	Change Plans	Diug	and Abandon Back		mporarily Abandon ater Disposal		
following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed only after all requirements, including reclamation, have been completed and the operator of determined that the site is ready for final inspection.)  PROPOSED PROCEDURE TO DEEPEN WELL 150'. OBJECTIVE: OPEN AND PRODUCE FROM YATES 2.3 AND 4 ZONES. 1. INSPECT LOCATION AND ANCHORS. 2. BLEED OFF EXISTING PRESSURE. MIRU WORKOVER RIG. INSTALL PROPER BLOWOUT EQUIPMENT 3. UNHANG WELL, POOH WITH PUMP AND RODS, VISUALLY INSPECT RODS AND SHOP PUMP. 4. NIPPLE DOWN WELLHEAD, NIPPLE UP BOP, TAG FOR FILL. 5. POOH LAYING DOWN 2-3/8' TUBING. 6. PU 4-1/2'' BIT AND 5-1/2'' CASING SCRAPPER, CLEAN OUT TO 2200' (PBTD). 2200' 7. POOH WITH BIT AND SCRAPPER. 8. PU BOTTOMHOLE DRILL STRING ASSEMBLY. 9. DRILL THROUGH CASING SHOE @ 2205'. DRILL NEW HOLE TO 2355' 10. CIRCULATE WELL CLEAN. POOH WITH DRILL STRING. 11. PU AND RIH WITH 5-1/2'' RBP AND PACKER, SET RBP @ 2198'. PUH SET PACKER @ 2100' 12. ACIDIZE PERFS 2152' - 2190'. SWION FOR ACID TO SPEND. 13. FLOWBACK ACID. POOH WITH RBP AND PACKER.							
14 RIH WITH PACKER. SET PACKE 15. FLOWBACK ACID. POOH. RETU ACUSPED FOR 14. Thereby certify that the foregoing is tru	ZECARD -7	P-8AT	HACID AND D				
CARIE STOKER	Tale REGULATORY AFFAIRS COORDINATOR						
Signature Ome	Date 03/21/2016						
	THIS SPACE	FOR FEDE	RAL OR ST	ATE OF	FICE USE		
Approved by							
Conditions of approval, if any, are attached, that the applicant holds legal or equitable till entitle the applicant to conduct operations the Title 1811 S.C. Section 1001 and Title 42.11	e to those rights in the subject ereon.	l lease which wo	uld office 🕻	FO	PARD PE D		
Title 18 U.S.C Section 1001 and Title 43 U fictitious or fraudulent statements or represe	attations as to any matter with	crime for any pe iin its jurisdiction	rson knowingly ar	nd willfully i	to make to any department	or agency of the United States any false.	
(Instructions on page 2)							



. .

