Submit I Copy To Appropriate District RECENED State of New Mexico Office	Form C-103
District 1 – (575) 393-6161 Energy, Minerals and Natural Resc	well API NO. Revised July 18, 2013
District II ~ (575) 748-1283 APR 1 0 LCONSERVATION DIVIS	ION 30-015-26169
District III - (505) 334-6178 1000 Rio Brazos Rd. Aztec NM-875105 District IV - (505) 476-3460 Santa Fe, NM-87505	5. Indicate Type of Lease STATE FEE FEE
District IV - (505) 476-3460 Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	
PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other	.8. Well Number 001
2. Name of Operator Colgate Operating, LLC	9. OGRID Number 371449
3. Address of Operator.	10. Pool name or Wildcat
303 West Wall Street, Suite 700 - Midland, Tx 79701	Parkway; Delaware
4. Well Location Unit Letter <u>C</u> : 330 feet from the <u>North line and 2310 feet from the North line and 1310 </u>	ioni that What Time
	County Eddy
11. Elevation (Show whether DR, RKB, R	
3326 GR	
12. Check Appropriate Box to Indicate Nature o	f Notice, Report or Other Data
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REME	DIAL WORK
	IENCE DRILLING OPNS.□ PAND A ⊠ G/CEMENT JOB □
DOWNHOLE COMMINGLE	CACCINICIA I SOD
CLOSED-LOOP SYSTEM	_ ,
	¬.
OTHER: OTHEI	
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15.7.14 NMAC. For M	details, and give pertinent dates, including estimated date lultiple Completions: Attach wellbore diagram of
13. Describe proposed or completed operations. (Clearly state all pertinent	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of
 Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15.7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03.29.19 	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of $\frac{A_{PProved}}{L_{labilin}}$
 13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7:14:NMAC. For M proposed completion or recompletion. 03:27:19-03:29:19 Notified NMOCD Artesia by Jason Rice 	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of $\frac{A_{PProved}}{L_{labilin}}$
 Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15.7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03.29.19 	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of $\frac{A_{PProved}}{L_{labilin}}$
 13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15.7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03.29.19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700°. Put 35° class *C° cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510°. Circ hole w/ 10# gelled brine. 	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of $\frac{A_{PProved}}{L_{labilin}}$
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700°. Put 35° class *C° cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510°. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118°. RU cement truck: TIH w/ tbg. Squeezed 2	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of Approved for plusting of well bore only. Approved for plusting of well bore only. Which may be found at OCD Web Page under receipt to the well plugsing. TOH w/ tbg. 5 sxs class 'C' cement:
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700°. Put 35° class °C° cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510°. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118°. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @ 450°. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @ 100°. TIH w/ tbg. Circ 50 sxs class °C° cement to	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of Approved for plusting of well bore only. Liability under bond is retained pending receipt with the found at OCD Web Page under the plusting of well plusting. TOH w/ tbg. 5 sxs class 'C' cement. lass 'C' cement. TOH
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7:14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700'. Put 35' class 'C' cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510'. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118'. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @ 450'. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @ 100'. TIH w/ tbg. Circ 50 sxs class 'C' cement to RD WSU. Cleaned steel pit (no earth pit).	details, and give pertinent dates, including estimated date fulliple Completions: Attach wellbore diagram of Approved for plusting of well hore only. Liability under hond is retained pending receipt which may be found at OCD Web Palge under Plugsing). TOH w/ tbg. 5 sxs class 'C' cement. lass 'C' cement. TOH. surface. RD.
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700°. Put 35° class °C° cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510°. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118°. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @ 450°. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @ 100°. TIH w/ tbg. Circ 50 sxs class °C° cement to	details, and give pertinent dates, including estimated date fulliple Completions: Attach wellbore diagram of Approved for plusting of well hore only. Liability under hond is retained pending receipt which may be found at OCD Web Palge under Plugsing). TOH w/ tbg. 5 sxs class 'C' cement. lass 'C' cement. TOH. surface. RD.
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @:3,700'. Put 35' class 'C' cement on top with dum WOC 4 hours. Tagged w/ tbg @:3,510'. Circ hole w/ 10# gelled brine. RU wireline. Perf @:1,118''. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @:450''. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @:100'. TIH w/ tbg. Circ 50 sxs class 'C' cement to RD WSU. Cleaned steel pit (no earth pit). Will cut off wellhead, install DHM and clean location soon (including)	details, and give pertinent dates, including estimated date fulliple Completions: Attach wellbore diagram of Approved for plusting of well hore only. Liability under hond is retained pending receipt which may be found at OCD Web Palge under Plugsing). TOH w/ tbg. 5 sxs class 'C' cement. lass 'C' cement. TOH. surface. RD.
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7:14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700'. Put 35' class 'C' cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510'. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118'. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @ 450'. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @ 100'. TIH w/ tbg. Circ 50 sxs class 'C' cement to RD WSU. Cleaned steel pit (no earth pit).	details, and give pertinent dates, including estimated date fulliple Completions: Attach wellbore diagram of Approved for plusting of well hore only. Liability under hond is retained pending receipt which may be found at OCD Web Palge under Plugsing). TOH w/ tbg. 5 sxs class 'C' cement. lass 'C' cement. TOH. surface. RD.
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700°. Put 35° class 'C' cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510°. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118°. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @ 450°. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @ 100°. TIH w/ tbg. Circ 50 sxs class 'C' cement to RD WSU. Cleaned steel pit (no earth pit). Will cut off wellhead, install DHM and clean location soon (including Spud Date:	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of Approved for plusting of well bore only. Which may be found at OCD Web Page under to well plug hing). TOH w/ tbg. 5 sxs class 'C' cement. lass 'C' cement. TOH surface. RD.
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @:3,700'. Put 35' class 'C' cement on top with dum WOC 4 hours. Tagged w/ tbg @:3,510'. Circ hole w/ 10# gelled brine. RU wireline. Perf @:1,118''. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @:450''. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @:100'. TIH w/ tbg. Circ 50 sxs class 'C' cement to RD WSU. Cleaned steel pit (no earth pit). Will cut off wellhead, install DHM and clean location soon (including)	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of Approved for plusting of well bore only. Which may be found at OCD Web Page under to well plug hing). TOH w/ tbg. 5 sxs class 'C' cement. lass 'C' cement. TOH surface. RD.
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15:7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700°. Put 35° class 'C' cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510°. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118°. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @ 450°. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @ 100°. TIH w/ tbg. Circ 50 sxs class 'C' cement to RD WSU. Cleaned steel pit (no earth pit). Will cut off wellhead, install DHM and clean location soon (including Spud Date:	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of Approved for plusting of well bore only. Which may be found at OCD Web Page under to well plug hing). TOH w/ tbg. 5 sxs class 'C' cement. lass 'C' cement. TOH surface. RD.
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15.7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700°. Put 35° class °C° cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510°. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118°. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @ 450°. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @ 100°. TIH w/ tbg. Circ 50° sxs class °C° cement to RD WSU. Cleaned steel pit (no earth pit). Will cut off wellhead, install DHM and clean location soon (including). Spud Date: Rig Release Date:	details, and give pertinent dates, including estimated date fultiple Completions: Attach wellbore diagram of Approved for plusting of well bore only. Which may be found at OCD Web Page under to well plug hing). TOH w/ tbg. 5 sxs class 'C' cement. lass 'C' cement. TOH surface. RD.
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15.7.14 NMAC. For M proposed completion or recompletion. 03:27.19-03:29:19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700°. Put 35° class °C° cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510°. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118°. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @ 450°. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @ 100°. TIH w/ tbg. Circ 50° sxs class °C° cement to RD WSU. Cleaned steel pit (no earth pit). Will cut off wellhead, install DHM and clean location soon (including). Spud Date: Rig Release Date:	details, and give pertinent dates, including estimated date fulliple Completions: Attach wellbore diagram of Approved for plusting of well hope only. Approved for plusting of well hope only. Which may be found as retained pending receipt of Well plugating) TOH w/ tbg. 5 sxs class C' cement. lass 'C' cement. TOH. surface. RD. Operations Tech DATE 04/08/2019
13. Describe proposed or completed operations. (Clearly state all pertinent of starting any proposed work). SEE RULE 19:15.7.14 NMAC. For M proposed completion or recompletion. 03.27.19-03.29.19 Notified NMOCD Artesia by Jason Rice RU JWS NU BOP moved in all P&A equipment. RU WL. Set CIBP @ 3,700'. Put 35' class 'C' cement on top with dum WOC 4 hours. Tagged w/ tbg @ 3,510'. Circ hole w/ 10# gelled brine. RU wireline. Perf @ 1,118'. RU cement truck. TIH w/ tbg. Squeezed 2 TOH. RU Wireline. Perforated @ 450'. TIH w/ tbg. Squeezed 25 sxs c RU wireline. Perf @ 100'. TIH w/ tbg. Circ 50 sxs class 'C' cement to RD WSU. Cleaned steel pit (no earth pit). Will cut off wellhead, install DHM and clean location soon (including). Spud Date: Rig Release Date: TITLE	details, and give pertinent dates, including estimated date fulliple Completions: Attach wellbore diagram of Approved for plusting of well hope only. Approved for plusting of well hope only. Which may be found as retained pending receipt of Well plugating) TOH w/ tbg. 5 sxs class C' cement. lass 'C' cement. TOH. surface. RD. Operations Tech DATE 04/08/2019