Office District I		Diate of 110	w Mexico		Form C-10
District 1	Energ	y, Minerals and	l Natural Resources		Revised June 10, 200
1625 N. French Dr., Hobbs, NM 882	•	-		WELL API NO.	
District II	OII	CONICEDIA	TION DIVISION	30 015 01764	
1301 W. Grand Ave., Artesia, NM 8	0210			5. Indicate Type	of Lease
District III	Dio Descript Dd. Arton NM 97410:			STATE	
1000 Rio Brazos Rd., Aztec, NM 87- <u>District IV</u> 1220 S. St. Francis Dr., Santa Fe. NM		Santa Fe, N	IM 87505	6. State Oil & G	
87505					
SUNDRY DO NOT USE THIS FORM FOR P	NOTICES AND I			7. Lease Name of	or Unit Agreement Name
DIFFERENT RESERVOIR. USE "A				Artesia Unit	
PROPOSALS.)				8. Well Number	
 Type of Well: Oil Well Gas Well 	Other (Injection) X		Well # 32	
2. Name of Operator	(3	, <u> </u>	RECEIVED	9. OGRID Num	ber
Melrose Operating Company			HECEIVED	184860	
3. Address of Operator			JUL 1 0 2006	10. Pool name o	
c/o P.O. Box 953, Midland, T	TX 79702	<u> </u>	OOU-MITEOU	Artesia; Queen-C	Grayburg
4. Well Location				•	
Unit Letter M:	990' feet from th	e South line	and 330° feet fr	om theWestline	
Section 36 T	Township 17S	Range 28			
	11. Eleva	uon (Show wheti	er DR, RKB, RT, GR,	etc.): 3384	
12. Ch	eck Appropriat	e Box to India	ate Nature of Not	ice, Report or Other	r Data
NOTICE C	F INTENTION	N TO:	S	UBSEQUENT RE	EPORT OF:
PERFORM REMEDIAL WOR		D ABANDON			ALTERING CASING
TEMPORARILY ABANDON	☐ CHANGE	PLANS [COMMENCE	DRILLING OPNS.	PLUG AND
DUILL OD ALTED CASING	☐ MULTIPLE	E 1	CASING TES	ET AND	ABANDONMENT
PULL OR ALTER CASING			CASING TES		
	COMPLE	11011	02.112.11.00		
OTHER:	COMPLE		OTHER:		
13. Describe proposed or of starting any propos	completed operat	ions. (Clearly st	OTHER:	s, and give pertinent da	
13. Describe proposed or of starting any propos or recompletion.	completed operations completed work). SEE R	ions. (Clearly st ULE 1103. For	OTHER: ate all pertinent detail Multiple Completions	s, and give pertinent da : Attach wellbore diag	gram of proposed complet
 Describe proposed or of starting any propos or recompletion. 10-17/31-05: Rigged up. Set R 	completed operations of completed operations of completed operations of complete com	ions. (Clearly st ULE 1103. For sure test, did not	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2	s, and give pertinent da : Attach wellbore diag 230-0'. Dumped 2 sx s	gram of proposed complete and on RBP. WOC job.
13. Describe proposed or of starting any propos or recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement.	completed operatised work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wirelin	ions. (Clearly st ULE 1103. For sure test, did not C1 C 2% CaCl 1 ne shot squeeze 1	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2 32 cu/ft; 75 sx cementable @ 1950'-couldn'	s, and give pertinent da : Attach wellbore diag 230-0'. Dumped 2 sx sat circulated out & outsit t circulate. Shot @ 170	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job.
13. Describe proposed or of starting any propos or recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers	completed operatised work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling. Tbg @ 1968', pt	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cementable @ 1950'-couldn' % CaCl. Cmt retainer	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx st circulated out & outsit circulate. Shot @ 1700 @ 280' pumped 400 sx	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job.
13. Describe proposed or of starting any propos or recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200	completed operatised work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling. Tbg @ 1968', pu sx Cl C 3% CaCl	ions. (Clearly st ULE 1103. For sure test, did not C1 C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cement hole @ 1950'-couldn's CaCl. Cmt retainer 5/8" & outside 8 5/8"-	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700 @ 280' pumped 400 sx 45 sx to pit. WOC.	and on RBP. WOC job. ide surface casing. 0'. WOC job. at Cl C 3% CaCl, displaced
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement.	completed operatised work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wirelin 5. Tbg @ 1968', pu 5x Cl C 3% CaCl 6, fell out @ 243', to	ions. (Clearly st ULE 1103. For sure test, did not C1 C 2% CaC1 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8 agged cement at	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen nole @ 1950'-couldn's % CaCl. Cmt retainer 5/8" & outside 8 5/8"- ove retainer @ 265'.	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx stat circulated out & outsit circulate. Shot @ 1700 @ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 1540	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job. x Cl C 3% CaCl, displaced 0', drilling hard cement to
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @	completed operatised work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cem	ions. (Clearly st ULE 1103. For sure test, did not C1 C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8 tagged cement at tenters, pumped	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen nole @ 1950'-couldn's 6 CaCl. Cmt retainer 5/8" & outside 8 5/8"- ove retainer @ 265'. 50 sx Cl C w/2% CaC	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700@ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 15401. WOC & drilled out to	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job. x Cl C 3% CaCl, displaced 0', drilling hard cement to 0 1968'.
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD-	completed operative sed work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cem -1 plastic coated p	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8 tagged cement at tenters, pumped acker, 2 3/8" pla	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen hole @ 1950'-couldn' CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaC stic coated tubing & s	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700@ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 15401. WOC & drilled out to	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job. x Cl C 3% CaCl, displaced 0', drilling hard cement to 0 1968'.
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @	completed operative sed work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cem -1 plastic coated p	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8 tagged cement at tenters, pumped acker, 2 3/8" pla	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen hole @ 1950'-couldn' CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaC stic coated tubing & s	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700@ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 15401. WOC & drilled out to	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job. x Cl C 3% CaCl, displaced 0', drilling hard cement to 0 1968'.
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD-	completed operative sed work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cem -1 plastic coated p	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8 tagged cement at tenters, pumped acker, 2 3/8" pla	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen hole @ 1950'-couldn' CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaC stic coated tubing & s	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700@ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 15401. WOC & drilled out to	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job. x Cl C 3% CaCl, displaced 0', drilling hard cement to 0 1968'.
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD-	completed operative sed work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cem -1 plastic coated p	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8 tagged cement at tenters, pumped acker, 2 3/8" pla	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen hole @ 1950'-couldn' CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaC stic coated tubing & s	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700@ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 15401. WOC & drilled out to	gram of proposed completed and on RBP. WOC job. ide surface casing. O'. WOC job. at Cl C 3% CaCl, displace O', drilling hard cement to 1968'.
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD-	completed operative sed work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cem -1 plastic coated p	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8 tagged cement at tenters, pumped acker, 2 3/8" pla	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen hole @ 1950'-couldn' CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaC stic coated tubing & s	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700@ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 15401. WOC & drilled out to	gram of proposed completed and on RBP. WOC job. ide surface casing. O'. WOC job. at Cl C 3% CaCl, displace O', drilling hard cement to 1968'.
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD-	completed operative sed work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cem -1 plastic coated p	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8 tagged cement at tenters, pumped acker, 2 3/8" pla	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen hole @ 1950'-couldn' 46 CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaC stic coated tubing & s	s, and give pertinent das: Attach wellbore diage 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700@ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 15401. WOC & drilled out to	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job. x Cl C 3% CaCl, displaced 0', drilling hard cement to 0 1968'.
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD-	completed operative sed work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cement plastic coated proportion on wo	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze 1 imped 25 sx C 2' circulated out 8 lagged cement at lenters, pumped acker, 2 3/8" pla rkover unit. Wil	oTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cementale @ 1950'-couldn's % CaCl. Cmt retainer 5/8" & outside 8 5/8"- ove retainer @ 265'. 50 sx Cl C w/2% CaCl stic coated tubing & stire-test w/chart.	s, and give pertinent das: Attach wellbore diagonals: Attach wellbore diagonals: Attach wellbore diagonals: Attach wellbore diagonals: Attach wellbore de	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job. x Cl C 3% CaCl, displaced 0', drilling hard cement to 0 1968'.
13. Describe proposed or of starting any propos or recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD-fluid settles. Well had 20# dro	completed operative sed work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cement plastic coated proportion on wo	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze l umped 25 sx C 2' circulated out 8 agged cement at nenters, pumped acker, 2 3/8" pla rkover unit. Wil	other: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cement hole @ 1950'-couldn's 4 CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaCl stic coated tubing & stirc-test w/chart.	s, and give pertinent da 230-0'. Dumped 2 sx state circulated out & outsite circulate. Shot @ 170a @ 280' pumped 400 states. WOC. Tagged cement @ 154a 1. WOC & drilled out to the to a 1853'. Waiting or	gram of proposed completer and on RBP. WOC job. ide surface casing. O'. WOC job. at Cl C 3% CaCl, displaced to 1968'. In pressure test after packet
13. Describe proposed or of starting any propos or recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD fluid settles. Well had 20# dro	completed operative sed work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling Tbg @ 1968', pu sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cement plastic coated proportion on wo	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze l umped 25 sx C 2' circulated out 8 agged cement at nenters, pumped acker, 2 3/8" pla rkover unit. Wil	oTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cementale @ 1950'-couldn's % CaCl. Cmt retainer 5/8" & outside 8 5/8"- ove retainer @ 265'. 50 sx Cl C w/2% CaCl stic coated tubing & stire-test w/chart.	s, and give pertinent da 230-0'. Dumped 2 sx state circulated out & outsite circulate. Shot @ 170a @ 280' pumped 400 states. WOC. Tagged cement @ 154a 1. WOC & drilled out to the to a 1853'. Waiting or	gram of proposed complet and on RBP. WOC job. ide surface casing. 0'. WOC job. x Cl C 3% CaCl, displaced 0', drilling hard cement to 0 1968'. In pressure test after packe
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD fluid settles. Well had 20# dro	completed operatised work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling. Tbg @ 1968', pt sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cemental plastic coated proportion work.	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze l amped 25 sx C 2' circulated out 8 agged cement at acter, 2 3/8" pla rkover unit. Wil	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen hole @ 1950'-couldn's CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaC stic coated tubing & s l re-test w/chart.	s, and give pertinent das: Attach wellbore diags 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700@ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 15401. WOC & drilled out to tet @ 1853'. Waiting or ledge and belief.	gram of proposed completer and on RBP. WOC job. ide surface casing. O'. WOC job. at Cl C 3% CaCl, displaced of Cl C 3% CaCl, dis
13. Describe proposed or of starting any propos or recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD-fluid settles. Well had 20# dro	completed operatised work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling. Tbg @ 1968', pt sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cemental plastic coated proportion work.	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze l amped 25 sx C 2' circulated out 8 agged cement at acter, 2 3/8" pla rkover unit. Wil	OTHER: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cemen hole @ 1950'-couldn's CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaC stic coated tubing & s l re-test w/chart.	s, and give pertinent das: Attach wellbore diags 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700@ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 15401. WOC & drilled out to tet @ 1853'. Waiting or ledge and belief.	gram of proposed completer and on RBP. WOC job. ide surface casing. O'. WOC job. at Cl C 3% CaCl, displaced of the completer
13. Describe proposed or of starting any proposor recompletion. 10-17/31-05: Rigged up. Set R 11-28-06: Rig up Rising Star, 12-1-05: Drilled out cement. 12-9-05: Rigged up cementers w/32 bbls 800 psi. Mixed 200 12-13/16-05: Drill out cement, 1967'. 12-17-05: Tubing @ 12-28-05: Went in hole w/AD fluid settles. Well had 20# dro	completed operatised work). SEE R RBP @2445', Press Cement w/400 sx 12-5-05: Wireling. Tbg @ 1968', pt sx C1 C 3% CaCl , fell out @ 243', to 1968', rig up cemental plastic coated proportion work.	ions. (Clearly st ULE 1103. For sure test, did not Cl C 2% CaCl 1 ne shot squeeze l imped 25 sx C 2' circulated out 8 lagged cement at lenters, pumped a acker, 2 3/8" pla rkover unit. Will	other: ate all pertinent details Multiple Completions hold. Ran bond log-2. 32 cu/ft; 75 sx cement hole @ 1950'-couldn's CaCl. Cmt retainer 5/8" & outside 8 5/8"- hove retainer @ 265'. 50 sx Cl C w/2% CaCl stic coated tubing & stircest w/chart.	s, and give pertinent das: Attach wellbore diags 230-0'. Dumped 2 sx sat circulated out & outsit circulate. Shot @ 1700 @ 280' pumped 400 sx 45 sx to pit. WOC. Tagged cement @ 1540 1. WOC & drilled out to tet @ 1853'. Waiting or ledge and belief. Telephone No. 432 68	gram of proposed completer and on RBP. WOC job. ide surface casing. O'. WOC job. at Cl C 3% CaCl, displaced of the completer