Form 3160-5 (February 2005)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

NOV 0520

FORM APPROVED OMB No. 1004-0137 Expires: March 31, 2007

5. Lease Serial No.

1. Type of Well Oil Well Gas Well Other Water Injection 8. We The State of Operator State of Operator One of Operator Operato	Start/Resume) Water Shut-Off Well Integrity Other Abandon al proposed work and approximate duration thereof. ertical depths of all pertinent markers and zones. subsequent reports must be filed within 30 days a new interval. a Form 3160-4 must be filed once
Case well	ederal Q 1 Well No. 30-015-04068 eld and Pool or Exploratory Area quare Lake GB SA cuntry or Parish, State Eddy NM PORT OR OTHER DATA Start/Resume)
2. Name of Operation CBS Operating Corp. 3a. Address P O Box 2236 Midland TX 79702 4. Location of Well Footage, Sec., T.,R.M., or Survey Description) 660' FNL & 660' FWL Sec 3 T17S R30E 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, RE TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Acidize Convert to Injection Change Plans Plug and Abandon Temporarily Convert to Injection Change Plans Plug and Abandon Temporarily Convert to Injection The plug Back Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BlA. Required following completed. Final Abandonment Notice must be filed only after all requirements, including reclams determined that the site is ready for final inspection.) Mi&RU Mayo Marrs 10-3-2007. RIH and tag CIBP @ 2747'. Fill hole with plugging mud. Spot 25 sx cement on top of CIBP @ 2745'. WOC. RIH and tag @ 2480'. RIH & perforate @ 1400'. RIH with packer and plug tested to 2200 and spot 30 sx cement (@ 1450'. POH. WOC. RIH and tag @ 445'. Wash down to 620'. Spot 40 sx cement. WOC. Tag @ 392'. RIH and tag @ 265'. RIH and perforate @ 170'. RIH with packer, pump 55 sx cement. Tag @ 80'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation. Tag @ 80'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation. Tag @ 24'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation.	ederal Q 1 Well No. 30-015-04068 eld and Pool or Exploratory Area quare Lake GB SA cuntry or Parish, State Eddy NM PORT OR OTHER DATA Start/Resume)
Address P O Box 2236 Midland TX 79702 4. Location of Well Frotage, Sec., T.R.M., or Survey Description) 660' FNL & 660' FWL Sec' 3 T175 R30E 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, RE TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Addize Deepen Production Recomplete Classing Repair New Construction Recomplete Change Plans Plug and Abandon Temporarily Final Abandonment Notice 3. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of an the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true valuation the work will be performed or provide the Bond No. on file with BLM/BIA. Required following completion of the involved operations. If the operation results in a multiple completion or recompletion in testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclams determined that the site is ready for final inspection.) MI&RU Mayo Marrs 10-3-2007. RIH and tag CIBP @ 2747'. Fill hole with plugging mud. Spot 25 sx cement on top of CIBP @ 2745'. WOC. Tag plug @ 2480' RIH & perforate @ 1400'. RIH with packer and plug tested to 2200 and spot 30 sx cement @ 1450'. POH. WOC. RIH and tag @ 1146'. Cut 5-1/2" casing @ 550' and pull out of hole. Laid down all 55 RIH and perforate @ 392' as per BLM. RIH with bubing and packer. Pump 50 sx cement. RIH and perforate @ 392'. Spot 40 sx cement. WOC. Tag @ 392'. RIH and tag @ 265'. RIH and perforate @ 170'. RIH with packer, pump 65 sx cement. Tag @ 80'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation. Tag @ 80'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation.	30-015-04068 eld and Pool or Exploratory Area quare Lake GB SA untry or Parish, State Eddy NM PORT OR OTHER DATA Start/Resume)
Address P O Box 2236	eld and Pool or Exploratory Area QUATE Lake GB SA untry or Parish, State Eddy NM PORT OR OTHER DATA Start/Resume)
Midland TX 79702 432/685-0878 Location of Well (Footage, Sec., T.R.M., or Survey Description) 660' FNL & 660' FWL Sec 3 T17S R30E 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, RE TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent	quare Lake GB SA untry or Parish, State Eddy NM PORT OR OTHER DATA Start/Resume)
Location of Well (Footage, Sec., T.R.M., or Survey Description) 660' FNL & 660' FWL Sec 3 T17S R30E 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, RE TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent	entry or Parish, State Eddy NM CORT OR OTHER DATA Start/Resume)
12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, RE TYPE OF SUBMISSION Acidize	Eddy NM CORT OR OTHER DATA Start/Resume)
TYPE OF SUBMISSION Notice of Intent	Start/Resume)
Acidize Deepen	Well Integrity Other Abandon al proposed work and approximate duration thereof. ertical depths of all pertinent markers and zones. subsequent reports must be filed within 30 days a new interval, a Form 3160-4 must be filed once
Alter Casing Fracture Treat Reclamation Recomplete Change Plans Plug and Abandon Temporarily Plug and Abandon Temporarily Plug and Abandon Temporarily Plug Back Water Disposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true value the Bond no. of file with BLM/BLA. Required following completion of the involved operations. If the operation results in a multiple completion or recompletion is testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamate determined that the site is ready for final inspection.) MI&RU Mayo Marrs 10-3-2007. RIH and tag CIBP @ 2747'. Fill hole with plugging mud. Spot 25 sx cement on top of CIBP @ 2745'. WOC. Tag plug @ 2480'. RIH & perforate @ 1400'. RIH with packer and plug tested to 2200 and spot 30 sx cement @ 1450'. POH. WOC. RIH and tag @ 1146'. Cut 5-1/2" casing @ 550' and pull out of hole. Laid down all 55 RIH and tag @ 445'. Wash down to 620'. Spot 40 sx cement. WOC. Tag @ 392'. RIH and perforate @ 392' as per BLM. RIH with tubing and packer. Pump 50 sx cement RIH and tag @ 265'. RIH and perforate @ 170'. RIH with packer, pump 65 sx cement. Tag @ 30'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation. Tag @ 24'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation.	Well Integrity Other Abandon al proposed work and approximate duration thereof. ertical depths of all pertinent markers and zones. subsequent reports must be filed within 30 days a new interval, a Form 3160-4 must be filed once
Alter Casing Fracture Treat Reclamation Casing Repair New Construction Recomplete Casing Repair New Construction Recomplete Change Plans Plug and Abandon Temporarily Plug Back Water Disposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true of Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required following completion of the involved operations. If the operation results in a multiple completion or recompletion it testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamated that the site is ready for final inspection.) MI&RU Mayo Marrs 10-3-2007. RIH and tag CIBP @ 2747'. Fill hole with plugging mud. Spot 25 sx cement on top of CIBP @ 2745'. WOC. Tag plug @ 2480'. RIH & perforate @ 1400'. RIH with packer and plug tested to 2200 and spot 30 sx cement @ 1450'. POH. WOC. RIH and tag @ 1146'. Cut 5-1/2" casing @ 550' and pull out of hole. Laid down all 55 RIH and tag @ 445'. Wash down to 620'. Spot 40 sx cement. WOC. Tag @ 392'. RIH and perforate @ 392' as per BLM. RIH with tubing and packer. Pump 50 sx cement. RIH and tag @ 265'. RIH and perforate @ 170'. RIH with packer, pump 65 sx cement. Tag @ 80'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation. Tag @ 24'. Call BLM. Fill casing with 15 sx cement to surface.	Abandon al proposed work and approximate duration thereof. ertical depths of all pertinent markers and zones. subsequent reports must be filed within 30 days a new interval, a Form 3160-4 must be filed once
Change Plans Change Plans Plug and Abandon Temporarily Plug Back Water Dispos Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true value of the Bond under which the work will be performed or provide the Bond No. on file with BLMBIA. Required following completion of the involved operations. If the operation results in a multiple completion or recompletion in testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclams determined that the site is ready for final inspection.) MI&RU Mayo Marrs 10-3-2007. RIH and tag CIBP @ 2747'. Fill hole with plugging mud. Spot 25 sx cement on top of CIBP @ 2745'. WOC. Tag plug @ 2480'. RIH & perforate @ 1400'. RIH with packer and plug tested to 2200 and spot 30 sx cement @ 1450'. POH. WOC. RIH and tag @ 1146'. Cut 5-1/2" casing @ 550' and pull out of hole. Laid down all 55 RIH and tag @ 445'. Wash down to 620'. Spot 40 sx cement. WOC. Tag @ 392'. RIH and perforate @ 392' as per BLM. RIH with tubing and packer. Pump 50 sx cement. RIH and tag @ 265'. RIH and perforate @ 170'. RIH with packer, pump 65 sx cement. Tag @ 80'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation. Tag @ 24'. Call BLM. Fill casing with 15 sx cement to surface.	Abandon al proposed work and approximate duration thereof. ertical depths of all pertinent markers and zones. subsequent reports must be filed within 30 days a new interval, a Form 3160-4 must be filed once
Change Plans	al r proposed work and approximate duration thereof. ertical depths of all pertinent markers and zones. subsequent reports must be filed within 30 days a new interval, a Form 3160-4 must be filed once
Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true valuable to the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required following completion of the involved operations. If the operation results in a multiple completion or recompletion it testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclams determined that the site is ready for final inspection.) MI&RU Mayo Marrs 10-3-2007. RIH and tag CIBP @ 2747'. Fill hole with plugging mud. Spot 25 sx cement on top of CIBP @ 2745'. WOC. Tag plug @ 2480'. RIH & perforate @ 1400'. RIH with packer and plug tested to 2200 and spot 30 sx cement @ 1450'. POH. WOC. RIH and tag @ 1146'. Cut 5-1/2" casing @ 550' and pull out of hole. Laid down all 550. RIH and tag @ 445'. Wash down to 620'. Spot 40 sx cement. WOC. Tag @ 392'. RIH and perforate @ 392' as per BLM. RIH with tubing and packer. Pump 50 sx cement. RIH and tag @ 265'. RIH and perforate @ 170'. RIH with packer, pump 65 sx cement. Tag @ 80'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation. Tag @ 24'. Call BLM. Fill casing with 15 sx cement to surface.	al r proposed work and approximate duration thereof, ertical depths of all pertinent markers and zones, subsequent reports must be filed within 30 days a new interval, a Form 3160-4 must be filed once
Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true of Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required following completion of the involved operations. If the operation results in a multiple completion or recompletion in testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclams determined that the site is ready for final inspection.) MI&RU Mayo Marrs 10-3-2007. RIH and tag CIBP @ 2747'. Fill hole with plugging mud. Spot 25 sx cement on top of CIBP @ 2745'. WOC. Tag plug @ 2480'. RIH & perforate @ 1400'. RIH with packer and plug tested to 2200 and spot 30 sx cement @ 1450'. POH. WOC. RIH and tag @ 1146'. Cut 5-1/2" casing @ 550' and pull out of hole. Laid down all 55 RIH and tag @ 445'. Wash down to 620'. Spot 40 sx cement. WOC. Tag @ 392'. RIH and perforate @ 392' as per BLM. RIH with tubing and packer. Pump 50 sx cement. RIH and tag @ 265'. RIH and perforate @ 170'. RIH with packer, pump 65 sx cement. Tag @ 80'. Call BLM. RIH and perforate @ 60'. Pumped 65 sx cement, no circulation. Tag @ 24'. Call BLM. Fill casing with 15 sx cement to surface.	proposed work and approximate duration thereof ertical depths of all pertinent markers and zones, subsequent reports must be filed within 30 days a new interval, a Form 3160-4 must be filed once
	o' of casing. at @ 392'. WOC. WOC. WOC. Accepted for reco
I hereby certify that the foregoing is true and correct. Name (Printed/Typed)	
M. A. Sirgo, III Title Engineer	
Signature Date October 17, 2	007
THIS SPACE FOR FEDERAL OR STATE OFFICE U	.007
/S/ DAVID R. GLASS	

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.