Submit 1 Copy To Appropriate District	State of N	lew Mexico	Form C-103 PM	
Office , , District I	Energy, Minerals as	nd Natural Resources	October 13, 2009	
1625 N. French Dr., Hobbs, NM 88240 District II	*		WELL API NO. 30-015-34005	
1301 W. Grand Ave., Artesia, NM 88210		ATION DIVISION	5. Indicate Type of Lease	
District III 1000 Rio Brazos Rd., Aztec, NM 87410		St. Francis Dr.	STATE FEE	
District IV	Santa Fe,	NM 87505	6. State Oil & Gas Lease No.	
1220 S. St. Francis Dr., Santa Fe, NM 87505				
SUNDRY NOT	ICES AND REPORTS ON		7. Lease Name or Unit Agreement Name	
(DO NOT USE THIS FORM FOR PROPODIFFERENT RESERVOIR. USE "APPLI PROPOSALS.)	ICATION FOR PERMIT" (FORM	C-THE FOR SUCH	Red Lake 28 K State	
PROPOSALS.)	Gas Well  Other	RECEIVEL	8. Well Number 2	
1. Type of Well: Oil Well 2. Name of Operator	Gas Well  Other	NOV - 9 2009	9. OGRID Number	
Edge Petrole	um Operating Company, Inc		224400 10. Pool name or Wildcat	
3. Address of Operator 1301 Travis	Ste. 2000 Houston, TX 7	NMOCD ARTES	Artesia; Glorieta-Yeso (O)	
4. Well Location				
	feet from the South line	and 2310 feet fr	om the West line	
			IPM Eddy County	
	11. Elevation (Show whe			
	3653'GL			
12. Check	12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data			
			•	
NOTICE OF IN	NTENTION TO: PLUG AND ABANDON	☐ REMEDIAL W	JBSEQUENT REPORT OF: DRK ⊠ ALTERING CASING □	
TEMPORARILY ABANDON			DRILLING OPNS. P AND A	
PULL OR ALTER CASING		☐ CASING/CEMI	<del></del>	
DOWNHOLE COMMINGLE				
OTHER:		OTHER:	<u>L</u> _	
1. Describe proposed or comp		state all pertinent details,	and give pertinent dates, including estimated date	
Describe proposed or composed of starting any proposed w	ork). SEE RULE 19.15.7.1	state all pertinent details,	and give pertinent dates, including estimated date  Completions: Attach wellbore diagram of	
Describe proposed or comp of starting any proposed w proposed completion or rec	ork). SEE RULE 19.15.7.1 completion.	state all pertinent details, 4 NMAC. For Multiple	Completions: Attach wellbore diagram of	
Describe proposed or composed of starting any proposed we proposed completion or reconstruction.  11-04-09 TP-0, CP-0. Unhur	ork). SEE RULE 19.15.7.1 completion.  ng well, PU rods, fished part	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7	Completions: Attach wellbore diagram of 7/8" rods, 3/4" pin x 2" pump 18'. No gas anchor.	
Describe proposed or composed of starting any proposed we proposed completion or reconstruction of the starting any proposed with the proposed completion or reconstruction.  TP-0, CP-0. Unhur Mix 5 gal chemical	ork). SEE RULE 19.15.7.1 completion.  ng well, PU rods, fished part ls w/ 35 bbls oil, pump hot of	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 bil down tbg, dropped sta	Completions: Attach wellbore diagram of 7/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. nding valve. Took 10 bbls to load tbg, test tbg to	
1. Describe proposed or composed of starting any proposed we proposed completion or reconstruction of the starting any proposed we proposed completion or reconstruction.  11-04-09 TP-0, CP-0. Unhur Mix 5 gal chemical 3500# - held. RU 6 SWI SDFN	cork). SEE RULE 19.15.7.15 completion.  In well, PU rods, fished part ls w/ 35 bbls oil, pump hot of & RIH w/ fishing tool, fish seems.	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 bil down tbg, dropped sta S/V & POOH. PU pump	Completions: Attach wellbore diagram of 1/8" rods, ¾" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.	
1. Describe proposed or composed of starting any proposed we proposed completion or recomposed completion of the composed completion of the com	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot can be a RIH w/ fishing tool, fish spsi. Bled well down, GIH v	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 bil down tbg, dropped sta S/V & POOH. PU pump w/ polish rod, polish rod 1	Completions: Attach wellbore diagram of 1/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  iner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,	
1. Describe proposed or composed of starting any proposed we proposed completion or recomposed completion of the composed completion of the com	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot can be a RIH w/ fishing tool, fish the psi. Bled well down, GIH wr. Changed out all boxes to	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 oil down tbg, dropped sta S/V & POOH. PU pump w/ polish rod, polish rod 1 7/8" full hole spray meta	Completions: Attach wellbore diagram of 1/8" rods, ¾" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.	
1. Describe proposed or composed of starting any proposed we proposed completion or recomposed completion of the composed completion of the com	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot can be a RIH w/ fishing tool, fish spsi. Bled well down, GIH v	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 oil down tbg, dropped sta S/V & POOH. PU pump w/ polish rod, polish rod 1 7/8" full hole spray meta	Completions: Attach wellbore diagram of 1/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  iner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,	
1. Describe proposed or composed starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompos	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot can be a RIH w/ fishing tool, fish the psi. Bled well down, GIH wr. Changed out all boxes to	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 oil down tbg, dropped sta S/V & POOH. PU pump w/ polish rod, polish rod 1 7/8" full hole spray meta	Completions: Attach wellbore diagram of 1/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  iner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,	
1. Describe proposed or composed of starting any proposed we proposed completion or recomposed completion of the composed completion of the com	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot can be a RIH w/ fishing tool, fish the psi. Bled well down, GIH wr. Changed out all boxes to	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 oil down tbg, dropped sta S/V & POOH. PU pump w/ polish rod, polish rod 1 7/8" full hole spray meta	Completions: Attach wellbore diagram of 1/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  iner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,	
1. Describe proposed or composed starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompos	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot can be a RIH w/ fishing tool, fish the psi. Bled well down, GIH wr. Changed out all boxes to	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 oil down tbg, dropped sta S/V & POOH. PU pump w/ polish rod, polish rod 1 7/8" full hole spray meta	Completions: Attach wellbore diagram of 1/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  iner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,	
1. Describe proposed or composed starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompos	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot can be a RIH w/ fishing tool, fish the psi. Bled well down, GIH wr. Changed out all boxes to	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 oil down tbg, dropped sta S/V & POOH. PU pump w/ polish rod, polish rod 1 7/8" full hole spray meta	Completions: Attach wellbore diagram of 1/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  iner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,	
1. Describe proposed or composed starting any proposed we proposed completion or recomposed we proposed completion or recomposed completion or recomposed completion or recomposed completion or recomposed with the second	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part is w/35 bbls oil, pump hot of a RIH w/ fishing tool, fish is psi. Bled well down, GIH wr. Changed out all boxes to circ. – 100% water, turn well	state all pertinent details, 4 NMAC. For Multiple of the ded rod. POOH w/ 142-7 and down the details of the ded rod. POOH w/ 142-7 and down the details of t	Completions: Attach wellbore diagram of 1/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  iner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,	
1. Describe proposed or composed starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompos	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part is w/35 bbls oil, pump hot of a RIH w/ fishing tool, fish is psi. Bled well down, GIH wr. Changed out all boxes to circ. – 100% water, turn well	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 oil down tbg, dropped sta S/V & POOH. PU pump w/ polish rod, polish rod 1 7/8" full hole spray meta	Completions: Attach wellbore diagram of 1/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  iner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,	
1. Describe proposed or composed starting any proposed we proposed completion or recomposed we proposed completion or recomposed completion or recomposed completion or recomposed completion or recomposed with the second	cork). SEE RULE 19.15.7.15 completion.  Ing well, PU rods, fished part is w/35 bbls oil, pump hot of a RIH w/ fishing tool, fish is psi. Bled well down, GIH wr. Changed out all boxes to circ. – 100% water, turn well	state all pertinent details, 4 NMAC. For Multiple of the ded rod. POOH w/ 142-7 and down the details of the ded rod. POOH w/ 142-7 and down the details of t	Completions: Attach wellbore diagram of 1/8" rods, 3/4" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  iner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,	
1. Describe proposed or composed starting any proposed we proposed completion or recomplete to the proposed completion or recomplete to the proposed completion or recomplete to the proposed complete to the proposed compl	rork). SEE RULE 19.15.7.1. completion.  Ing well, PU rods, fished part is w/35 bbls oil, pump hot of & RIH w/ fishing tool, fish is psi. Bled well down, GIH v. Changed out all boxes to circ. – 100% water, turn well	state all pertinent details, 4 NMAC. For Multiple of the ded rod. POOH w/ 142-7 and the down the details of the	Completions: Attach wellbore diagram of 7/8" rods, ¾" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  Siner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub, 1 boxes. Hung well on, load tbg w/ 12 bbls, test to	
1. Describe proposed or composed starting any proposed we proposed completion or recompletion or recompletion or recomposed completion of the starting any proposed we proposed completion or recomposed completion or recomposed completion or recomposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recomposed comple	rork). SEE RULE 19.15.7.1. completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot of RIH w/ fishing tool, fish spsi. Bled well down, GIH wr. Changed out all boxes to circ. – 100% water, turn well above is true and complete	state all pertinent details, 4 NMAC. For Multiple of the ded rod. POOH w/ 142-70 poil down tbg, dropped states S/V & POOH. PU pump to polish rod, polish rod 17/8" full hole spray metall over to production.	Completions: Attach wellbore diagram of 1/8" rods, ¾" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  Siner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub, 1 boxes. Hung well on, load tbg w/ 12 bbls, test to rodge and belief.	
1. Describe proposed or composed starting any proposed we proposed completion or recomplete to the proposed completion or recomplete to the proposed completion or recomplete to the proposed complete to the proposed compl	rork). SEE RULE 19.15.7.1. completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot of RIH w/ fishing tool, fish spsi. Bled well down, GIH wr. Changed out all boxes to circ. – 100% water, turn well above is true and complete	state all pertinent details, 4 NMAC. For Multiple of the ded rod. POOH w/ 142-7 and the down the details of the	Completions: Attach wellbore diagram of 7/8" rods, ¾" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  Siner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub, 1 boxes. Hung well on, load tbg w/ 12 bbls, test to	
1. Describe proposed or composed starting any proposed we proposed completion or recomposed completion of the starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion	rork). SEE RULE 19.15.7.1 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot of & RIH w/ fishing tool, fish fishing tool, fished part ls with the part ls with the fishing tool, f	state all pertinent details, 4 NMAC. For Multiple of the ded rod. POOH w/ 142-70 poil down tbg, dropped states S/V & POOH. PU pump to polish rod, polish rod 17/8" full hole spray metall over to production.	Completions: Attach wellbore diagram of  7/8" rods, ¾" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to  & GIH, changed 40 rod boxes going in hole.  Indiner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub, I boxes. Hung well on, load tbg w/ 12 bbls, test to  Edge and belief.  DATE_11/06/2009	
1. Describe proposed or composed was proposed completion or recompleted and proposed was proposed completion or recompleted and the second starting any proposed was proposed completed or recompleted and second so the second se	rork). SEE RULE 19.15.7.1 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot of & RIH w/ fishing tool, fish fishing tool, fished part ls with the part ls with the fishing tool, f	state all pertinent details, 4 NMAC. For Multiple of ted rod. POOH w/ 142-7 bil down tbg, dropped sta S/V & POOH. PU pump w/ polish rod, polish rod 1 7/8" full hole spray meta Il over to production.  elease Date:  to the best of my knowled  Angela Lightner	Completions: Attach wellbore diagram of  1/8" rods, ¾" pin x 2" pump 18'. No gas anchor.  Inding valve. Took 10 bbls to load tbg, test tbg to  & GIH, changed 40 rod boxes going in hole.  Inter, 1 pony rod, 142- 7/8" steel rods, 1 lift sub,  I boxes. Hung well on, load tbg w/ 12 bbls, test to  added and belief.  DATE_11/06/2009	
1. Describe proposed or composed starting any proposed we proposed completion or recomposed completion of the recomposed completion or recompletion or recomposed completion or recompletion or recompletion or recompletion or recomposed completion	rork). SEE RULE 19.15.7.1 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot of & RIH w/ fishing tool, fish spsi. Bled well down, GIH wr. Changed out all boxes to circ. – 100% water, turn well above is true and complete E-mail action.	state all pertinent details, 4 NMAC. For Multiple of the ded rod. POOH w/ 142-70 bil down tbg, dropped states S/V & POOH. PU pump v/ polish rod, polish rod 17/8" full hole spray metall over to production.  Clease Date:  to the best of my knowled to the best of my knowled angela@rkford.co	Completions: Attach wellbore diagram of 7/8" rods, ¾" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to & GIH, changed 40 rod boxes going in hole.  Siner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub, 1 boxes. Hung well on, load tbg w/ 12 bbls, test to redge and belief.  DATE_11/06/2009  PHONE: 432-682-0440	
1. Describe proposed or composed starting any proposed we proposed completion or recompletion or recompletion or recomposed completion of the starting any proposed we proposed completion or recomposed completion or recomposed completion or recomposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recomposed comple	rork). SEE RULE 19.15.7.1 completion.  Ing well, PU rods, fished part ls w/ 35 bbls oil, pump hot of & RIH w/ fishing tool, fish fishing tool, fished part ls with the part ls with the fishing tool, f	state all pertinent details, 4 NMAC. For Multiple of the ded rod. POOH w/ 142-70 bil down tbg, dropped states S/V & POOH. PU pump v/ polish rod, polish rod 17/8" full hole spray metall over to production.  Clease Date:  to the best of my knowled to the best of my knowled angela@rkford.co	Completions: Attach wellbore diagram of  7/8" rods, ¾" pin x 2" pump 18'. No gas anchor. Inding valve. Took 10 bbls to load tbg, test tbg to  & GIH, changed 40 rod boxes going in hole.  Indiner, 1 pony rod, 142- 7/8" steel rods, 1 lift sub, I boxes. Hung well on, load tbg w/ 12 bbls, test to  Edge and belief.  DATE_11/06/2009	