·Office -	State of New Mexic			Form C-103	
District I	Energy, Minerals and Natural	Resources	WELL ADING	May 27, 2004	
1625 N. French Dr., Hobbs, NM 88240 District II			WELL API NO. 30-015-30163		
1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATION DIVISION		5. Indicate Type of Le	ease	
<u>District III</u> 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.		STATE	FEE 🛛	
District IV	Santa Fe, NM 87505		6. State Oil & Gas Le		
1220 S. St. Francis Dr., Santa Fe, NM 87505					
	CES AND REPORTS ON WELLS		7. Lease Name or Uni	t Agreement Name	
	SALS TO DRILL OR TO DEEPEN OR PLUG CATION FOR PERMIT" (FORM C-101) FOR S			•	
PROPOSALS.)	ATION FOR FERMIT (FORM C-101) FOR	soen	Ogden	·	
	Gas Well Other		8. Well Number 3		
2. Name of Operator		·	9. OGRID Number	260297	
BTA Oil Producers LLC 3. Address of Operator			10. Pool name or Wild	deat	
104 S. Pecos, Midland, TX 79701		Loving, Delaware South 40380			
4. Well Location			201116, 201411410 304		
Unit Letter \underline{J} : 1980 feet from the south line and 2130 feet from the east line					
Section 29		ange 28E	NMPM Eddy	y County	
	11. Elevation (Show whether DR, R.	KB, RT, GR, etc.)			
Pit or Below-grade Tank Application ☐ o					
	 	n and Dista			
	aterDistance from nearest fresh wate		nce from nearest surface w	ater	
Pit Liner Thickness: mil	Below-Grade Tank: Volume		struction Material		
12. Check A	Appropriate Box to Indicate Natu	are of Notice, F	Report or Other Dat	a	
NOTICE OF IN	TENTION TO:	SLIBS	EQUENT REPOR	DT OF	
PERFORM REMEDIAL WORK		REMEDIAL WORK		TERING CASING	
TEMPORARILY ABANDON		COMMENCE DRIL	-	ND A	
PULL OR ALTER CASING	= 1	ASING/CEMENT		, to t	
_	_				
OTHER:		THER:			
13. Describe proposed or comp	leted operations. (Clearly state all per	tinent details, and	give pertinent dates, in	cluding estimated date	
or recompletion.	of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion				
•			וחן	FCEIVED	
BTA P&A'd this well as follow	vs:		וחו	ECEIVED	
	vs:			ECEIVED Feb 07 2011	
01/21-27/11				}	
01/21-2 <u>7/11</u> 1) MI & RU plugging t	ınit. Move pumping unit. ND WH. NU E		NMC	ECEIVED FEB 07 2011 OCD ARTESIA	
01/21-27/11 1) MI & RU plugging to 4 2) RIH open-ended to 4	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C		NMC	}	
1) MI & RU plugging to 2) RIH open-ended to 4 3) POH w/tbg to 2580' 4) Spot P&A plug as for	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C llows: 35 sx Cl C @ 2225' to 2580'. POH	C cmt on top of CIBI I to 740'. WOC, tag	NMC 2 from 4227-4480'.	OCD ARTESIA	
1) MI & RU plugging to 2) RIH open-ended to 4 3) POH w/tbg to 2580' 4) Spot P&A plug as fo 5) Perf csg @ 1050'. R	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C ollows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C	C cmt on top of CIBI I to 740'. WOC, tag	NMC 2 from 4227-4480'.	OCD ARTESIA	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580° 4) Spot P&A plug as fo 5) Perf csg @ 1050°. R 6) POH w/tbg. ND BC	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C ollows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C	C cmt on top of CIBI I to 740'. WOC, tag cmt and displ to 940	NMC 2 from 4227-4480'.	OCD ARTESIA	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580° 4) Spot P&A plug as fo 5) Perf csg @ 1050°. R 6) POH w/tbg. ND BO 7) Perf csg @ 60°. Sqz	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C ollows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C	C cmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO.	P from 4227-4480'. @ 2213'. '. WOC, tag plug @ 937'	OCD ARTESIA	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580° 4) Spot P&A plug as for 5) Perf csg @ 1050°. R 6) POH w/tbg. ND BO 7) Perf csg @ 60°. Sqz 8) Move in backhoe and 9) Cut off anchors. Bac	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C ollows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C oP. 25 sx Cl C cmt to surf. Verify cmt at surf. d welder. Dug out cellar. Cut off WH and	C cmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO.	P from 4227-4480'. @ 2213'. '. WOC, tag plug @ 937'	OCD ARTESIA	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580' 4) Spot P&A plug as for 5) Perf csg @ 1050'. R 6) POH w/tbg. ND BO 7) Perf csg @ 60'. Sqz 8) Move in backhoe and	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C ollows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C oP. 25 sx Cl C cmt to surf. Verify cmt at surf. d welder. Dug out cellar. Cut off WH and	C cmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO.	P from 4227-4480'. @ 2213'. '. WOC, tag plug @ 937'	OCD ARTESIA	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580° 4) Spot P&A plug as for 5) Perf csg @ 1050°. R 6) POH w/tbg. ND BO 7) Perf csg @ 60°. Sqz 8) Move in backhoe and 9) Cut off anchors. Bac	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C ollows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C oP. 25 sx Cl C cmt to surf. Verify cmt at surf. d welder. Dug out cellar. Cut off WH and	C cmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO.	P from 4227-4480'. @ 2213'. '. WOC, tag plug @ 937'	OCD ARTESIA	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580' 4) Spot P&A plug as for 5) Perf csg @ 1050'. R 6) POH w/tbg. ND BO 7) Perf csg @ 60'. Sqz 8) Move in backhoe and 9) Cut off anchors. Backnown and Clean location.	anit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C bllows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C PP 25 sx Cl C cmt to surf. Verify cmt at surf. d welder. Dug out cellar. Cut off WH and ck filled cellar. above is true and complete to the best	C cmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO. I csg 6' below groun of my knowledge	P from 4227-4480'. @ 2213'. '. WOC, tag plug @ 937' d level, weld on a dry hol	OCD ARTESIA	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580' 4) Spot P&A plug as for 5) Perf csg @ 1050'. R 6) POH w/tbg. ND BO 7) Perf csg @ 60'. Sqz 8) Move in backhoe and 9) Cut off anchors. Backnown and Clean location.	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C ollows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C oP. .25 sx Cl C cmt to surf. Verify cmt at surf. d welder. Dug out cellar. Cut off WH and ck filled cellar.	C cmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO. I csg 6' below groun of my knowledge	P from 4227-4480'. @ 2213'. '. WOC, tag plug @ 937' d level, weld on a dry hol	OCD ARTESIA	
1) MI & RU plugging to 2) RIH open-ended to 4 3) POH w/tbg to 2580° 4) Spot P&A plug as for 5) Perf csg @ 1050°. R 6) POH w/tbg. ND BC 7) Perf csg @ 60°. Sqz 8) Move in backhoe and 9) Cut off anchors. Bactorial Clean location. I hereby certify that the information grade tank has been/will be constructed or	unit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C collows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C above is true and complete to the best closed according to NMOCD guidelines \(\), 2	C cmt on top of CIBI I to 740'. WOC, tag cmt and displ to 940 RD MO. I csg 6' below groun of my knowledge a general permit o	NMC P from 4227-4480'. @ 2213'. ". WOC, tag plug @ 937' d level, weld on a dry hole and belief. I further cer r an (attached) alternative	OCD ARTESIA Tify that any pit or below-OCD-approved plan .	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580' 4) Spot P&A plug as for 5) Perf csg @ 1050'. R 6) POH w/tbg. ND BO 7) Perf csg @ 60'. Sqz 8) Move in backhoe and 9) Cut off anchors. Backnown and Clean location. I hereby certify that the information grade tank has been/will be constructed or SIGNATURE	init. Move pumping unit. ND WH. NU El480'. Tag CIBP @ 4480', spot 25 sx Cl C. Illows: 35 sx Cl C @ 2225' to 2580'. POH. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar.	C cmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO. I csg 6' below groun of my knowledge a general permit oegulatory Adminis	P from 4227-4480'. @ 2213'. '' WOC, tag plug @ 937' d level, weld on a dry hole and belief. I further cer r an (attached) alternative	OCD ARTESIA Tify that any pit or below-OCD-approved plan . TE_01/31/2011	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580° 4) Spot P&A plug as for 5) Perf csg @ 1050°. R 6) POH w/tbg. ND BC 7) Perf csg @ 60°. Sqz 8) Move in backhoe and 9) Cut off anchors. Backloe and 10) Clean location. I hereby certify that the information grade tank has been/will be constructed or SIGNATURE	init. Move pumping unit. ND WH. NU El480'. Tag CIBP @ 4480', spot 25 sx Cl C. Illows: 35 sx Cl C @ 2225' to 2580'. POH. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IH w/pkr and set @ 740'. Sqz 50 sx Cl C. IP. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar. IF Sqz 50 sx Cl C cmt to surf. Verify cmt at surf. dealer. Cut off WH and set filled cellar.	C cmt on top of CIBI I to 740'. WOC, tag cmt and displ to 940 RD MO. I csg 6' below groun of my knowledge a general permit o	P from 4227-4480'. @ 2213'. '' WOC, tag plug @ 937' d level, weld on a dry hole and belief. I further cer r an (attached) alternative	OCD ARTESIA Tify that any pit or below-OCD-approved plan .	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580' 4) Spot P&A plug as for 5) Perf csg @ 1050'. R 6) POH w/tbg. ND BO 7) Perf csg @ 60'. Sqz 8) Move in backhoe and 9) Cut off anchors. Backnown and Clean location. I hereby certify that the information grade tank has been/will be constructed or SIGNATURE	init. Move pumping unit. ND WH. NU El480'. Tag CIBP @ 4480', spot 25 sx Cl C. illows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C. iP. 25 sx Cl C cmt to surf. Verify cmt at surf. d welder. Dug out cellar. Cut off WH and ck filled cellar. above is true and complete to the best closed according to NMOCD guidelines \(\D \), a TITLE Re ep E-mail addres	Ecmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO. I csg 6' below groun of my knowledge a general permit oegulatory Adminis ss: pinskeep@bta	P from 4227-4480'. @ 2213'. ''. WOC, tag plug @ 937' d level, weld on a dry hole and belief. I further cer r an (attached) alternative trator DA oil.com Telephone	OCD ARTESIA Tify that any pit or below-OCD-approved plan . TE_01/31/2011	
1) MI & RU plugging to 2) RIH open-ended to 4 3) POH w/tbg to 2580' 4) Spot P&A plug as for 5) Perf csg @ 1050'. R 6) POH w/tbg. ND BC 7) Perf csg @ 60'. Sqz 8) Move in backhoe and 9) Cut off anchors. Back 10) Clean location. I hereby certify that the information grade tank has been/will be constructed or SIGNATURE Type or print name Pam Inske For State Use Only	anit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C Allows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C Allows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C Allows: 35 sx Cl C Allows: 36 sx Cl C Allows: 37 sx Cl C Allows: 37 sx Cl C Allows: 37 sx Cl C Allows: 38 sx c	C cmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO. I csg 6' below groun of my knowledge a general permit oegulatory Adminis ss: pinskeep@bta	P from 4227-4480'. @ 2213'. ''. WOC, tag plug @ 937' d level, weld on a dry hole and belief. I further cer r an (attached) alternative trator DA oil.com Telephone	OCD ARTESIA Tify that any pit or below- OCD-approved plan TE 01/31/2011 No. 432-682-3753	
1) MI & RU plugging to RIH open-ended to 4 3) POH w/tbg to 2580° 4) Spot P&A plug as for 5) Perf csg @ 1050°. R 6) POH w/tbg. ND BC 7) Perf csg @ 60°. Sqz 8) Move in backhoe and 9) Cut off anchors. Backloe and 10) Clean location. I hereby certify that the information grade tank has been/will be constructed or SIGNATURE	anit. Move pumping unit. ND WH. NU E 1480'. Tag CIBP @ 4480', spot 25 sx Cl C allows: 35 sx Cl C @ 2225' to 2580'. POH IH w/pkr and set @ 740'. Sqz 50 sx Cl C bP. 25 sx Cl C cmt to surf. Verify cmt at surf. d welder. Dug out cellar. Cut off WH and ck filled cellar. above is true and complete to the best closed according to NMOCD guidelines, and	E cmt on top of CIBl I to 740'. WOC, tag cmt and displ to 940 RD MO. I csg 6' below groun of my knowledge a general permit of egulatory Adminis ss: pinskeep@bta Approved for plugging Liability under bond is	P from 4227-4480'. @ 2213'. ''. WOC, tag plug @ 937' d level, weld on a dry hole and belief. I further cer r an (attached) alternative trator DA oil.com Telephone	OCD ARTESIA Tify that any pit or below- OCD-approved plan TE 01/31/2011 No. 432-682-3753	

Forms, www.cmnrd.state.nm.us/ocd.