

District I

1625 N. French Dr., Hobbs, NM 88240

District II

1301 W. Grand Ave., Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
October 13, 2009

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-21362
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Corinne Grace ✓		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 1418 Carlsbad, NM 88220		7. Lease Name or Unit Agreement Name Cuerva Unit ✓
4. Well Location Unit Letter <u>K</u> : <u>1980</u> feet from the <u>South</u> line and <u>1980</u> feet from the <u>West</u> line Section <u>6</u> Township <u>23 S</u> Range <u>26 E</u> NMPM <u>Eddy</u> County		8. Well Number <u>1</u> ✓
11. Elevation (Show whether DR, RKB, RT, GR, etc.) GL 3419 KB: 3437		9. OGRID Number 5268
		10. Pool name or Wildcat Sheep Draw:Strawn (gas)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
 DOWNHOLE COMMINGLE ☐

OTHER: ☐


SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPNS. ☐ P AND A ☒
 CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

SEE ATTACHED P & A

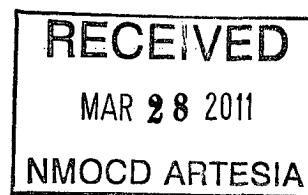

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Eddie W. Seay TITLE Agent DATE 3/24/11

Type or print name Eddie W. Seay E-mail address: seay04@leaco.net PHONE: 575-392-2236

For State Use Only

APPROVED BY: [Signature] TITLE

Conditions of Approval (if any):

Approved for plugging of well bore only.
Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OCD Web Page under Forms. www.emnrd.state.nm.us/oed.

DATE 3/29/2011

108

CUERVA UNIT #1 PLUG AND ABANDONMENT

Notified OCD Phil Hawkins

Move in Smith & Marrs 1/6/11 Start P & A

- 1) Pull production equipment
- 2) Drill out plugs down to 10931'
OCD approved to start setting plugs.
- 3) Set 100 sx plug at 10931' woc
- 4) Tag plug at 10092'
- 5) Load hole with salt gel.
- 6) Spot 25 sx plug 8520'
- 7) Spot 25 sx plug 7000'
- 8) Cut and pull 5 ½" casing at 4000' pull 87 joints.
- 9) Spot stub plug using 30 sx cement woc.
- 10) Tag plug at 3800'
- 11) Spot 30 sx plug 1310' woc.
- 12) Tag plug at 1200'
- 13) Cut 9 5/8" at 1000' could not pull.
- 14) Pump 300 sx plug at 1000' woc.
- 15) Tag plug 341'
- 16) Perforate casing at 340' pump 200 sx cement, circulate to surface, leave casing full.
- 17) Install dry hole marker, remove anchors.

Final P & A 2/28/11

Will work with OCD to clean up and remediate location.