Submit 1 Copy To Appropriate District Office State of New Me	exico Form C-103
District I Energy, Minerals and Natu	ral Resources October 13, 2009
1625 N. French Dr., Hobbs, NM 88240	WELL API NO.
District II 1301 W. Grand Ave., Artesia, NM 88210 OIL CONSERVATION	DIVISION 30-015-38408
District III 1220 South St. Fran	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	STATE M FEE L
District IV 1220 S. St. Francis Dr., Santa Fe, NM	6. State Oil & Gas Lease No. XO-0647-0405
87505	XO-0047-0403
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLI	
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FO	DR SUCH D State
PROPOSALS.)	8. Well Number 044
1. Type of Well: Oil Well Gas Well Other	
2. Name of Operator	9. OGRID Number 873
Apache Corporation 3. Address of Operator	10. Pool name or Wildcat
303 Veterans Airpark Ln. Midland, TX 79705	ARTESIA; GLORIETA-YESO (O)
•	ARTEON, GEORIETA TESO (O)
4. Well Location	
Unit Letter O :980 feet from the S	line and2300feet from the Eline
Section 25 Township 17S Range 28E	NMPM County EDDY
11. Elevation (Show whether DR,	RKB, RT, GR, etc.)
3679 GR	
-	
12. Check Appropriate Box to Indicate N	ature of Notice, Report or Other Data
NOTICE OF INTENTION TO	OUROS OUR DEPORT OF
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON	REMEDIAL WORK ALTERING CASING
TEMPORARILY ABANDON CHANGE PLANS	COMMENCE DRILLING OPNS. P AND A
PULL OR ALTER CASING MULTIPLE COMPL	CASING/CEMENT JOB
DOWNHOLE COMMINGLE	
	OTHER, COMPLETION PROCEDURE
OTHER:	OTHER: COMPLETION PROCEDURE
OTHER: 13. Describe proposed or completed operations. (Clearly state all	pertinent details, and give pertinent dates, including estimated date
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG	pertinent details, and give pertinent dates, including estimated date
OTHER: 13. Describe proposed or completed operations. (Clearly state all	pertinent details, and give pertinent dates, including estimated date
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion.	Dertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG	Dertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion.	Dertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or completed operations. (Clearly state all post of starting any proposed work). SEE RULE 19.15.7.14 NMAC proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLG 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF	poertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR
OTHER: 13. Describe proposed or completed operations. (Clearly state all post of starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLG 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR.
OTHER: 13. Describe proposed or completed operations. (Clearly state all post of starting any proposed work). SEE RULE 19.15.7.14 NMAO proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 70 with the state of the	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR.
OTHER: 13. Describe proposed or completed operations. (Clearly state all post starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 749, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305'	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR 1" 1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40,
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 49, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR 1" 1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40,
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 49, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR.	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSE PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 74, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 74, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH.	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSE PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 74, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 74, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH.	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 74, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH.	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 749, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61'	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 749, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61'	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAC proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 749, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61' Spud Date: 3/5/2011	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 749, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61'	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAC proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 749, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61' Spud Date: 3/5/2011	pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of LLOWING PROCEDURE: PF (5 HOLES). SET PKR @ 4275'. ACIDIZE LWR "1.3 RCN BALL SEALERS. RELEASE PKR. 74, 83, 92, 4100, 14, 28, 39, 62, 75, 84, 95, 4203, 09, 17, 34, 40, 615% HCL NEFE @ 4.6 BPM & DROP 58 7/8" 1.3 RCN WHITE SAND, PUMP 3952 GALS 8# LINEAR GEL
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAC proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 749, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61' Spud Date: 3/5/2011	Pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of C. For Multiple C
OTHER: 13. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 49, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61' Spud Date: 3/5/2011 TITLE Engin	Pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of C. For Multiple C
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, '49, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61' Spud Date: 3/5/2011 I hereby certify that the information above is true and complete to the bound of the second of	Pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of C. For Multiple C
OTHER: 13. Describe proposed or completed operations. (Clearly state all of starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 49, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61' Spud Date: 3/5/2011 TITLE Engin	Pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of C. For Multiple C
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/I JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 49, 56, 64, 77' W/I SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61' Spud Date: 3/5/2011 I hereby certify that the information above is true and complete to the best of the second state of the second	Pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of C. For Multiple C
OTHER: 13. Describe proposed or completed operations. (Clearly state all pof starting any proposed work). SEE RULE 19.15.7.14 NMAG proposed completion or recompletion. APACHE HAS COMPLETED THE D STATE #44 VIA THE FOLE 3/26/2011: DO DV TOOL @ 3011'. 3/28/2011: PERF LWR PADDOCK @ 4325, 39, 50, 55, 67' W/1 JSF PADDOCK W/1000 GALS 15% NEFE @ 4.6 BPM & DROP 10 7/8 3/30/2011: PERF PADDOCK @ 4008, 12, 17, 35, 40, 44, 53, 62, 68, 49, 56, 64, 77' W/1 SPF (29 HOLES). SET RBP @ 4305' 3/31/2011: SET PKR @ 3930'. ACIDIZE 4008-4277' W/3000 GALS BALL SEALERS. RELEASE PKR. 4/1/2011: FRAC PADDOCK W/73,748 GALS 20# & 110,200# 16/30 FLUSH. 4/6/2011: RIH W/146 2 7/8" TBG, SN @ 4399.95', TAC @ 3959.61' Spud Date: 3/5/2011 I hereby certify that the information above is true and complete to the bound of the second of t	Pertinent details, and give pertinent dates, including estimated dates. For Multiple Completions: Attach wellbore diagram of C. For Multiple C