		UNITED STATE: ARTMENT OF THE I EAU OF LAND MANA	R	811 S. FIRST	STREET	FORM APPROVED OMB No. 1004-0137 xpires: October 31, 2014		
	SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tribe Name			
	SUBMIT IN TRIPLICATE – Other instructions of			s on page 2.		7. If Unit of CA/Agreement, Name and/or No. NMNM87871		
	1. Type of Well Oil Well 🖌 Gas W			8. Well Name and No. GP Federal Com #1				
	2. Name of Operator Abo Petroleum Corporation	Name of Operator Petroleum Corporation				9. API Well No. 30005628950000 30-005602895		
	3a. Address PO Box 900, Artesia, NM 88211-0900			No. (include area c	code)	10. Field and Pool or Pecos Slope	Exploratory Area	
)	575-748-425 4. Location of Well (Foorage, Sec., T., R., M., or Survey Description) 980'F5L&660'FWL					11. County or Parish, State Chaves, NM		
·		K THE APPROPRIATE BO	X(ES) TO I	NDICATE NATU	RE OF NOTIO	CE, REPORT OR OTH	ER DATA	
TYPE OF SUBMISSION					TYPE OF ACTION			
	Notice of Intent	Acidize		eepen racture Treat	_	uction (Start/Resume) amation	Water Shut-Off Well Integrity	
	Subsequent Report	Casing Repair		ew Construction lug and Abandon		mplete porarily Abandon	Other	
	Final Abandonment Notice	Convert to Injection		lug Back		er Disposal		
determined that the site is ready for final inspection.) 1. MI RU WSC Rig up safety equipment as necessary. POOH with production equipment. 2. MI RU WL to set a CIBP at 3,722'. Spot a 25 sx class "C" plug from 3,362'-3,722'. 3. Load the hole with plugging mud and spot a 25 sx class "C" plug form 1,040' to 1,400'. 4. Load the hole with plugging mud and spot a 25 sx class "C" plug form o' to 500'. This plug will be the surface casing shoe plug and combine. WOC and tag plug; reset if necessary. 5. Cut off wellhead and install marker, clean up location as per regulated. Release Equipment. RECEIVED FEB 21 2013 FEB 21 2013 MOCD ARTESIA Approved FOR 3 MONTH P HAY 0 8 2013						de 2/21/2013 or record CD		
	14. I hereby certify that the foregoing is t	rue and correct. Name (Printed	d/Typed)					
	Dan S Lewis			Title Treasu	Jrer	— <u> </u>		
	Signature	~ Demis		Date 01/16/	2013	·····		
THIS SPACE FOR FEDERAL OR STATE OFFICE USE								
		DR. GLAS		Title	TROLEUN	ENGINEER	FEB 0 8 2013	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.								
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or frau the figure of the United States any false, and the section of the United States and the section of the								
	CONDITIONS OF APPROVAL							

ج بر ^رد Verbal Regulatory approval

AFE approval_____ Regulatory approval_____

G.P. Federal Com # 1-21 660' FSL & 660' FEL, Sec. 21-T19S-R25E Eddy County, New Mexico PLUGGING PROCEDURE

Call OCD in Artesia with a 24 hour notice before commencing operations

Surface Casing:8 5/8" 24# set @ 863'.Cemented with 450 sx + 20 yds. redi-mix.Production Casing:4-1/2"10.5# set @ 4,300'.Cemented with 420 sx, (circ).

Perfs: Abo (3,772' - 3,780') Tops: Glorieta: 1,350' Abo: 3,636'

1.) MI RU WSC. Rig up safety equipment as necessary. POOH with production equipment.

2.) MI RU WL to set a CIBP at 3,722'. Spot a 25 sx class "C" plug from 3,362'- 3,722'.


3.) Load the hole with plugging mud and spot a 25 sx class "C" plug from 1,040' to 1,400'.

4.) Load the hole with plugging mud and spot a 50 sx class "C" plug from 0' to 500'. This plug will be the surface casing shoe plug and the surface plug combine. WOC and tag plug; reset if necessary.


5.) Cut off wellhead and install marker clean up location as per regulated. Release Equipment

date 1-14-13 Area Engineer

Mike Hill January 14, 2013 MH/mydocs\Word\proposal\pa\GP fed 1-21 PA.doc

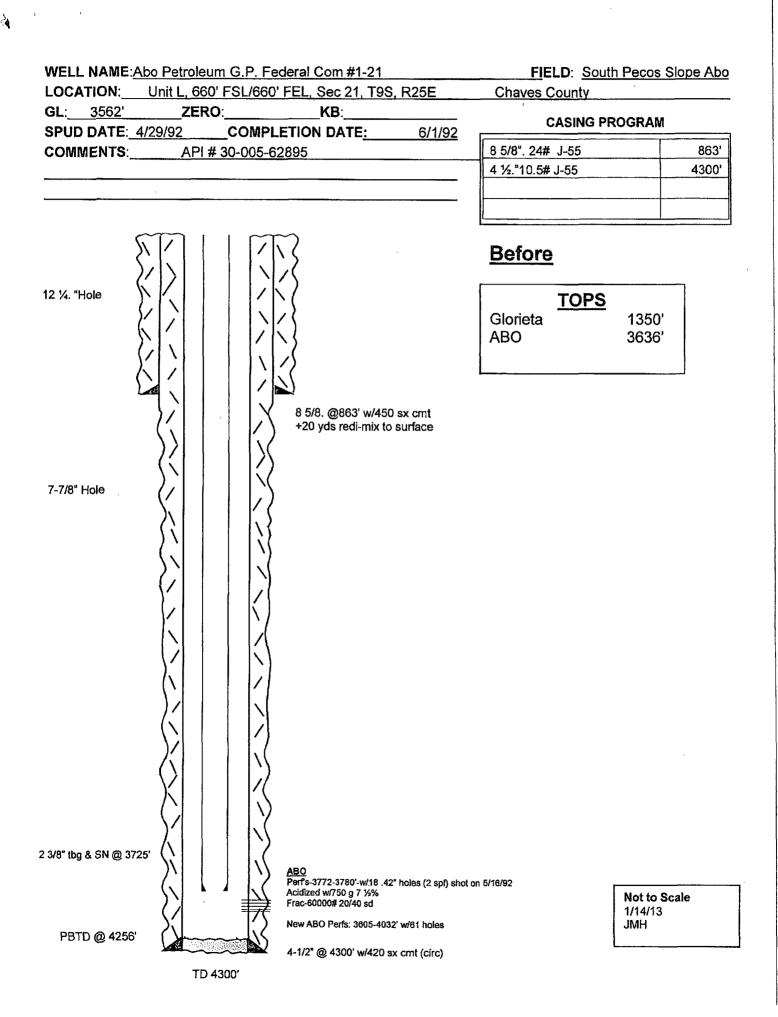

ŝ

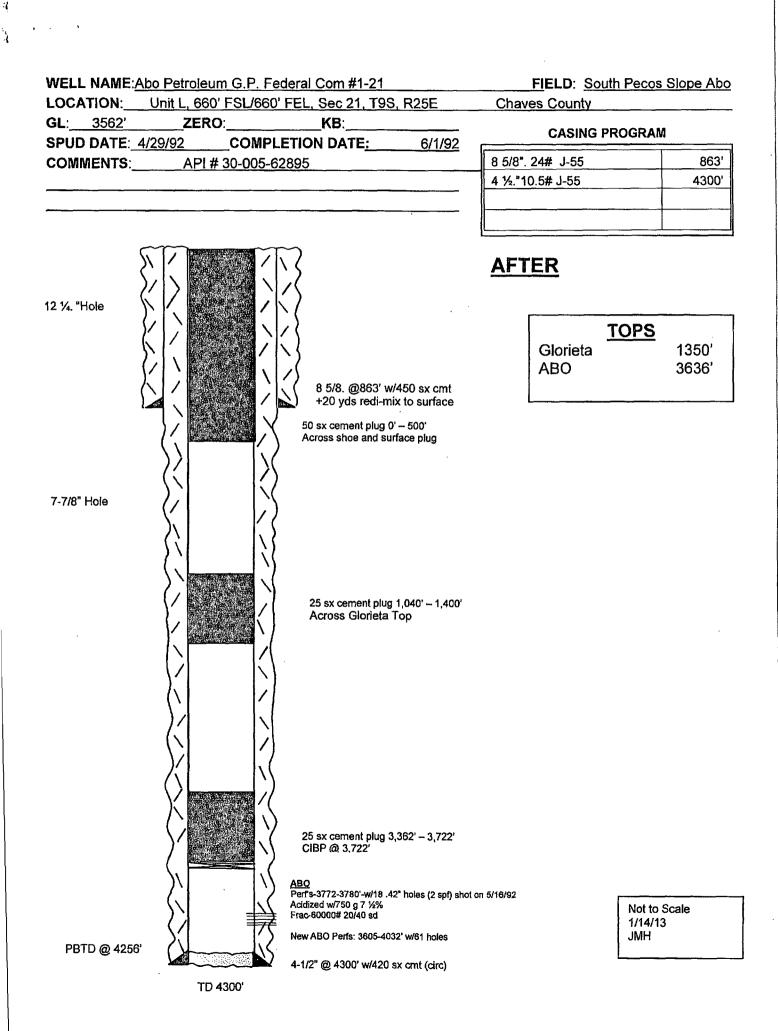

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office (RFO), prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.

2. <u>Notification</u>: Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.