

UNITED STATES **OCD-ARTESIA**
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

RECEIVED

1. Type of Well

Oil Gas
☒ Well ☐ Well ☐ Other

DEC 28 2005

OCD-ARTESIA

2. Name of Operator

STRATA PRODUCTION COMPANY

3. Address and Telephone No. **P. O. Box 1030**

Roswell, New Mexico 88202-1030 505-622-1127

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1780' FSL & 1980' FEL

Section 26-20S-28E

5. Lease Designation and Serial No.

NM-15873

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Doris Federal #2

9. API Well No.

30-015-24833

10. Field and Pool, or Exploratory Area

Scanlon Delaware

11. County or Parish, State

Eddy County, New Mexico

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ OTHER _____

☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

11/28/05: Notify BLM. MIRU. MI steel pit. NUBOP. Pull 138 jnts tbg. Run gauge ring to 4550'. Set CIBP at 4475'. Dump 35' cmt on top. Close in well.
11/29/05: Run to 4400'. Circ 10# mud. TOH. Spot 35 sxs at 2800 - 2450'. TOH. Russ Davis required no tag. Begin ND wellhead. Prepare to weld on.
11/30/05: NDWH. Weld on pull nipple. Cut csg at 920'. LD 22 jnts. TIH and spot 35 sxs at 970'. TOH.
12/01/05: TIH w/tbg and tag at 798'. TOH and spot 35 sxs w/2 1/2% CACL at 466'. TOH. WOC. Tag at 358'. TOH. NDBOP. Spot 20 sxs at 60' to surface. RD. Cut off wellhead and anchors. Install dry hole marker. Level location. Move out.

Approved as to plugging of the well bore.
Liability under bond is retained until
surface restoration is completed.

14. I hereby certify that the foregoing is true and correct

Signed *Alexis C. Swoboda*

Title Production Records

Date 12/16/05

(This space for Federal or State office use)

Approved by (ORIG. SGD.) ALEXIS C. SWOBODA

PETROLEUM ENGINEER

Date DEC 22 2005

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

* See Instruction on Reverse Side