

Submit 1 Copy to Appropriate District Office  
 District I - (575) 393-6161  
 1625 N. French Dr., Hobbs, NM 88240  
 District II - (575) 748-1283  
 811 S. First St., Artesia, NM 88210  
 District III - (505) 334-6178  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 District IV - (505) 476-3460  
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
 Energy, Minerals and Natural Resources

Form C-103  
 Revised July 18, 2013

OIL CONSERVATION DIVISION  
 1220 South St. Francis Dr.  
 Santa Fe, NM 87505

WELL API NO. <b>30-015-01959</b>
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name <b>Western Yates State</b>
8. Well Number <b>001</b>
9. OGRID Number <b>370080</b>
10. Pool name or Wildcat <b>Artesia (Queen-Grayburg-SanAndres)</b>

**SUNDRY NOTICES AND REPORTS ON WELLS**  
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well  Gas Well  Other

2. Name of Operator  
**Breitbart Operating LP**

3. Address of Operator  
**1401 McKinney Street, Suite 2400, Houston, TX 77010**

4. Well Location  
 Unit Letter: **F** **1960** feet from the **North** line and **2310** feet from the **West** line  
 Section **20** Township **18S** Range **28E** NMPM County **Eddy**

11. Elevation (Show whether DR, RKB, RT, GR, etc.)  
**3600' GR**

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK  PLUG AND ABANDON   
 TEMPORARILY ABANDON  CHANGE PLANS   
 PULL OR ALTER CASING  MULTIPLE COMPL   
 DOWNHOLE COMMINGLE   
 CLOSED-LOOP SYSTEM   
 OTHER:

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK  ALTERING CASING   
 COMMENCE DRILLING OPNS.  P AND A   
 CASING/CEMENT JOB   
 OTHER:

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

**Subsequent to Alternate P&A Procedure Sundry dated 01/21/2016, Breitbart Operating LP plugged and abandoned this well.**

01/25/2016: MIRU SU, NDWH, NUBOP, TIH with 2 7/8" tubing and tag up @ 180', TOO H.

01/26/2016: TIH with 4 3/4" bit and 2 7/8" tubing, clean out with air foam unit to 609'. Pull up 1 jt, tubing, continue circulating with air/foam overnight.

01/27/2016: RIH with WL and jet cutter, cut off tubing at 576', leaving bit and bit sub in hole, POOH with WL. Pull up 1 jt. RIH WL, shoot 6 holes @ 565', POOH with WL. MIRU cement pump, establish rate with mud, pump 10 bbl LCM pill of oyster shells, cotton seed hulls and bentonite pellets. Pump 65 cu ft cement via tubing, displace to EOT. SD, WOC.

01/28/2016: RIH with WL inside tubing, tag TOC below tubing @ 609'. MIRU cement truck, pump 10 bbl LCM pill. Pump 65 cu ft cement via tubing, displace to EOT. SD, WOC. RIH with WL inside tubing, tag TOC @ 514'. POOH with WL, RIH with WL and jet cutter, cut tubing @ 510'. POOH with WL. SDON.

01/29/2016: RIH with WL inside tubing, shoot 6 holes @ 512'. MIRU cement truck, pump 10 bbl LCM pill. Pump 50 sx cement, SD WOC. RIH with WL inside tubing, tag TOC @ 502'. POOH with WL, RIH with WL and jet cutter, cut tubing @ 485'. POOH with WL. Pull tubing up 1', RIH with WL, shoot 6 holes @ 484'. POOH with WL. Pump 10 bbls LCM Pill, pump 100 sx cement. SD WOC.

01/30/2016: RIH with WL inside tubing, tag TOC @ 509'. MIRU cement truck, pump 20 bbl brine gell mud and 10 bbl LCM pill, pump 50 sx cement via tubing. WOC. RIH with WL inside tubing, tag TOC @ 406'. SDON.

01/31/2016: RIH with WL and jet cutter, cut tubing @ 158', POOH with WL. Pull 1 jt tubing. MIRU cement truck, pump 50 sx cement with sand and Flo Seal. WOC. RIH with WL inside tubing and tag TOC @ 148'. POOH with WL. Pump 50 sx cement. WOC. RIH with WL and tag TOC @ 140'. Pump 100 sx cement mixture, WOC. SDON.

02/01/2016: RIH with WL and tag TOC @ 120'. Pump cement via tubing, pump 15 sx cement, cement circulating to surface. POOH with 2 7/8" tubing, NDBOP. Fill up casing with cement to surface. RD and release equipment.

02/02/2016: Cut off WH, install dry hole P&A marker, cut off all anchors and clean up location.

Spud Date: 11/29/1961

Rig Release Date: 04/03/1961

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Shelly Doescher TITLE Agent DATE 02/04/2016  
 Type or print name Shelly Doescher E-mail address: shelly\_doescher@yahoo.com PHONE: 505-320-5682

*Submit Subsequent C-103 for Location release*

For State Use Only  
 APPROVED BY: Wade TITLE Dist. H. Supervisor DATE 2/9/2016  
 Conditions of Approval (if any):