
	Submit 1 Copy To Appropriate District Office	State of New M Energy, Minerals and Na			Form C-103 Revised July 18, 2013		
ι	<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Winterars and Na	iturai Nesources	WELL API NO.	revised July 10, 2015		
	<u>District II</u> – (575) 748-1283	OIL CONSERVATIO	NOIVISION	30-005-63767			
	811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178	1220 South St. Fi		5. Indicate Type of Le			
	1000 Rio Brazos Rd., Aztec, NM 87410			STATE 🛛	FEE		
	<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, NM	8/303	6. State Oil & Gas Lea VO-6139	ise No.		
			PLUG BACK TO A	7. Lease Name or Unit Mortar BMF State Co			
	PROPOSALS.) 1. Type of Well: Oil Well	8. Well Number 1					
	Name of OperatorEOG Y Resources, Inc.	9. OGRID Number 025575					
	3. Address of Operator 104 South Fourth Street, Artesia,	10. Pool name or Wild Palma Mesa; Siluro-Or					
	4. Well Location	1980 feet from the No					
ļ	Unit Letter F:	1980 feet from the	West line				
	Section 25		Range 27E	NMPM Chaves	County		
	11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3959'GR						
	12. Check	Appropriate Box to Indicate	Nature of Notice	, Report or Other Data	a		
	NOTICE OF IN	BSEQUENT REPOR					
	PERFORM REMEDIAL WORK		ERING CASING				
	TEMPORARILY ABANDON	CHANGE PLANS	1	_	ND A		
	PULL OR ALTER CASING DOWNHOLE COMMINGLE	CASING/CEMEI	AL JOB []				
	CLOSED-LOOP SYSTEM						
	OTHER:		OTHER:				
_		oleted operations. (Clearly state a					
	of starting any proposed w proposed completion or re-	ork). SEE RULE 19.15.7.14 NM. completion.	AC. For Multiple Co	ompletions: Attach wellbo	re diagram of		
]	EOG Y Resources, Inc. plans to plug ar	nd abandon this well as follows:					
	 MIRU all safety equipment as neede RIH with GR/JB to 6462'. 	d. ND wellhead and NU BOP.					
3	3. Set a CIBP at 6462' and cap it with 2 4. Tag TOC at 6244'. Spot a 25 sx Cla				OC.		
	5. Spot a 25 sx Class "C" cement plug 6. Spot a 25 sx Class "C" cement plug	from 2706'-2826'. This will cover to	p of the Glorieta.				
**	7. Tag TOC. Spot a 45 sx Class "C" co 8. Cut off wellhead, install dry hole ma	ement plug from 400' up to surface. T	7.1 111 1 1 2 /422		olug.		
	·		F LSQ - WOC	NAM OF CO	ONSERVATION		
· ·	Wellbore schematics attached			bore only receipt AATES	IA DISTRICT		
			Date Approved for plussing the for the formal and t	casing snoe and the surface particles and the surface particles and the surface particles and particles are also particles and are octor of web Page under June and ar OCD web Page under June are are non-under page and belief.	0 3 2017		
	Sand Data	Dia Palaga	Day ad for the born	ent Report Web occ.	CEIVED		
	Spud Date:	Rig Release	Daile AP John 193 (Substian	and stare. nin	Winds it makes		
-	WELL MUST BE PL	usero By 1/31	2018 Thield For William				
j	I hereby certify that the information	above is true and complete to the	best of my knowled	ge and belief.			
	signature (Juna) H	resta TITLE	Regulatory Specia	alist DATE June	28, 2017		
	Type or print name Tina Hu For State Use Only		a_huerta@eogresour		75-748-4168		
	APPROVED BY: July of Conditions of Approval (if any):	1 Byl TITLE COM.	PLIANCE OF	FIOEBDATE 7/3	12017		
	St Ste	ATTACHED C	10A-S				

LOCATION: 1980' FNL & 1980' FWL 25-8S-27E Chaves Co., NM GL: 3,959' ZERO: KB: SPUD DATE: 9/30/05 COMPLETION DATE: 12/14/05					CASING PROGRAM			
OMMENTS: API No.: 30)-005-63767			11-3/4" 42#	‡ H-40	350		
					8-5/8" 24# J-55			
12-1/4" Hole				5-1/2" 15.5	# J-55	6,740		
		//	11-3/4" csg @ 350' co 350sx. Circulated	emented w/	<u>B</u>	<u>efore</u>		
11" Hole 7-7/8" Hole			8-5/8" csg @ 1500' cei 700sx. Circulated.	mented w/	Yates 7 Rivers Queen Penrose Grayburg San Andreas Glorieta Yeso Tubb Abo Wolfcamp Wolcamp B Spear Cisco Strawn Siluro	500' 586' 1,110' 1,212' 1,336' 1,618' 2,766'		
		\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	Siluro perfs 6512 250gal 20% IC ad	′ – 6538′ (64) acidi cid	zed w/			

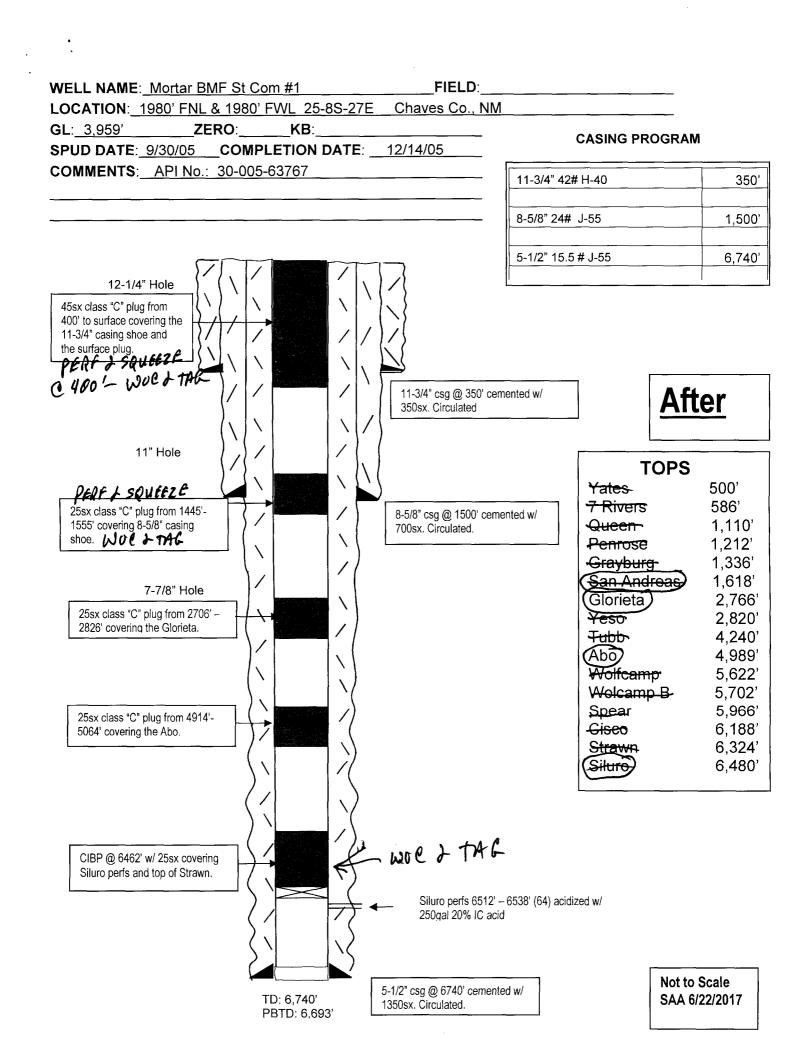

CONDITIONS FOR PLUGGING AND ABANDONMENT

District II / Artesia N.M.

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 7. Produced water will not be used during any part of the plugging operation.
- 8. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 9. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 10. Class 'C' cement will be used above 7500 feet.
- 11. Class 'H' cement will be used below 7500 feet.
- 12. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 13. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing
- 14. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 15. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.

- 16. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 17. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 18. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 19. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County

(SPECIAL CASES)

AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)