Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**


OCD Artesia


FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

CHANDY MOTICES AND DEPORTS ON WELLS

	JREAU OF LAND MANA N OTICES AND REPC		ILS		5 Lease Serial No. NMNM17225B		
	s form for proposals to I. Use form 3160-3 (AP			}	6. If Indian, Allottee or Tribe Name		
SUBMIT IN 1	RIPLICATE - Other ins	tructions on	page 2		7. If Unit or CA/Agreen	nent, Name and/or No.	
1. Type of Well Gas Well Oth	er				8. Well Name and No. ABBY FEDERAL 5		
Name of Operator RKI EXPLORATION & PROD	. Contact:	CAITLIN O'H.			9. API Well No. 30-015-29308-00)-S1	
3a. Address 3500 ONE WILLIAMS CENTE TULSA, OK 74172	R MD 35	3b. Phone No. Ph: 539-57	(include area code) 3-3527		10. Field and Pool or E ROSS DRAW	xploratory Area	
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description	n)			11. County or Parish, S	tate	
Sec 28 T26S R30E SESE 967	FSL 330FEL				EDDY COUNTY	, NM	
12. CHECK THE AF	PROPRIATE BOX(ES) TO INDICA	TE NATURE OF	NOTICE,	REPORT, OR OTH	ER DATA	
TYPE OF SUBMISSION		·	TYPE OF	ACTION			
Notice of Intent ■ Notice of Intent Notice of	☐ Acidize	☐ Dee	pen	☐ Product	on (Start/Resume)	■ Water Shut-Off	
	☐ Alter Casing	☐ Hyd	raulic Fracturing	□ Reclama	ation	■ Well Integrity	
☐ Subsequent Report	□ Casing Repair	☐ New	Construction	☐ Recomp	lete	Other	
☐ Final Abandonment Notice	□ Change Plans	🛛 Plug	and Abandon	☐ Tempor	arily Abandon		
	Convert to Injection	Plug	g Back	☐ Water D	Pisposal		
If the proposal is to deepen directions Attach the Bond under which the wor following completion of the involved testing has been completed. Final At determined that the site is ready for f RKI EXPLORATION & PROD THE WBD AND PROCESS A	rk will be performed or provid operations. If the operation ro- pandonment Notices must be final inspection. UCTION, LLC RESPEC	te the Bond No. or results in a multiplication in the second of the seco	n file with BLM/BIA le completion or reco requirements, includ	. Required sul impletion in a i ing reclamation	osequent reports must be new interval, a Form 3160 n, have been completed a	filed within 30 days 0-4 must be filed once nd the operator has	
Accepted for recor		RECEIVED			ATTACHED F		
AUG 0 7 2018 CONDITIONS OF APPROVAL					APPRUVAL		
DISTRICT II-ARTESIA O.C.D.							
14. I hereby certify that the foregoing is	Electronic Submission	#407297 verifie	d by the BLM Wel	l Information	n System		
Con	Por RKI EXPL nmitted to AFMSS for pro	cessing by PRI	DD LLC, sent to t SCILLA PEREZ or	ne Carisbao 1 03/12/2018	(18PP1290SE)		
Name (Printed/Typed) CAITLIN (D'HAIR		Title SUBMIT	TER			
Signature (Electronic S	Submission)		Date 03/12/20	018			
	THIS SPACE FOR FEDERAL OR STATE OFFICE USE						
Approved By James							
Conditions of approval, if any, are attache certify that the applicant holds legal or equivalent would entitle the applicant to conduct the conduction of th	uitable title to those rights in t	es not warrant or he subject lease	Office (a	rlska	6		

Title 8 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

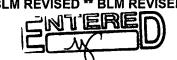

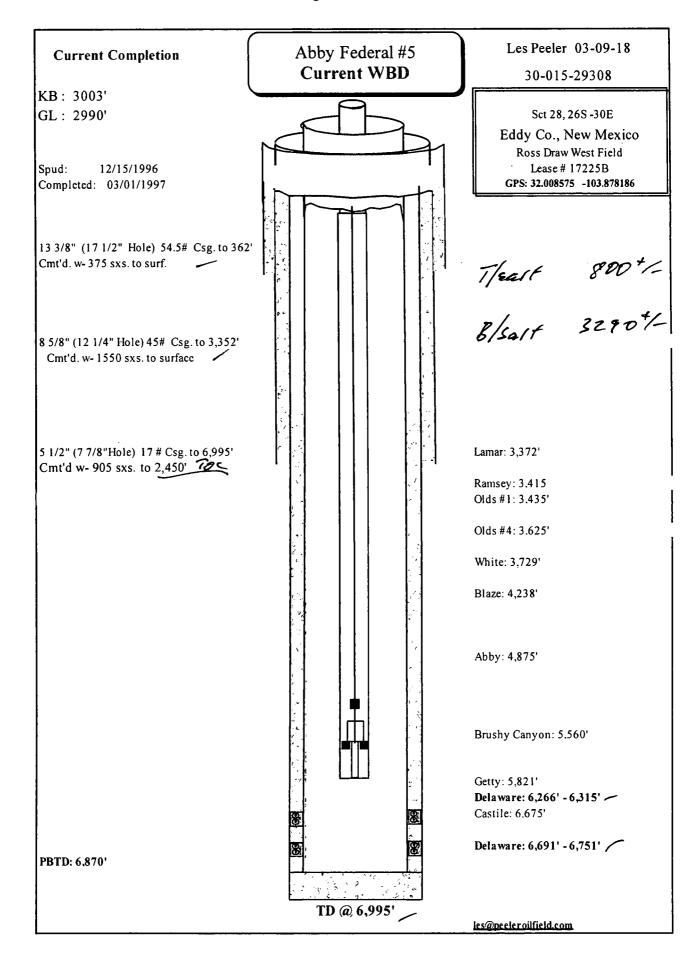

Les Peeler 03-09-18 Abby Federal #5 Proposed Plugged WBD **Proposed WBD** 30-015-29308 KB: 3003' GL: 2990' Sct 28, 26S-30E Eddy Co., New Mexico Ross Draw West Field Lease # 17225B 12/15/1996 Spud: GPS: 32.008575 -103.878186 Completed: 03/01/1997 Perf @ 150' & sqz. 70 sxs. to surface 13 3/8" (17 1/2" Hole) 54.5# Csg. to 362' (a) (a) (b) Cmt'd. w- 375 sxs. to surf. Perf @412' & Sqz. 70 sxs. Tag @262' 8 5/8" (12 1/4" Hole) 45# Csg. to 3,352' Cmt'd. w- 1550 sxs. to surface 5 1/2" (7 7/8"Hole) 17 # Csg. to 6,995' Lamar: 3,372' S. S. S. S. S. Cmt'd w- 905 sxs. to 2,450' Perf @ 3402' & Sqz.'70 sxs. to 3252' Ramsey: 3,415 Olds #1: 3,435' Olds #4: 3,625' White: 3,729' Blaze: 4,238' ; ... , E. Spot 30 sxs. @ 2? Over DVT Abby: 4,875' Brushy Canyon: 5,560' Getty: 5,821' Set CIBP @ 6.166' & spot 25 sxs. on top Delaware: 6,266' - 6,315' Castile: 6,675' Delaware: 6,691' - 6,751' PBTD: 6,870' TD @ 6,995' les@peeleroilfield.com



Abby Federal #5 Plug and Abandon Procedure

Ross Draw West Field

Section 28 T-26S, R-30E Eddy Co., New Mexico

API # 30-015-29308 Lease # 17225B GPS: 32.008575 -103.878186

Spud Date: 12/15/1996 TD Date: 03/01/1997

Producing Formations: Delaware: 6,266' - 6,751'

KB Elev: 3003' GL Elev: 2990' 6,995 TD: **PBTD:** 6,870'

CASING SUMMARY:

Safety Factor = 80% of new applied to burst, collapse and tension parameters in table.

Size	Depth (ft)	Weight (#/ft)	Grade psi	Connection Type	Capacity (bbls/ft)	ID (in)	Drift (in)	Burst (psi)	Collapse (psi)	Tension (lbs)
13 3/8"	362'	54.5 #	n/a	n/a	.1521	n/a	n/a	n/a	n/a	n/a
8 5/8"	3,352'	45 #	n/a	n/a	.0637	n/a	n/a	n/a	n/a	n/a
5 ½"	6,995'	17#	n/a	n/a	.0238	n/a	n/a	n/a	n/a	n/a

Surface:

13 3/8": 0'- 362'- TOC @ surface w-375 sxs.

Production:

8 5/8" 0'- 3,352' – TOC @ surface w-1550 sxs.

Production

5 1/2": 0'- 6,995' - TOC @ 2,450' w- 905 sxs,

COMPLETION HISTORY TO DATE:

OBJECTIVE: Plug and abandon.

WPX REQUIRES THAT HARD HATS, STEEL TOE BOOTS, FIRE RETARDANT CLOTHING, AND SAFETY GLASSES BE WORN ON LOCATION.

HOLD SAFETY MEETING PRIOR TO COMMENCING PERFORATING, WIRE LINE AND PUMPING **OPERATIONS**

NO IGNITION SOURCES WITHIN 100 FT OF THE WELLHEAD, FLOWBACK TANKS OR MANIFOLD.

PROCEDURE:

1	ı Y	Test	safety	anchors	and	replace	as	necessary	,
J	.,	1 631	Salciy	anchors	aiiu	ICDIACC	as	HECESSAI V	1.

- 2) MIRU Service Unit. Deliver, unload and tally 6,300' 2-3/8" 4.7# J-55 EUE work string.
- 3) Press. test tbg.
- 4) NDWH NUBOP -
- 5) POOH w- rods & tbg. & Lay Dn.
- 6) MI RU wireline unit. Run 5 1/2" GR/JB to 6,166'
- 7) RIH w- 5 1/2" tbg. conveyed CIBP & set @ 6,166' PU 1 jt. Circulate 148 bbls. heavy mud. Spot 25 sxs. Class "C" cmt. From 6,166' 5,966' & flush with heavy mud. TOOH w- tbg.
- 8) POOH & LD Tbg. & Stand Back ??'.
- 9) Spot 30 sxs. from ???' (Over DVT @??') UNKNOWN Depth onit
- 10) POOH & LD tbg. Stand Back 3400'.
- 11) RUWL RIH & Perf @ 3,402' (50' below 8 5/8" Shoe)
- 12) RIH w- Pkr & tbg. set Pkr. Establish pump rate. Squeeze 70 sx Class "C" Cement (14.8 ppg, 6.3 gps, 1.32 cfs yield) from 3,402' to 3,252'. Flush with mud. 3240'
- 13) WOC & Tag-Tag@3,257. 3240 Perf @ 850,502 Cont to 750.
- 14) POOH & LD Tbg. & stand back 400'.
- 15) RU WL & Perforate @ 412' (50' below 13 3/8" @ 362') RD wireline.
- 16) RIH w- Pkr & tbg. set Pkr. Establish pump rate. Squeeze 70 sx Class "C" Cement (14.8 ppg, 6.3 gps, 1.32 cfs yield) from 412' to 262'. Flush with mud.
- 17) WOC & Tag Tag @ 262'.
- 18) POOH & LD tbg.
- 19) RU WL & Perforate @ 150'. RD MO wireline
- 20) RIH w- Pkr & tbg. set Pkr. Establish pump rate. Squeeze 70 sx Class C Cement (14.8 ppg, 6.3 gps, 1.32 cfs yield) from 150' to surface.
- 21) RDMO Service Unit. RDMO Cementers.
- 22) MIRU Welder. Cut-off casing head. WO cap with well name and number, operator name, and date.
- 23) Pull safety anchors, dress, and reclaim surface location if necessary.

WPX Contact List:

WPX	Title	Ofc.	Celi	
Justin Warren	Production Superintendent	575-885-7525	701-421-7324	
Steve Bernhardt	Permian Production Engineer	539-573-3548	918-671-0683	
Brad Ballinger	Permian Production Engineer	539-573-0135	303-928-0799	
Bailey Nett	Permian Production Engineer	539-573-2547	505-386-8974	
Brittani Vegher	Permian Production Engineer		918-600-8645	
Josh Walker	Regulatory Specialist	539-573-0108	580-716-0330	
Les Peeler	Plugging Consultant	405-659-5185	405-318-4726	

Emergency Contacts - New Mexico:

Carlsbad Medical Center Hospital: (575) 887-4100

2430 W. Pierce St., Carlsbad, NM 88220

(575) 396-3611 Sheriff's Office: Lea County Sheriff Dept

Eddy County Sheriff Dept (575) 887-7551

Emergency Contacts - Texas:

Reeves County Hospital Hospital: (432) 447-3551

2323 Texas St, Pecos TX 79772

Sheriff's Office: Reeves County Sheriff Dept (432) 445-4901

Loving County Sheriff Dept (432) 377-2411

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.