-	Submit's Copies To Appropriate District Office	State of N	lew Mexico		Form C-103						
	District I	Energy, Minerals and Natural Resources		WELL ANIMO	Revised March 25, 1999						
	1625 N. French Dr., Hobbs, NM 88240 District II			WELL API NO.	5-04439						
	811 South First, Artesia, NM 88210	th First, Artesia, NM 88210 OIL CONSERVATION DI		5. Indicate Type							
	District III 1000 Rio Brazos Rd., Aztec, NM 87410		St. Francis Dr.	STATE C							
	District IV	Santa Fe,	NM 87505	6. State Oil & C							
	1220 S. St. Francis Dr., Santa Fe, NM 87505	•									
ſ		ICES AND REPORTS ON		7. Lease Name or	Unit Agreement Name:						
	(DO NOT USE THIS FORM FOR PROPO DIFFERENT RESERVOIR. USE "APPLI										
İ	PROPOSALS.)		(56)								
	1. Type of Well: Oil Well Gas Well	Other Plug &	Abandon ////	Tallm	adna						
r	2. Name of Operator	Oulci 1148 4		8. Well No.	auge						
L	Yates Petroleum Corpo	ration	OCO RECEIVED	<u>r̃`i</u> 1							
	3. Address of Operator	at America NM O	100 1/60	9. Pool name or V							
H	105 South Fourth Stre 4. Well Location	et - Artesia, NM o		<u> Vueen-Graybu</u>	rg-San Andres						
4. Well Location Court Co											
1	Unit Letter N :	990 feet from the	South line and 1	.650 feet from	the West line						
	Section 32	T17	C n 20E	NACON Edda	Country						
	Section 32	Township 17		NMPM Eddy	County						
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CA											
						-	TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRII	LLING OPNS. 🔲	PLUG AND ABANDONMENT
						, t	PULL OR ALTER CASING		CASING TEST AN	ID 🔑 🔲	ADAINDONNEN
								COMPLETION	CEMENT JOB	•.	
(OTHER:		OTHER:								
1	2. Describe proposed or complete	ed operations. (Clearly state	all pertinent details, and gi	ive pertinent dates, ii	icluding estimated date						
	of starting any proposed work).	SEE RULE 1103. For Mu	ltiple Completions: Attach	wellbore diagram o	f proposed completion						
	or recompilation.										
5-29-2003 - Moved in and rigged up pulling unit and plugging equipment. 5-30-2003 - Nippled down wellhead and nippled up BOP. Dug out cellar. Rigged up floor and tubing equipment. Shut well in. NOTE: OCD had a problem with C-103. 5-31-6-2-2003 - RIH and tagged plug. Shut well in for night. 6-3-2003 - Circulated hole with plugging mud. Spotted 25 sacks Class C Neat cement from 2590-2440'. POOH with tubing. Rigged up wireline. RIH and perforated 7" casing at 12 POOH and rigged down wireline. RIH with cement retainer to 1169'. Squeezed with 60 sacks Class C Neat cement. Dumped 35' of cement on top of retainer. POOH with tubing.					iccod up floor						
					•						
					eat cement from						
					" casing at 1250'.						
	POOH and rigged down	h tubing. Rigged w wireline. RIH with	p wireline. RIH an cement retainer to	d perforated 7	" casing at 1250'. zed with 60						
	POOH and rigged down	h tubing. Rigged u wireline. RIH with ment. Dumped 35' o	p wireline. RIH an cement retainer to	d perforated 7	" casing at 1250'. zed with 60						
	POOH and rigged down sacks Class C Neat cer Shut well in for nigh 6-4-2003 - Rigged up	h tubing. Rigged u wireline. RIH with ment. Dumped 35' o t. wireline. RIH and	<pre>p wireline. RIH an cement retainer to f cement on top of perforated 7" casin</pre>	d perforated 7 1169'. Squee retainer. POO g at 545'. PO	" casing at 1250'. zed with 60 H with tubing. OH and rigged						
	POOH and rigged down sacks Class C Neat cershut well in for nigh 6-4-2003 - Rigged up down wireline. RIH w	h tubing. Rigged uwireline. RIH with ment. Dumped 35' ot. wireline. RIH and ith cement retainer	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445". Squeezed	d perforated 7 1169'. Squee retainer. POO g at 545'. PO with 60 sacks	" casing at 1250'. zed with 60 H with tubing. OH and rigged Class C Neat						
	POOH and rigged down sacks Class C Neat cershut well in for night 6-4-2003 - Rigged up down wireline. RIH weement. Dumped 35' o	h tubing. Rigged uwireline. RIH with ment. Dumped 35' ot. Wireline. RIH and ith cement retainer f cement on top of	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445'. Squeezed retainer. POOH wit	d perforated 7 1169'. Squee retainer. POO g at 545'. PO with 60 sacks h tubing. Rig	" casing at 1250'. zed with 60 H with tubing. OH and rigged Class C Neat ged down tubing						
	POOH and rigged down sacks Class C Neat cershut well in for nigh 6-4-2003 - Rigged up down wireline. RIH w cement. Dumped 35' or equipment and floor.	h tubing. Rigged u wireline. RIH with ment. Dumped 35' o t. wireline. RIH and ith cement retainer f cement on top of Nippled down BOP a	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445'. Squeezed retainer. POOH wit	d perforated 7 1169'. Squee retainer. POO g at 545'. PO with 60 sacks h tubing. Rig	" casing at 1250". zed with 60 H with tubing. OH and rigged Class C Neat ged down tubing swedge_with						
	POOH and rigged down sacks Class C Neat cershut well in for nigh 6-4-2003 - Rigged up down wireline. RIH w cement. Dumped 35' of equipment and floor. valve. Shut well in	h tubing. Rigged uwireline. RIH with ment. Dumped 35' ot. wireline. RIH and ith cement retainer f cement on top of Nippled down BOP afor night.	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445'. Squeezed retainer. POOH wit nd casinghead. Ins	d perforated 7 1169'. Squee retainer. POO g at 545'. PO with 60 sacks h tubing. Rig talled 7" X 2"	" casing at 1250'. zed with 60 H with tubing. OH and rigged Class C Neat ged down tubing						
ī	POOH and rigged down sacks Class C Neat cershut well in for nigh 6-4-2003 - Rigged up down wireline. RIH w cement. Dumped 35' or equipment and floor.	h tubing. Rigged uwireline. RIH with ment. Dumped 35' ot. wireline. RIH and ith cement retainer f cement on top of Nippled down BOP afor night.	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445'. Squeezed retainer. POOH wit nd casinghead. Ins	d perforated 7 1169'. Squee retainer. POO g at 545'. PO with 60 sacks h tubing. Rig talled 7" X 2"	" casing at 1250'. zed with 60 H with tubing. OH and rigged Class C Neat ged down tubing swedge_with						
	POOH and rigged down sacks Class C Neat cershut well in for nigh 6-4-2003 - Rigged up down wireline. RIH w cement. Dumped 35' o equipment and floor. valve. Shut well in hereby certify that the information	h tubing. Rigged uwireline. RIH with ment. Dumped 35' ot. wireline. RIH and ith cement retainer f cement on top of Nippled down BOP afor night. CONTI	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445'. Squeezed retainer. POOH wit nd casinghead. Ins	d perforated 7 1169'. Squee retainer. P00 g at 545'. P0 with 60 sacks h tubing. Rig talled 7" X 2"	" casing at 1250'. zed with 60 H with tubing. OH and rigged Class C Neat ged down tubing swedge with						
	POOH and rigged down sacks Class C Neat cershut well in for nigh 6-4-2003 - Rigged up down wireline. RIH w cement. Dumped 35' of equipment and floor. valve. Shut well in	h tubing. Rigged uwireline. RIH with ment. Dumped 35' ot. wireline. RIH and ith cement retainer f cement on top of Nippled down BOP afor night. CONTI	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445'. Squeezed retainer. POOH wit nd casinghead. Ins	d perforated 7 1169'. Squee retainer. P00 g at 545'. P0 with 60 sacks tubing. Rig talled 7" X 2" e and belief.	" casing at 1250'. zed with 60 H with tubing. OH and rigged Class C Neat ged down tubing swedge with by 903						
S	POOH and rigged down sacks Class C Neat cer Shut well in for nigh 6-4-2003 - Rigged up down wireline. RIH w cement. Dumped 35' o equipment and floor. valve. Shut well in hereby certify that the information IGNATURE	h tubing. Rigged uwireline. RIH with ment. Dumped 35' of t. wireline. RIH and ith cement retainer f cement on top of Nippled down BOP afor night. CONTI above is true and complete to the com	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445'. Squeezed retainer. POOH wit nd casinghead. Ins	d perforated 7 1169'. Squee retainer. P00 g at 545'. P0 with 60 sacks tubing. Rig talled 7" X 2" e and belief.	" casing at 1250'. zed with 60 H with tubing. OH and rigged Class C Neat ged down tubing swedge with						
S	POOH and rigged down sacks Class C Neat cers Shut well in for nigh 6-4-2003 - Rigged up down wireline. RIH w cement. Dumped 35' o equipment and floor. valve. Shut well in hereby certify that the information IGNATURE	h tubing. Rigged uwireline. RIH with ment. Dumped 35' of t. wireline. RIH and ith cement retainer f cement on top of Nippled down BOP afor night. CONTI above is true and complete to the com	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445'. Squeezed retainer. POOH wit nd casinghead. Ins	d perforated 7 1169'. Squee retainer. P00 g at 545'. P0 with 60 sacks tubing. Rig talled 7" X 2" e and belief. Supervisor Telepho	"casing at 1250'. zed with 60 H with tubing. OH and rigged Class C Neat ged down tubing swedge with DATE June 11, 2003						
T (POOH and rigged down sacks Class C Neat cer Shut well in for nigh 6-4-2003 - Rigged up down wireline. RIH w cement. Dumped 35' o equipment and floor. valve. Shut well in hereby certify that the information IGNATURE	h tubing. Rigged uwireline. RIH with ment. Dumped 35' of t. wireline. RIH and ith cement retainer f cement on top of Nippled down BOP afor night. CONTINUATE ABOVE IS THE AMOUNT OF THE CONTINUATE ABOVE OF THE CONTINUATE AB	p wireline. RIH an cement retainer to f cement on top of perforated 7" casin to 445'. Squeezed retainer. POOH wit nd casinghead. Ins	d perforated 7 1169'. Squee retainer. P00 g at 545'. P0 with 60 sacks h tubing. Rightalled 7" X 2" e and belief. Supervisor Telepho	" casing at 1250'. zed with 60 H with tubing. OH and rigged Class C Neat ged down tubing swedge with by 903						

YATES PETROLEUM CORPORATION Tallmadge #1 Section 32-T17S-R30E Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

6-5-2003 - Rigged up wireline. RIH and perforated 7" & 8-5/8" casing at 100'. POOH and rigged down wireline. Installed 7" X 2" swedge with valve. Circulated 90 sacks Class C Neat cement down 7" and up to surface inside and outside of 8-5/8" casing. WOC. Cement stayed at surface. Cut off wellhead. Rigged down pulling unit and plugging equipment. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 6-4-2003.

19.03