

OCD-ARTESIA
UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

I&E-HOBBS
S

FORM APPROVED
OMB No 1004-0137
Expires, March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1 Type of Well <input type="checkbox"/> Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other		5 Lease Serial No NM 0476685
2 Name of Operator Great Western Drilling Company		6 If Indian, Allottee or Tribe Name
3a Address PO Box 1659, Midland, TX 79702	3b Phone No (include area code) 432-682-5241	7 If Unit or CA/Agreement, Name and/or No Hay Hollow Unit #1
4 Location of Well (Footage, Sec., T., R., M., or Survey Description) 2080 FNL & 1980 FEL Sec. 11, T-26-S, R-27-E, Unit J		8 Well Name and No Hay Hollow Unit #1
		9 API Well No 30-015-21456
		10 Field and Pool, or Exploratory Area Hay Hollow, Strawn (Gas)
		11 County or Parish, State Eddy, NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input checked="" type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other _____
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleate horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleation in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

1/17/08-1/18/08 MIRU, Bleed well down. 1/21/08 Kill well. NU BOP Work to get packer loose. SDFN. 1/22/08 RU Wireline. RIH w/ SL. Hit tight spot @ 9600. POH. GIH w/ smaller weight bar. Tag @ 9600. Pump 50 bbls. fluid in hole. Pressured up to 1200 psi. Worked packer. RIH w/ WL got down to 9900'. POH shut down. 1/23/08 Pump down tbg. Well circulated. Pump 80 bbls. Work packer. RIH w/ cutter. Cut tbg @ 9911'. Start out of hole. SDFN. 1/24/08 POH w/ 316 jts. tbg. RIH w/ CICR and set @ 9905'. SDFN. 1/25/08 Pump down tbg. Well circulated. POH w/ tbg. Found hole in 310th jt. tbg. RIH w/ plug and tbg. Set CICR @ 9905'. Pressured up to 1900 psi. Sting out of plug SDFN. 1/28/08 Load hole w/ mud laden fluid. Spot 25 sx cmt. @ 9905'. POH to 9170' and spot 35 sx cmt. POH w/ tbg. SDFN. 1/30/08 Perf. 5 1/2 csg. @ 6060'. RIH w/ packer. Set @ 5750. Sqz. 35 sx. cement. WOC SDFN. 1/31/08 Tag plug @ 5940. POH w/ tbg. ND wellhead. 2/01/08 Cut 5 1/2 csg. @ 5858. Work pipe. SDFN. 2/04/08 RU csg. jacks. Pull slips. Work pipe. RIH w/ cutter to 5348'. Cut pipe. Start out of hole w/ csg. 2/105/08 POH w/ 128 jts. 5 1/2 csg. NU well head. & BOP. SDFN. 2/06/08 RIH w/ tbg. to 5398'. Load hole w/ mud laden fluid. Spot 40 sx. cement. PO of cement. WOC. Tag plug @ 4894'. POH. SDFN. 2/07/08 ND BOP & well head. SDFN. 2/08/08 Rig up csg. jacks. Pull Slips. RIH w/ cutter to 2690'. POH. SDFN. 2/11/08 Cut 8 5/8 csg. @ 2690. Grapple broke. SDFN. 2/12/08 Spear 8 5/8. POH w/ 62 jts. 8 5/8. NU wellhead. SDFN. 2/13/08 NU wellhead. & BOP. RIH w/ tbg. to 2142. Washed tbg. down. POH. 8 jts. cork screwed. SDFN. 2/14/08 RIH w/ notched collar & tbg. to 2772. Spot 90 sx cement. PO of cement. WOC. Tag plug @ 2637'. POH to 2390. Spot 200 sx. cement. POH WOC SDFN. 2/15/08 Tagged plug @ 2110. Tbg. plugged. POH. RIH w/ tbg. to 2110 Spot 70 sx. cement. POH to 1570. Spot 70 sx cement. POH. WOC w/ 200 psi on csg. SDFN. 2/18/08 Tag plug @ 1444'. POH to 720'. Spot 80 sx cement. WOC. Tag plug @ 565'. POH to 60'. Spot 45 sx cement to surface. Cut off well head and Weld on Dry Hole Marker. Rig down.

14 I hereby certify that the foregoing is true and correct.

Name (Printed/Typed) SAM ROBERTS	Title AREA ENGINEER
Signature <i>Sam Roberts</i>	Date MARCH 10, 2008

ACCEPTED FOR FEDERAL OR STATE OFFICE USE

Approved by Gerry Gye, Deputy Field Inspector	Title AREA ENGINEER
Conditions of approval, if any, are attached to this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office Carlsbad Field Office
Title 18 U.S.C. Section 1001 and Title 18 U.S.C. Section 1003 prohibit any person knowingly and willfully to make to any Federal official a false statement or knowingly to conceal or omit material information in any matter within its jurisdiction.	

ACCEPTED FOR RECORD
MAR 18 2008
BUREAU OF LAND MANAGEMENT
CARLSBAD FIELD OFFICE