Form 3160-5 (August 1999)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

OCD-ARTES

FORM APPROVED OMB NO. 1004-0135 Expires' November 30, 2000

Lease Serial No.

.....

N104730

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.		6 If Indian, Allottee or Tribe Name
SUBMIT IN TRIPLICATE - Other in	tructions on reverse side	7. If Unit or CA/Agreement, Name and/or No.
1. Type of Well X Oil Well Gas Well Other 2. Name of Operator OXY USA Inc.	MAY 19 2008 DCD-ARTESIA 16696	8. Well Name and No. Sundance Federal 8
3a. Address P.O. Box 50250 Midland, TX 79710 4. Location of Well (Footage, Sec., T., R., M., or Survey Description 1980 FNL 1980 FWL SENW(F) Sec 5 T24S R31	3b. Phone No. (include area code) 432 - 685 - 5717	30-015-27547 10. Field and Pool, or Exploratory Area Sand Dunes Delaware, West
		11. County or Parish, State Eddy NM
12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REP	
TYPE OF SUBMISSION	TYPE OF ACTION	
	Deepen Production or Casing Fracture Treat Reclamation	water Shut-Off Well Integrity

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

New Construction

Plug and Abandon

Plug Back

Recomplete

Water Disposal

Temporarily Abandon

See Attached

Casing Repair

Change Plans

Convert to Injection

Accepted for record NMOCD

Final Abandonment Notice

Approved for plugging of well bore only. Liability under bond is retained pending receipt of C-103 (Subsequent Report of Well Plugging) which may be found at OCD Web Page under Forms, www.cmnrd.state.nm.us/ocd.

MAY 1 6 2008

BUREAU OF LAND MANAGEMENT CARLSBAD FIELD OFFICE

14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)	Title	
David Stewart	Sr. Regulatory Analyst	
In Sal	Date 5(5(08	
THIS SPACE FO	OR FEDERAL OR STATE OFFICE USE	
Approved by	Title	Date
Conditions of approval, if any, are attached. Approval of this notice decertify that the applicant holds legal or equitable title to those rights in which would entitle the applicant to conduct operations thereon.	oes not warrant or the subject lease Office	

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Sundance Federal #8

04/25/08

Notified BLM, Bob Hoskins. MIRU Triple N rig #22 and plugging equipment. Set steel working pit. ND wellhead, NU BOP. RIH w/ retrieving head for RBP on 170 jts TN 2%" workstring. SD for weekend.

04/28/08

BLM, Bob Hoskins on location. RU cementer and circulated hole w/ 110 bbl 10# mud laden fluid. RIH w/ tubing and tagged RBP @ 5,580' on jt #177. Unable to latch onto RBP. Reversed tubing w/ 15 bbls, latched onto RBP. Released RBP and POOH w/ same. RU wireline and RIH w/ 3½" collar locator, tagged PBTD @ 5,824'. PUH and located DV tool @ 5,450'. POOH w/ wireline. RIH w/ tubing @ 5,824' and displaced 30 bbls #10 mud laden fluid, pumped 50 sx C cmt w/ 2% CaCl₂ displaced w/ 10# mud. PUH w/ tubing to 4,245' and WOC. RIH w/ wireline, tagged cmt @ 5,555'. POOH w/ wireline. RIH w/ tubing to 5,503' and pumped 25 sx C cmt @ 5,502'. POOH w/ tubing and SDFN, will tag 04/29/08.

04/29/08

BLM, Bob Hoskins on location. RU wireline and RIH, tagged cmt @ 5,230'. PUH and cut 5½" csg @ 4,190' w/ 2,000 SplitShot casing cutter. POOH w/ wireline. ND BOP and wellhead. Tied back and speared csg, no movement @ 120k. Shot wellhead w/ 15' prima cord, pulled wellhead slips, and stretched csg. Indicating free @ 3,987'. NU wellhead and BOP. Contacted BLM, Wesley Ingram. RIH w/ 5½" AD-1 packer to 3,825'. Loaded hole, set packer, and established rate of 1 BPM @ 500 psi. Squeezed 65 sx C cmt w/ 2% CaCl₂ @ 4,190', displacing w/ 18 bbls, ISIP 300 psi, had circulation on last 5 bbls of displacement. WOC 3 hrs. RIH w/ tubing out of derrick. SI well. RD and re-spotted rig. RU. POOH w/ packer. RIH w/ wireline and tagged cmt @ 4,000'. PUH and cut 5½" csg @ 3,928'. POOH w/ wireline. RIH w/ packer to 500'. Established circulation thru casing cut @ 2 BPM w/ full returns in 5½ x 8½". POOH w/ packer. RU casing tools, PU on csg, free. NU BOP for casing and laid down and 4 jts casing. SI well, SDFN.

04/30/08

Continued POOH w/ 5½" casing, total 95½ jts R3 15.5/17# N-80, all in good condition. RD csg tools, NU tubing BOP, and RIH w/ tubing to 3,999'. RU cementer, cleared tubing, and pumped 225 sx C cmt @ 3,999', displacing w/ 11 bbls mud. POOH w/ tubing, SDFN. Will tag 05/01/08.

05/01/08

BLM, Bob Hoskins on location. RIH w/ tubing, tagged cmt @ 2,060'. RU cementer and pumped 375 sx C cmt @ 2,060', displacing w/ mud. PUH w/ tubing and WOC 4 hrs. RIH w/ wireline, tagged cmt @ 1,685', POOH w/ wireline. RIH w/ tubing to 1,685' and pumped 300 sx C cmt @ 1,685'. POOH w/ tubing. SDFN, will tag 05/02/08.

05/02/08

RIH w/ wireline and tagged cmt @ 580', POOH w/ wireline. ND BOP and pumped 30 sx C cmt 100' to surface. RDMO

Accepted for record NMOCD