Office	State of New Me			Form C-103
<u>District I</u>	Energy, Minerals and Natur	ral Resources	WELL API NO.	May 27, 2004
1625 N. French Dr , Hobbs, NM 88240 <u>District II</u>	OII COMORDALATION	DIMIGION	30-015-36500	
1301 W Grand Ave, Artesia, NM 88210	OIL CONSERVATION		5. Indicate Type of Lease	
<u>District III</u> 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Fran	=	STATE FEE	
<u>District IV</u> 1220 S St. Francis Dr, Santa Fe, NM	Santa Fe, NM 87	202	6. State Oil & Gas Lease N	lo.
87505	EC AND DEPORTS ON WELLS		7 Logg Name of Linit Ass	roomant Name
SUNDRY NOTICE (DO NOT USE THIS FORM FOR PROPOSA	ES AND REPORTS ON WELLS LS TO DRILL OR TO DEEPEN OR PLU	JG BACK TO A	7. Lease Name or Unit Agr Quick Draw 10 G	reement Name
DIFFERENT RESERVOIR USE "APPLICA"			8. Well Number	
PROPOSALS.)  1. Type of Well: Oil Well X Ga	s Well Other DECEIN	VED	1	
2. Name of Operator		VED	9. OGRID Number	
Mewbourne Oil Company	DEC 15	2009	14744	•
3. Address of Operator			10. Pool name or Wildcat	
PO Box 5270 Hobbs, NM 88240	NMOCD AF	RTESIA	Undesignated San Andres	11790
4. Well Location	O fact from the N	line and 165	O fact from the E line	
Unit Letter G : 231		line and165		
	Township 20S F	Range 25E		ounty
A THE STREET STREET	3400' GL	nab, m, on, cie	·/	
Pit or Below-grade Tank Application  or C	Closure 🗌			
Pit typeDepth to Groundwate	rDistance from nearest fresh wa	ater well Dis	stance from nearest surface water	<del></del> _
Pit Liner Thickness: mil	Below-Grade Tank: Volume	bbl's; C	onstruction Material	
12. Check Ap	propriate Box to Indicate Na	ature of Notice,	Report or Other Data	
NOTICE OF INTI	ENTION TO:	SH	BSEQUENT REPORT O	E·
	PLUG AND ABANDON	REMEDIAL WORK		GCASING □
<del>-</del>	CHANGE PLANS	COMMENCE DRIL	<del>_</del>	
				U
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMENT	JOB 🗌	
OTHER:		OTHER. Isolate	eso, Complete San Andres	
13. Describe proposed or complet	ed operations. (Clearly state all p	ertinent details, ar	nd give pertinent dates, including	ng estimated date
of starting any proposed work	ed operations. (Clearly state all p ). SEE RULE 1103. For Multiple	ertinent details, an e Completions: A	nd give pertinent dates, including ttach wellbore diagram of prop	ng estimated date bosed completion
<ol> <li>Describe proposed or complet of starting any proposed work or recompletion.</li> </ol>	ed operations. (Clearly state all p ). SEE RULE 1103. For Multiple	ertinent details, ar e Completions: A	nd give pertinent dates, including ttach wellbore diagram of prop	ng estimated date
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor	). SEE RULE 1103. For Multiple arry plug @ 1810'. Perforate San And	e Completions: A	ttach wellbore diagram of prop	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor	). SEE RULE 1103. For Multiple	e Completions: A	ttach wellbore diagram of prop	oosed completion
of starting any proposed work or recompletion. 11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD	). SEE RULE 1103. For Multiple rary plug @ 1810'. Perforate San And , 120° phasing, 19 GC, 38.87" penetra	e Completions: A dres at 1404' to 1450 attion) Acidize w/45	ttach wellbore diagram of prop , 00 gal 15% HCl & 70 ball sealers	oosed completion
of starting any proposed work or recompletion. 11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD	ary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra	e Completions: A dres at 1404' to 1450 attion) Acidize w/45	ttach wellbore diagram of prop , 00 gal 15% HCl & 70 ball sealers	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.	e Completions: A dres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19	ttach wellbore diagram of prop , 00 gal 15% HCl & 70 ball sealers 9 GC, 39" penetration) Acidize	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.	e Completions: A dres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19	ttach wellbore diagram of prop , 00 gal 15% HCl & 70 ball sealers 9 GC, 39" penetration) Acidize	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH sealers. Swab test.	e Completions: A dres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 ID, 120° phasing, 19	ttach wellbore diagram of proportion of the prop	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s	ary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH sealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH	e Completions: A dres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 ID, 120° phasing, 19	ttach wellbore diagram of proportion of the prop	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s	ary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH lealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH lealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH lealers. Swab test.	e Completions: A dres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 ID, 120° phasing, 19 ID, 120° phasing, 19	ttach wellbore diagram of proportion of the prop	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s	ary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH lealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH lealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH lealers. Swab test.	e Completions: A dres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 ID, 120° phasing, 19 ID, 120° phasing, 19	ttach wellbore diagram of proportion of the prop	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD 11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s  12/04/09 Frac San Andres @ 1086' – 1450 Sand.	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH lealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0.40" EH lealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH lealers. Swab test.	e Completions: A dres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 ID, 120° phasing, 19 ID, 120° phasing, 19	ttach wellbore diagram of proportion of the prop	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD 11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s  12/04/09 Frac San Andres @ 1086' – 1450 Sand.	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH lealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0.40" EH lealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH lealers. Swab test.	e Completions: A dres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 ID, 120° phasing, 19 ID, 120° phasing, 19	ttach wellbore diagram of proportion of the prop	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH lealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0.40" EH lealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH lealers. Swab test.	e Completions: A dres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 ID, 120° phasing, 19 ID, 120° phasing, 19	ttach wellbore diagram of proportion of the prop	oosed completion
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s  12/04/09 Frac San Andres @ 1086' – 1450 Sand.  12/10/09 RIH w/tbg & rods. Put well on p	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH sealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH sealers. Swab test.  20' (99', 99 holes, 1 SPF) w300,000 galandoroduction.	e Completions: A  lires at 1404' to 1450  ation) Acidize w/45  ID, 120° phasing, 19  ID, 120° phasing, 19  ID, 120° phasing, 19  S 20# slickwater car	ttach wellbore diagram of proposition of the propos	oosed completion  Swab test.
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s  12/04/09 Frac San Andres @ 1086' – 1450 Sand.  12/10/09 RIH w/tbg & rods. Put well on p	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH sealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH sealers. Swab test.  2' (99', 99 holes, 1 SPF) w300,000 galaxoroduction.	e Completions: A  lires at 1404' to 1450  ation) Acidize w/45  ID, 120° phasing, 19  ID, 120° phasing, 19  ID, 120° phasing, 19  S 20# slickwater car	ttach wellbore diagram of proposition of the propos	oosed completion  Swab test.
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s  12/04/09 Frac San Andres @ 1086' – 1450 Sand.  12/10/09 RIH w/tbg & rods. Put well on p Filed for DHC	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH sealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH sealers. Swab test.  2' (99', 99 holes, 1 SPF) w300,000 galaxoroduction.	e Completions: A  lires at 1404' to 1450  ation) Acidize w/45  ID, 120° phasing, 19  ID, 120° phasing, 19  ID, 120° phasing, 19  S 20# slickwater car	ttach wellbore diagram of proposition of the propos	oosed completion  Swab test.
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s  12/04/09 Frac San Andres @ 1086' – 1450 Sand.  12/10/09 RIH w/tbg & rods. Put well on p Filed for DHC  I hereby certify that the information above is true be constructed or closed according to NMOCI	ary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH sealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH sealers. Swab test.  20' (99', 99 holes, 1 SPF) w300,000 gals.  21' (29', 29', 29 holes, 1 SPF) w300,000 gals.  22' (29', 39 holes, 1 SPF) w300,000 gals.  23' (29', 39 holes, 1 SPF) w300,000 gals.  24' (29', 39 holes, 1 SPF) w300,000 gals.  25' (29', 39 holes, 1 SPF) w300,000 gals.	lres at 1404' to 1450 ation) Acidize w/45 (ID, 120° phasing, 19 (I	ttach wellbore diagram of proposition of the propos	oosed completion  Swab test.
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s  12/04/09 Frac San Andres @ 1086' – 1450 Sand.  12/10/09 RIH w/tbg & rods. Put well on p Filed for DHC  I hereby certify that the information above is true be constructed or closed according to NMOCI	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH sealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH sealers. Swab test.  2' (99', 99 holes, 1 SPF) w300,000 gals.  2' production.  2' and complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\)	lres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 IS 20# slickwater car and belief I further an (attached) alternated in DA	ttach wellbore diagram of proposition of the propos	oosed completion  Swab test.
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s  12/04/09 Frac San Andres @ 1086' – 1450 Sand.  12/10/09 RIH w/tbg & rods. Put well on p Filed for DHC  I hereby certify that the information above is true be constructed or closed according to NMOCI	ary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH sealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH sealers. Swab test.  20' (99', 99 holes, 1 SPF) w300,000 gals.  21' (29', 29', 29 holes, 1 SPF) w300,000 gals.  22' (29', 39 holes, 1 SPF) w300,000 gals.  23' (29', 39 holes, 1 SPF) w300,000 gals.  24' (29', 39 holes, 1 SPF) w300,000 gals.  25' (29', 39 holes, 1 SPF) w300,000 gals.	lres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 IS 20# slickwater car and belief I further an (attached) alternated in DA	ttach wellbore diagram of proposition of the propos	oosed completion  Swab test.
of starting any proposed work or recompletion.  11/10/09 POOH w/rods & tbg. Set tempor (46', 46 holes, 1 SPF, 0.40" EHD.  11/12/09 Perforate San Andres at 1224' to w/3000 gal 15% HCl & 45 ball s  11/14/09 Perforate San Andres at 1153' to w/3000 gal 15% HCl & 45 ball s  11/20/09 Perforate San Andres at 1086' to w/2000 gal 15% HCl & 15 ball s  12/04/09 Frac San Andres @ 1086' – 1450 Sand.  12/10/09 RIH w/tbg & rods. Put well on p Filed for DHC  I hereby certify that the information above is true be constructed or closed according to NMOCI	rary plug @ 1810'. Perforate San And, 120° phasing, 19 GC, 38.87" penetra 1268' (31', 31 holes, 1 SPF, 0.40" EH sealers. Swab test.  1192' (29', 29 holes, 1 SPF, 0 40" EH sealers. Swab test.  1096' (10', 10 holes, 1 SPF, 0.40" EH sealers. Swab test.  2' (99', 99 holes, 1 SPF) w300,000 gals.  2' production.  2' and complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\) or a complete to the best of my knowledge of guidelines \( \pri\), a general permit \( \pri\)	lres at 1404' to 1450 ation) Acidize w/45 ID, 120° phasing, 19 ID and belief I further an (attached) alternation of the phone N	ttach wellbore diagram of proposition of the propos	oosed completion  Swab test.