Office Engage Min	te of New Mexico erals and Natural Resources	Form C-103 June 19, 2008
1625 N. French Dr., Hobbs, NM 88240		
District II 1301 W. Grand Ave, Artesia, NM 88210 OIL CONS	SERVATION DIVISION	3000560353
District III 1220 S	South St. Francis Dr.	5. Indicate Type of Lease STATE FEE
1000 Rio Brazos Rd., Aztec, NM 87410 District IV Santa Fe, NM 87505		6. State Oil & Gas Lease No.
1220 S. St. Francis Dr , Santa Fe, NM 87505		
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		7. Lease Name or Unit Agreement Name
PROPOSALS.)		State 27 8. Well Number 1
1. Type of Well: Oil Well ☐ Gas Well ☒ Oth 2. Name of Operator	er NECLIVED	9. OGRID Number
M.E. W. Enterprise	MAR 18 2010	9. OGRID Number 160190
3. Address of Operator		10. Pool name or Wildcat
PO Box 38, Roswell NM 88202	NMOCD ARTESIA	Newmill Strawn South
4. Well Location		
Unit Letter M :660feet from theSouth line and660feet from theWestline		
Section 27 Towns	<u> </u>	NMPM County Chaves
1434 CARCON 24 ALASO AND	ow whether DR, RKB, RT, GR, ei 3942 GL	(c.)
5742 QL		
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data		
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK		DRK ☐ ALTERING CASING ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ COMMENCE DRILLING OPNS.☐ P AND A		
PULL OR ALTER CASING		
DOWNINGLE COMMINGLE		
OTHER:	OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.		
·		
1. Move in up and install BOP. POH with tubing		
2. RIH to 6168' and set CIBP		
 Circulate hole with brine and mud. Spot 25 sx class C cement on top of CIBP. WOC and tag at 5958' POH tubing. Remove top spool on wellhead and weld on 15' 17# 5 ½ pull stub. 		
5. Rig up wireline and cut casing at 4020'. Pull on casing but would not come off slips. Shot wellhead with primer cord.		
Moved casing off slips with 170,000# about 6 ". Set back down on slips and pumped down backside and 5 1/2. Could not		
circulate and break down bridge.		
 6. Cut off pull stub, reassembled wellhead, and reinstalled BOP 7. RIH to 4093' and spot 25 sx class C cement across cut casing. WOC and tag at 3859' 		
8. POH tubing, rig up wireline, and perf @ 1450' & 70'		
9. RIH with tubing and set packer at 1062'. Squeezed perfs at 1450' with 55 sx class C cement. WOC and tag at 1203'		
10. POH and lay down remaining tubing. Rig up on 5 ½ casing and pump 18 sx class C cement to perfs at 70' and up 5 1/2 x 8 5/8 annulus to surface.		
11. Install dryhole marker and cut off anchors.		
I hereby certify that the information above is true and co	mplete to the best of my knowled	dge and belief.
2 10		
SIGNATURE Plum With to	TITLE Pris	DATE 3-15-10
Type or print name Russell White) For State Use Only	E-mail address: newest	2 gradion PHONE: 575-627-2065
APPROVED BY:	TITLE Approved for plugging of v	sell bore only. DATE 3/16/2015
Conditions of Approval (if any):	of C-103 (Subsequent Republich may be found at OC	ort of Well Plugging) D Web Page under
	Forms, www.cmnrd.state.ne	m.us/ocd.