

Submit 1 Copy To Appropriate District
Office
District I
1525 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
October 13, 2009

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-015-33853
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Bounds 25 Com.
8. Well Number 1
9. OGRID Number 147179
10. Pool name or Wildcat Black River; Morrow, SW

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)


1. Type of Well: Oil Well ☐ Gas Well ☒ Other ☐

2. Name of Operator
Chesapeake Operating, Inc.

3. Address of Operator
P.O. Box 18496
Oklahoma City, OK 73154-0496

4. Well Location
Unit Letter D: 990' feet from the North line and 660' feet from the West line
Section 25 Township 24 S Range 26 E NMPM County Eddy

11. Elevation (Show whether DR, RKB, RT, GR, etc)
3230' GR

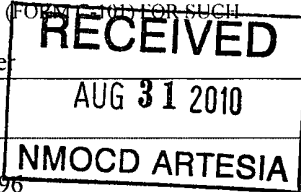

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P AND A ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	
DOWNHOLE COMMINGLE ☐			
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Chesapeake Operating, Inc. respectfully request to plug and abandon this well.

Please find the plugging procedure, actual & proposed well bore diagram, and NMOC D's C-144(CLEZ) pit permit.

Notify OCD 24 hrs. prior
To any work done.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bryan Arrant TITLE Senior Regulatory Compl. Sp. DATE 08/30/2010

Type or print name Bryan Arrant E-mail address: bryan.arrant@chk.com PHONE: (405)935-3782

For State Use Only

APPROVED BY [Signature] TITLE Approval Granted providing work DATE 9/1/2010

Conditions of Approval (if any):

is complete by 12/1/2010

Bounds 25 Com 1 Eddy County, New Mexico Plugging Procedure

Date: August 20, 2010

Location: 990' FNL & 660' FWL Sec. 25-T24S-R26E

Production Casing: 4 1/2" 13.5# P-110 0-12,000'

PBTD/TD: 11,400' / 12,000'

Current Perfs: Morrow 11,263-71'
Morrow 11,492-685' (below CIBP)

Recommended Procedure:

1. MIRU PU. NDWH/NUBOP. Release packer and POH w/ 2 3/8" tbg.
2. RU wireline co. Set CIBP @ 11,250' and bail 35' of cement on top.
3. RIH w/ tbg to 11,200' and circulate plug mud.
4. PUH to 8,900' and set a 25 sxs shoe plug from 8,800-8,900'. POH w/ tbg. *woc Tag*
5. RIH w/ string shot and back off 4 1/2" casing @ 7,100'. POH w/ casing. ** - woc comp + Bone S. 8160' - 8592'*
6. RIH w/ tbg to 7,150' and set a 25 sxs stub plug from 7,150-7050'. *- woc Tag*
7. PUH to 4,500' and set 25 sxs plug from 4,400-4,500'. ** - Bone Spring. 100' cm' plug. 5430'*
8. PUH to 2,000' and set a 25 sxs shoe plug from 1,880-1980'. POH w/ tbg. *- woc Tag*
9. Perforate casing w/ 4 squeeze holes at 350'. ** Bone of Salt 1670' - 1720' woc Tag.*
10. Circulate cement through squeeze holes @ 350' and bring cement back to surface inside and out of 7" csg.
11. RD and move off. Install dry hole marker and cut off dead men. Restore location.

Formations To be isolated with plugs. at top of each formation.

Salado - 312
Bone of Salt - 1670

** - Bone Springs 5430*
3rd. Bone Springs 8210
** Wolfcamp - 8542.*



Proposal Schematic

BOUNDS 25 COM 1

