

# COPY.

Carlsbad, New Mexico  
August 22, 1932

Mr. C. J. Worman,  
Box 72,  
Roswell, New Mexico

Dear Sir:

This will acknowledge receipt of your letter and also the log. I am returning the log to be notarized and also another copy to be made, fix this up and return it with the "Notice of Intention to Abandon" made out in triplicate. It will be necessary for you to have an approved copy of this before you start to abandon the well, so fix these at once and I will return your copy as soon as I have them and look them over. I want to be there when you start pulling the pipe, for that matter when you start to plug the well, so notify me the date you expect to start work.

The plugging requirements are as follows on this well:  
Fill up with mud laden fluid to 1390' and set five sacks of cement.  
" " " " " " 980' " " " " " " "  
" " " " " " 750' " " " " " " "  
" " " " " " 300' " " " " " " "  
" " " " " " " surface and set regulation marker.

A piece of 4" pipe will serve, set it in cement and let it extend 4 feet above the surface. It will be necessary to shut down for at least 24 hours after each batch of cement to let it set and all cement must be run with a dump bottom bailer, dumping it from the top will not be allowed. Before you run the cement after you have filled with mud to the proper level put in about five feet of small rocks to keep the cement from going into the mud and they will also serve as some thing to dump the bailer on.

In pulling the pipe keep the mud within fifty feet of the bottom of the pipe to avoid caving and bridging. Pull say two joints and then fill with mud.

Very truly yours,

J. D. Hunter  
State Oil and Gas Inspector.

Enc.