

ATTACHMENT for BAETZ A #1, dated 2/12/80, on form 9-331

1. MIRU pulling unit.
2. Set CIBP @ 8100' & dump 2 sx cmt on top.
3. Perfs 2 sqz holes at 6500'. GIH w/cmt retainer on 1" tbg & set at 6450'. Sqz w/50 sx cmt & then dump 35' cmt on top of retainer.
4. Perfs 2 holes at 6100'. GIH w/cmt retainer on 1" tbg & set at 6050'. Sqz with 50 sx cmt & then dump 35' cmt on top of retainer.
5. Perf 2 holes at 5000'. GIH w/cmt retainer on 1" tbg & set at 4950'. Sqz w/50 sx cmt & then dump 35' on top of retainer.
6. Perf 2 holes at 2200' - 5½" csg shoe. GIH w/cmt retainer on 1" tbg & sqz with 50 sx & then dump 35' on top of retainer.
7. Spot 100' plug at surface.
8. Install 4" dry hole marker & clear location.

100' plug in 2 7/8" - 1350' - 1450'