

Stevens Operating Co.
Plugging Procedure
O'Brien C # 1
Sec. 1-9-28-M

1. Spot a 40 sx. plug @ 7180'. WOC @ tag plug. Want tag @ 6924 or above.
2. Spot a 25 sx. plug @ 3805'. WOC @ tag plug.
3. Cut 5 1/2 csg. @ 3148' if free. Cut @ pull pipe, spot a 40 sx. plug 50' inside csg. stub. WOC @ tag plug.
4. Spot a 40 sx. plug @ 1175' WOC @ tag plug.
5. Spot a 40 sx. plug @ 735' WOC @ tag plug.
6. Spot a 10 sx. surface plug.
7. Salt-gel to be placed between pluggs @ 25 lb. per bbl. of brine water.
8. Clean @ level location.