

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	<input checked="" type="checkbox"/>
LAND OFFICE	<input checked="" type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

3a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
OG-4681	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

RECEIVED

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator		8. Farm or Lease Name
Pelto Oil Company ✓		
3. Address of Operator		9. Well No.
500 Dallas, Suite 1800, Houston, TX 77002		17
4. Location of Well		10. Field and Pool, or WHdcat
UNIT LETTER C 990 FEET FROM THE N LINE AND 1650 FEET FROM THE W LINE, SECTION 36 TOWNSHIP 8S RANGE 28E NMPM.		Twin Lakes SA Assoc.
15. Elevation (Show whether DF, RT, GR, etc.)		12. County
		Chaves

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER Convert to Injector ☒

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1-21-88 Finished LD tbg. Packed off well. RDPU.
- 4-14-88 RUPU (Monument). RU Star Tools rev drilling equip. TIH w/3 7/8" bit, 4 DC's & 2 3/8" workstring. Tagged hard btm @ 2596'. SDON.
- 4-15-88 Started pump, got circ, drilled on hard metal. Did not make any hole. Pulled tbg, DC & bit. Ran Kut-Rite shoe, 1 jt washpipe, jars, 2 DC's & workstring & started washing over fish. Cut through 17" of metal when pump press jumped up & lost circ. Could not get circ back. PU 1 jt off btm. Prep to pull tools & hopefully fish. SDON.
- 4-16-88 Pulled tbg & tools. No fish. DC were plugged. Cleaned out DC. WIH w/Kut-Rite shoe, washpipe, DC & tbg. Continued trying to wash over unknown fish. Did not make any hole & could not get any torque at all. Pulled tbg & tools. Ran lead imp block on sandline. Imp block showed 2 3/8" OD pin looking up. Prep to run short-cath overshot 4-17-88.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Bernie M. J. [Signature]TITLE Production Admin. Mgr.DATE 6-20-88Original Signed By
Mike Williams

Oil & Gas Inspector

APPROVED BY

TITLE

DATE JUN 29 1988

CONDITIONS OF APPROVAL, IF ANY

- 4-18-88 WIH w/short catch overshot, bumper sub, jars, 4 DC's & 2 3/8" workstring. Latched on fish. Wroked jars. Overshot jumped off fish when jars would go off. Pulled tbg & tools. Ran spear w/grapple to catch 2" ID, BS, jars, DC, & workstring & got inside fish. Worked jars pulling up to 65 pts. After several blows w/jars, something broke loose. Pulled tbg, tools & what appears to be part of a pkr mandrel. WIH w/another spear. Got in fish. Worked jars, pulling up to 65 pts. Could not jar fish loose. While trying to release spear, we got the fish started coming up hole dragging & acting like pkr setting itself several times as we worked it up. Worked fish up & down hole trying to wash any trash off that may be hanging up fish. SDON.
- 4-19-88 Continued trying to work fish up hole. Did not make any progress. Released spear. Pulled tbg & tools. WIH w/Kut-Rite shoe, washpipe, 4 DC's & workstring. Cut through 1' of hard metal then dropped down 1' more before cutting through more metal. Pulled tbg & tools to replace worn out shoe. Prep to GIH. SDON.
- 4-20-88 WIH w/another Kut-Rite shoe, 1 jt washpipe, 4 DC's & workstring. Cut through more hard metal. Pulled tbg & tools. WIH w/spear to catch 2" ID, jars, DC & workstring. Got inside fish. Pulled tbg, tools & fish. (Baker Model R compression pkr that was upside down). WIH w/3 7/8" bit, 4 DC's & workstring. Tagged solid btm @ 2602'. RU Star Tool's rev drlg equip. Got circ. Started drlg. Circ out small metal shavings. TD 2603'. SDON.
- 4-21-88 Continued drlg. Cleaned out to TD of 2635'. Circ hole clean. Pulled tbg, DC & bit & LD. RD rev equip. Too windy to RUPU. SDON. Prep to RDPU. RU Schlumberger & run CNL 4-22-88.
- 4-22-88 Too windy to RU mast truck. Will run CNL 4-23-88.
- 4-23-88 RU Schlumberger. Ran CNL. RD Schlumberger.
- 5-27-88 RUPU (Monument). PU & WIH w/3 7/8" bit, 4 1/2" csg scraper & 2 3/8" workstring to 2562'. Pulled tbg scraper & bit. Ran 4 1/2" Uni-6 BP & pkr on workstring & set BP @ 2546'. Got off of BP. SDON.
- 5-31-88 RU Gold Star pump truck. Tested csg from BP @ 2546' to surface @ 500#. Held OK. Pulled tbg & pkr. RU Schlumberger. Ran cmt top log. Found TOC @ 1980'. WIH w/tbg & ret head. Latched on BP. Pulled tbg & BP. WIH w/3 3/8" csg gun & shot 12 additional holes in P-1 using Hyper Jet II charges, 1 JSPF @ 2551-2556', 2558, 2559, 2603-2606'. RD Schlumberger. WIH w/tbg. Came out LD tbg. SDON.
- 6-1-88 PU & WIH w/plastic coated Baker AD-1 tension pkr, 78 jts (2510') 2 3/8" plstic coated tbg. RU Gold Star pump truck. Pumped 10 bbls corr inhib wtr down csg-tbg annulus. Set pkr open ended on btm of string @ 2513'. Loaded csg-tbg annulus w/inhib wtr. Press test @ 300#. Ran chart 30 min. Held OK. RDPU. JOB COMPLETE.