

CLSF

Form 160-5  
(June 1990)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

MAR 10 1995

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

5. Lease Designation and Serial No.

NM-048 768

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

Buffalo Valley Com.

8. Well Name and No.

Buffalo Valley #2

9. API Well No.

10. Field and Pool, or Exploratory Area

Buffalo Valley

11. County or Parish, State

Chavez

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Bledsoe Petro Corp.

3. Address and Telephone No.

3705 W. Memorial Rd, Oklahoma City, OK 73134 (405) 748-5050

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1650' from the North line and 990' from the East Line  
Sec. 35, Township 14S, Range 27E  
Elevation 3515 GR

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent  
☐ Subsequent Report  
☒ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ Other

☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form 1

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

9-27-94 Move in. Rig up. P.O.H. with tubing SDFD.  
9-28-94 Set CIBP @ 8000'; Dumped 5 SX Cement on top of plug. GIH with tubing to 7900' circ hole with mud. SDFD  
9-29-94 P.O.H. with tubing. Nipple up to pull casing. Cut casing @ 5000'. Start out of hole with casing. SDFD  
9-30-94 Finish out with casing. GIH with tubing to 7000' mix and pump 50 SX Cement. W.O.C. tag @ 6920'. Pull tubing to 5100' mix and pump 50 SX cement. Pull tubing to 2950'. Mix and pump 50 SX cement. Pull 1100' tubing. SDFD  
10-5-94 Tag plug @ 2804'. POH with tubing. Nipple up to pull 8 5/8". Cut 8 5/8" @ 1350' and lay down casing. GIH with tubing to 1400'.  
10-6-94 Mix and pump 65 SX cement. Pull tubing to 350' mix and pump 100 SX cement. W.O.C. tag plug @ 204'. Pull tubing to 50' mix and pump 35 SX. Cut off casing and wellhead 3' below G.L. weld on cap and plugged well marker. Clean location for abandonment.

Part ID-2  
4-7-95  
P&H

14. I hereby certify that the foregoing is true and correct

Signed

*Chris Ball*

Title Agent

MAR 8 1995

Date

March 8, 1995

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

*He was here*

Date