

NO. OF COPIES RECEIVED	2
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

RECEI

MAR 15 1974

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. K-4025, L-2463
7. Unit Agreement Name N/A
8. Farm or Lease Name New Mexico "L" State
9. Well No. 1
10. Field and Pool, or Wildcat Haystack - Cisco
12. County Chaves

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☐ GAS WELL ☒ OTHER-
2. Name of Operator
Read & Stevens, Inc.
3. Address of Operator
P. O. Box 2126, Roswell, New Mexico 88201
4. Location of Well
UNIT LETTER K, 1980 FEET FROM THE West LINE AND 1980 FEET FROM THE South LINE, SECTION 16 TOWNSHIP 6-S RANGE 27-E NMPM.
15. Elevation (Show whether DF, RT, GR, etc.)

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Set CIBP @ 5800' w/4 sx cement on top
Casing stuck couldn't free
Ran free point & casing stuck at 1940'
Cut casing at 1902', pulled & layed down 59 joints (approx. 1902') of 4 1/2" casing.
Heavy mud between plugs
Set 35 sx plug @ 1950'-1850'
Set 35 sx plug @ 1450'-1350'
Set 10 sx plug @ 10'- 0'
Cut off well head.
Installed dry hole marker.
Will notify when location is ready for inspection.

*csq. bottom hole -
13 3/8" - 45'
8 3/8" - 1415' Circ.
4 1/2" from 1940-6019*

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Joe C. [Signature] TITLE Agent DATE 3/14/74

APPROVED BY [Signature] TITLE OIL AND GAS INSPECTOR DATE APR 22 1974

CONDITIONS OF APPROVAL, IF ANY: