

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

RECEIVED BY
NOV 06 1984
O. C. D.
ARTESIA, OFFICE

5a. Indicate Type of Lease State ☐ Fee ☒
5. State Oil & Gas Lease No.
7. Unit Agreement Name
8. Farm or Lease Name Cavalcade E & D
9. Well No. 1
10. Field and Pool, or WHdcat Undesignated Abo
12. County Chaves

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☐ GAS WELL ☒ OTHER-

Name of Operator
Stevens Operating Corporation ✓
Address of Operator
P. O. Box 2203 Roswell, New Mexico 88201
Location of Well
UNIT LETTER P 660 FEET FROM THE South LINE AND 660 FEET FROM
THE East LINE, SECTION 7 TOWNSHIP 5-S RANGE 24-E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
4171.4 GR

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Surface Pipe: 10 3/4 csg @ 850 cmnt to surface.
Production Pipe: 4 1/2 csg @ 4086 cmnt to ± 3000'.
Abo Perforations: 3723.5-29 & 3900-06.5.

P & A Proposal:

1. Set CIBP @ 3700' + 40' Cmnt Cap.
2. Free Point 4 1/2 csg & cut off @ ± 2800' & pull out of hole.
3. Set 100' cmnt plug 3592-3492 w/35 sxs "C" cmnt to cover Top Abo.
4. Set 100' cmnt plug 2850-2750 w/40 sxs "C" cmnt (Tag) to cover 4 1/2 cut off.
5. Set 100' cmnt plug 1530-1430 w/40 sxs "C" cmnt to cover Top of Glorieta.
6. Set 100' cmnt plug 900-800 w/70 sxs "C" cmnt (Tag) to cover 10 3/4 shoe.
7. Set 30' cmnt plug 30-0 w/20 sxs "C" cmnt.
8. Install Dry Hole Marker.

* Mud between all plugs

Notify N.M.O.C.C. in sufficient time to witness

Plugging

I, hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Production Controller DATE 11-02-84

APPROVED BY [Signature] TITLE OIL AND GAS INSPECTOR DATE NOV 16 1984

CONDITIONS OF APPROVAL, IF ANY: