

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.G.S.	
LAND OFFICE	☒
OPERATOR	☒

JAN 23 '89

C. C. D.

5a. Indicate Type of Lease	
State ☒	Fee ☐
5. State Oil & Gas Lease No.	
V-908	

SUNDY NOTICES AND REPORTS ON WELL
DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO OPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Dry Hole		7. Unit Agreement Name
2. Name of Operator Jack J. Grynberg		8. Farm or Lease Name Union 36 State
3. Address of Operator 5000 South Quebec Street, Ste. 500, Denver, CO 80237		9. Well No. #1
4. Location of Well UNIT LETTER <u>K</u> 1980 FEET FROM THE <u>South</u> LINE AND 1980 FEET FROM THE <u>West</u> LINE, SECTION <u>36</u> TOWNSHIP <u>7S</u> RANGE <u>27E</u> NMPM.		10. Field and Pool, or Wildcat Wildcat
11. Elevation (Show whether DF, RT, GR, etc.) 3939' GR		12. County Chaves

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
 TEMPORARILY ABANDON ☐
 PULL OR ALTER CASING ☐
 OTHER ☐

PLUG AND ABANDON ☒
 CHANGE PLANS ☐
 OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
 COMMENCE DRILLING OPNS. ☐
 CASING TEST AND CEMENT JOBS ☐
 OTHER ☐
 ALTERING CASING ☐
 PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

The ABO zone (perf's 5145-5157' KB) has proven to be non-commercial in this well.

Abandonment Procedure:

1. Set CIBP @ 5100'. Dump 35' of cement on top. * Load hole w/mud
2. Pump 25 sx. cement @ 4950' (inside 4½" casing) through tubing.
3. Cut off 4½" casing at free point (est. 4400').
4. Pump 35 sx cement plug at stub. Tag plug after 4 hours.
5. Pump 25 sx. cement plug across top of Glorietta (2650-2750').
6. Pump 35 sx. cement plug at 2450'. Tag plug after 4 hours.
7. Pump 25 sx. cement at 400'.
8. Cut off surface casing and place 10 sx. surface plug.
9. Weld on plate and install dry hole marker.
10. Restore location.

Estimated start date January 25, 1989.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Ken D. Spraggs TITLE Operations Manager DATE 1/19/89Original Signed By
Mike WilliamsAPPROVED BY _____ TITLE _____
CONDITIONS OF APPROVAL, IF ANY: * As Noted AboveDATE JAN 24 1989

N

Plugging