

30-015-61149

660'S / 660'E-16-5-24

Jack J. Grynberg

Grynberg 16 St. #1

After

1. Run & set CIBP @ 3492' w/35' cement.
or Run tubing to 3492'.
Set 25 sx cement Plug 3492'-3392'.

2. Circulate brine gel.

3. Set 25 sx cement Plug 1480'-1380'.

4. Perforate 4 1/2" casing @ 910'.

5. Run Packer Squeeze cement 100' cement Plug -
inside & outside 4 1/2" casing. TAG

6. Perforate 4 1/2" casing @ 100'.
Circulate cement to surface
inside & outside 4 1/2" casing.

7. Cut & level all surface pits,
Cut deadmen, Clear location of junk,
Erect dryhole Marker.

10 3/4" csg
set @ 860'

1/4"

Perfs 3592'-

4 1/2" csg

set @ 4150'

w/ 1495 sx

Toc-960'