

30-015-61151

1980 N/660'W-16-S-24

Jack J. Grynberg

Grynberg State 16 #3

Before

1. Run & set CSBP @ 3466' w/35' cement.
or Run tubing to 3466'.

Set 25 sx cement Plug 3466'-3366'. TAG

2. Circulate brine gel.

3. Set 25 sx cement Plug @ 1160'.

4. Perforate 4 1/2" casing @ 975'.

5. Run Packer, Squeeze cement 100' cement Plug.
inside & outside 4 1/2" casing. TAG

6. Perforate 4 1/2" @ 100'
Circulate cement to surface
inside & outside 4 1/2" casing.

7. Cut & level all surface pits.
Cut deadmen, Clear location of junk.
Erect dry hole marker.

10 3/4" csg
set @ 925'

4 1/2" csg

set @ 3900'

w/1100

Toc - 925'

= Perfs 3566'-83'