

1980'N / 1980'E - 16-5-24

JACK J. Grynberg

Grynberg 16 St. #4

After.

1. Run + set CIBP @ 3446' w/ 35' cement.
or Run tubing to 3637'
Set 25 sx cement Plug 3446' - 3546'. TAG

2. Circulate brine gel.

3. Set 25 sx cement Plug 1210' - 1110'.

4. Perforate 4 1/2" casing @ 951'.

5. Run Packer. Squeeze cement 100' cement Plug
inside + outside 4 1/2" casing. TAG

6. Perforate 4 1/2" casing @ 100'
Circulate cement to surface
inside + outside 4 1/2" casing.

7. Cut + level all surface pits,
Cut deamen, Clear location of junk,
Erect dry hole marker.

10 3/4" csq
set @ 901'



Perfs 3546' - 3750'

4 1/2" csq

set @ 3990'

w/ 1460 sx cement.

Cal. to Circ.?