

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO.
30-005-61166

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☐ Gas Well ☒ Other ☐

2. Name of Operator
Yates Petroleum Corporation

3. Address of Operator
105 S. 4th Street Artesia, NM 88210

4. Well Location
Unit Letter **D** : **660** feet from the **North** line and **660** feet from the **West** line
Section **8** Township **6S** Range **26E** NMPM **Chaves** County
10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3707' GR

7. Lease Name or Unit Agreement Name:
Caudill RZ

7. Well No.
#1

8. Pool name or Wildcat
Pecos Slope Abo

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Propose to plug and abandon well as follows:

Notify OCD 24 hrs. prior to any work done

Pull all equipment out of the hole.

Set a CIBP at 3700' capped with 35' of cement to cover the Abo perms 3754-4040'.

Pull the 4-1/2" casing from +/- 3100' to the surface.

Set a 50 sack plug at 3150-3050' to cover the casing stub at +/- 3100'. **TA1**

Set a 50 sack plug at ~~1800-1700'~~ **1500-1600**

Set a 50 sack plug 978-878' to cover the base of the 8-5/8" casing. **TA4**

Set a ~~1000~~ sack plug at the surface. **Set 25 sk plug @ 528'**

Remove the wellhead and install a dry hole marker.

**Salt gel mud consisting of 10#
Brine W/25# of gel per bbl
must be placed between each plug**

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Susan Herpin* TITLE Engineering Technician DATE January 11, 2002

Type or print name Susan Herpin Telephone No. 505-748-1471

(This space for State use)

APPROVED BY *[Signature]* TITLE *[Signature]* DATE JAN 25 2002

Conditions of approval, if any: