Submit 3 Copies to Appropriate District Office

## State of New Mexico Energy, Minerals and Natural Resources Department

NOV 1 7 1993 niec1-1-89

DISTRICT I OIL CONSERVATION DIVISION WELL APINO, C. D. P.O. Box 1980, Hobbs, NM \$8240 P.O. Box 2088 DISTRICTI Santa Fe. New Mexico 87504-2088 P.O. Drawer DD, Artesia, NM 88210 5. Indicate Type of Louis PEE 🗍 STATE 1000 Rio Brazos Rd., Aziec, NM 87410 & State Oil & Gas Lease No. LH-181-3 SUNDRY NOTICES AND REPORTS ON WELLS ( DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: WELL X WEL | New Mexico State "36" 2. Name of Operator 8. Well No. Lynx Petroleum Consultants, Inc. 3. Address of Operator 9. Pool same or Wildcat P.O. Box 1979, Hobbs, NM 88241 Hagerman Strawn Gas 4. Well Location \_ Line and 1980 Unit Letter F: 1980 Feet From The North West Feet From The Range 26E Township 13S Chaves County **NMPM** 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3453' GR Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data 11. NOTICE OF INTENTION TO:

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING 
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT 
PULL OR ALTER CASING CASING TEST AND CEMENT JOB 
OTHER:

- 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103.
  - 1. Set C.I.B.P. at 6500'. Loaded hole with 10 ppg mud.
  - 2. Spotted 10 sxs cement on top of C.I.B.P.
  - 3. Spotted 25 sxs cement from 5200-5525'.
  - 4. Cut and pulled 4 1/2" casing at 4500'.
  - 5. Spotted 80 sxs cement at 4550'. Tagged top of stub plug at 4116'.
  - 6. Spotted 40 sxs cement 2400-2500'.
  - 7. Spotted 90 sxs cement at 1675'. Tagged top of shoe plug at 1494'.
  - 8. Spotted 30 sxs cement 338-438'.
  - 9. Spotted 10 sxs cement at surface.
  - 10. Removed wellhead and installed dryhole marker. Rig down. Cut off anchors. Cleaned location.  $\rho_{\sigma 2}$

(Wellbore Sketch Attached)

POST FD 2 12-3-93 PAA

I hereby certify that the up promision above as true and complete to the best of	my knowledge and balief.	
SHONATURE M/arc Win	President President	DATE _//_3/9.3
TYPE DR PRINT NAME Marc Wise		<b>ТЕДРНОХЕ НО</b> 392-6950

(Thu space for Size Live)

me tale Pap

2/7/93

Land Control of the Control

MOV 0 4 1993

A STATE OF THE STA