

No Well Sign

No Flow line.

Shot- IN

11-01-01



7/93

30-005-61344

6605/1980' W-32-55-24e

Jack J. Grynberg

Grynberg 32 St. #3

Before

1. Run + set CIBP @ 3673' w/ 35' cement
or Run tubing to 3673'.

Set 25 sx cement Plug 3673'-3573'. TAG

2. Circulate brine gel.

3. Set 25 sx cement Plug 2180'-2080'.

4. Perforate 4 1/2" casing @ 958'.

R

5. Run Packer, Squeeze cement

100' cement Plug inside + outside 4 1/2" casing. TAG

6. Perforate 4 1/2" casing @ 100'

7. Circulate cement to surface
inside + outside 4 1/2" casing.

± Perfs 3773'-3953' 8. Cut + level all surface pits,
cut deadmen, clear location of junk,
Erect dry hole marker.

10 3/4" csg

@ 908'
circ.

4 1/2" csg

@ 4120'

Toc - 2080'