

30-015-61364

1980' N / 1980' W - 32-55-24e

Jack J. Grynberg

Grynberg 32 ST. #4

After.

1. Run + set CSBP @ 3750' w/35' cement.

2. Circulate brine gel.

3. Set 25 sx cement Plug 1520'-1420'.

4. Perforate 4 1/2" casing @ 958'.

5. Run Packer. Squeeze cement
100' cement Plug inside + outside
4 1/2" casing. TAG

6. Perforate 4 1/2" casing @ 100'.
Circulate cement to surface
inside + outside 4 1/2" casing.

7. Cut + level all surface pits,
Cut deadmen, Clear junk from location,
Perfs 3850'-3942'. Erect dry hole marker.

10 3/4" csg
set @ 908'