

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

RECEIVED
FEB 26 1991

O. C. D.
ARTESIA, OFFICE

WELL API NO.
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Drumm Com.
8. Well No. 1
9. Pool name or Wildcat Buffalo Valley Penn, W.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well OIL WELL ☐ GAS WELL ☒ OTHER
2. Name of Operator Lynx Petroleum Consultants, Inc. ✓
3. Address of Operator P. O. Box 1979, Hobbs, NM 88241
4. Well Location Unit Letter <u>E</u> : <u>1980</u> Feet From The <u>North</u> Line and <u>660</u> Feet From The <u>West</u> Line Section <u>33</u> Township <u>14S</u> Range <u>26E</u> NMPM <u>Chaves</u> County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>3447' GR</u>

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set CIBP at 6625'. Spot 4 sxs cement on CIBP at 6625-6575'.
Spot 25 sxs cement from 6100-5725'.
2. Cut casing at 4546'. Pull 4546' of 4 1/2" casing.
3. Spot 25 sxs cement 4600-4511'. Tag plug. Spot 15 sxs at 4511'.
4. Spot 30 sxs cement 2600-2500'.
5. Spot 30 sxs cement 1400-1277'. Tag plug.
6. Spot 30 sxs cement 435-300'.
7. Pump 15 sxs cement from 50' to surface.
8. Install dry hole marker and clean location.

Post ID-2
3-15-91
P & A

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Maureen TITLE President DATE 2/26/91
TYPE OR PRINT NAME TELEPHONE NO.

(This space for State Use)

APPROVED BY Johnny Robinson TITLE OIL AND GAS SUPERVISOR DATE 5-31-91
CONTINUATION OF APPROVAL IF ANY

QW 100

QW 101

QW 102

QW 103

FEB 27 1991

QW 104