	NOK A
Submit 3 Copies To Appropriate Dispers 20 State of New M Office	lexico CIST Form C-103
Distant AS A Energy Minerals and Nat	tural Resources D Revised March 25, 1999
1625 N. French Dr., Hobby, NM 88240	WELL API NO.
District II 811 South First, Artesia, 188210 JUN 202 OIL CONSERVATION	N DIVISION 30-005-61395
DISTRICT IN DICENSIVE PROFESSION STREET	ancis Dr
1000 RIO BRIZOS KO., AZIESTMI SALW - ARIESTA - MISSING - Santa Fa NIMA	STATE FEE LA
District IV 1220 S. St. Francis Dr., Santa Fe, NM	6. State Oil & Gas Lease No.
87505	
SUNDRY SOLICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PL	S 7. Lease Name or Unit Agreement Name:
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) F	
PROPOSALS.)	
1. Type of Well: Oil Well Gas Well Other Plug & Aband	
Oil Well Gas Well Other Plug & Aband 2. Name of Operator	lon Acme Com 8. Well No.
Yates Petroleum Corporation	12
3. Address of Operator	9. Pool name or Wildcat
105 South Fourth St Artesia, NM 88210	Pecos Slope Abo
4. Well Location	
Unit Letter <u>0</u> : <u>660</u> feet from the <u>South</u>	line andfeet from the line
Section 20 Township 85 R	
	ange 26E NMPM Chaves County
10. Elevation (Show whether D. 3732' GR	К, ККВ, КІ, GK, есс.)
11. Check Appropriate Box to Indicate N	ature of Notice Report or Other Data
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
	ABANDONMENT
TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPLETION	
PULL OR ALTER CASING MULTIPLE COMPLETION	CASING TEST AND CEMENT JOB
PULL OR ALTER CASING MULTIPLE COMPLETION	CASING TEST AND CEMENT JOB
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operation 12. Describe proposed or completed operations. (Clearly state all per	ABANDONMENT CASING TEST AND CEMENT JOB CTHER:
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Complete operation of starting any proposed work). SEE RULE 1103. For Multiple Complete operations.	ABANDONMENT CASING TEST AND CEMENT JOB CTHER:
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Complete Comple	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Complete operation of starting any proposed or complete operations. (Clearly state all performed operations). SEE RULE 1103. For Multiple Contract or recompilation. NOTE: Permission and instructions for plugging	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Complete comple	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations of starting any proposed work). 12. Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple Cor recompilation. NOTE: Permission and instructions for pluggire & Associates from OCD-Artesia.	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: Tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion mg were obtained by Roger Brooks with BCM
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations of starting any proposed work). 12. Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple Correcompilation. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment.
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations of starting any proposed work). 12. Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple Correcompilation. NOTE: Permission and instructions for pluggire & Associates from OCD-Artesia.	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. ell down. Nippled down wellhead and
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations of the starting any proposed work). 12. Describe proposed or completed operations. (Clearly state all performed of starting any proposed work). SEE RULE 1103. For Multiple Completed operation. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging & 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" to out. RIH with tubing. Shut well in for night	ABANDONMENT ABANDONMENT ABANDONMENT ABANDONMENT CASING TEST AND CEMENT JOB OTHER:
 PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 12. Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple C or recompilation. NOTE: Permission and instructions for pluggir & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" tu out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. 	ABANDONMENT ABANDONMENT ABANDONMENT ABANDONMENT ABANDONMENT CASING TEST AND CEMENT JOB OTHER: Completions: Attach wellbore diagram of proposed completion and were obtained by Roger Brooks with BCM equipment. Bulled down wellhead and abing equipment. POOH with tubing, tallying Pulled up hole to 4308'. Spotted a 25
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations of starting any proposed work). SEE RULE 1103. For Multiple Contractions for plugging or recompilation. NOTE: Permission and instructions for plugging 6-8-10-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" to out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'.	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. equipment. equipment. Pulled down wellhead and abing equipment. POOH with tubing, tallying Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night.
 PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: 12. Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple C or recompilation. NOTE: Permission and instructions for pluggir & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" tu out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem 	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. ment plug from 2095-1500'. POOH with
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations of the starting any proposed work). SEE RULE 1103. For Multiple Contrecompilation. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging & 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" to out. RIH with tubing. Shut well in for night & 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cement plug from 4308-3930'.	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. hent plug from 2095-1500'. POOH with or. Nippled down BOP and 4-1/2" casing head.
 PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple C or recompilation. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" to out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck 	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: Intinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion Ing were obtained by Roger Brooks with BCM equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. ment plug from 2095-1500'. POOH with or. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP.
 PULL OR ALTER CASING DULTIPLE COMPLETION OTHER: Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple C or recompilation. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" tu out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck Cut casing at 975' - could not pull casing. F 	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: Intinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion Ing were obtained by Roger Brooks with BCM equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. ment plug from 2095-1500'. POOH with or. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP.
 PULL OR ALTER CASING DULTIPLE COMPLETION OTHER: I2. Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple C or recompilation. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" to out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cement tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck Cut casing at 975' - could not pull casing. Figure 1. 	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: Itinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion and were obtained by Roger Brooks with BCM equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. ment plug from 2095-1500'. POOH with or. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP. Rigged up floor and 2-3/8" tubing equip-
 PULL OR ALTER CASING DULTIPLE COMPLETION OTHER: Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple C or recompilation. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" tu out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck Cut casing at 975' - could not pull casing. F 	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. ell down. Nippled down wellhead and ubing equipment. POOH with tubing, tallying t. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. hent plug from 2095-1500'. POOH with or. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP. Rigged up floor and 2-3/8" tubing equip- C. Squeezed with 40 sacks Class C Neat best of my knowledge and belief.
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations. 12. Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple C or recompilation. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" tu out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck Cut casing at 975' - could not pull casing. F ment. Shut well in for night. 6-13-2002 - RIH with packer and tubing to 690' Thereby certify that the information above is true and complete to the b	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. ment plug from 2095-1500'. POOH with br. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP. Rigged up floor and 2-3/8" tubing equip- Squeezed with 40 sacks Class C Neat pont of the constant of the constan
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations. 12. Describe proposed or completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple C or recompilation. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" tu out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck Cut casing at 975' - could not pull casing. F ment. Shut well in for night. 6-13-2002 - RIH with packer and tubing to 690' Thereby certify that the information above is true and complete to the b	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. ell down. Nippled down wellhead and ubing equipment. POOH with tubing, tallying t. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. hent plug from 2095-1500'. POOH with or. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP. Rigged up floor and 2-3/8" tubing equip- C. Squeezed with 40 sacks Class C Neat best of my knowledge and belief.
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple Contractions for pluggint or recompilation. NOTE: Permission and instructions for pluggint & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" to out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck Cut casing at 975' - could not pull casing. Find ment. Shut well in for night. 6-13-2002 - RIH with packer and tubing to 690. Thereby certify that the information above is true and complete to the beside state. SIGNATURE TITLE_A	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. ment plug from 2095-1500'. POOH with or. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP. Rigged up floor and 2-3/8" tubing equip- Squeezed with 40 sacks Class C Neat contrinued on NEXT PAGE: Agent for BCM & Associates DATE June 19, 2002
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple Completion. NOTE: Permission and instructions for pluggint & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" to out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck Cut casing at 975' - could not pull casing. Find ment. Shut well in for night. 6-13-2002 - RIH with packer and tubing to 690' I hereby certify that the information above is true and complete to the bis SIGNATURE TITLE_A Type or print name	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. ment plug from 2095-1500'. POOH with br. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP. Rigged up floor and 2-3/8" tubing equip- Squeezed with 40 sacks Class C Neat pont of the constant of the constan
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple Contractions for pluggint or recompilation. NOTE: Permission and instructions for pluggint & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" to out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck Cut casing at 975' - could not pull casing. Find ment. Shut well in for night. 6-13-2002 - RIH with packer and tubing to 690. Thereby certify that the information above is true and complete to the beside state. SIGNATURE TITLE_A	ABANDONMENT EI CASING TEST AND CEMENT JOB OTHER: Intent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ing were obtained by Roger Brooks with BCM equipment. equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. ment plug from 2095-1500'. POOH with br. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP. Rigged up floor and 2-3/8" tubing equip- Squeezed with 40 sacks Class C Neat west of my knowledge and belief. CONTINUED ON NEXT PAGE: Agent for BCM & Associates DATE June 19, 2002 Telephone No. 746-6565
PULL OR ALTER CASING MULTIPLE COMPLETION OTHER: Image: Completed operations. (Clearly state all per of starting any proposed work). SEE RULE 1103. For Multiple Completion. NOTE: Permission and instructions for plugging & Associates from OCD-Artesia. 6-7-2002 - Moved in pulling unit and plugging 6-8-10-2002 - Rigged up pulling unit. Bled we nippled up BOP. Rigged up floor and 2-3/8" to out. RIH with tubing. Shut well in for night 6-11-2002 - Circulated hole with plugging mud. sack Class C Neat cement plug from 4308-3930'. 6-12-2002 - Spotted a 35 sack Class C Neat cem tubing. Rigged down tubing equipment and floor Pulled slips and worked casing - casing stuck Cut casing at 975' - could not pull casing. Find ment. Shut well in for night. 6-13-2002 - RIH with packer and tubing to 690' I hereby certify that the information above is true and complete to the beside sign and tubing to the beside sign a	ABANDONMENT CASING TEST AND CEMENT JOB OTHER: tinent details, and give pertinent dates, including estimated date Completions: Attach wellbore diagram of proposed completion ng were obtained by Roger Brooks with BCM equipment. equipment. equipment. equipment. Pulled up hole to 4308'. Spotted a 25 POOH to 2095'. Shut well in for night. ment plug from 2095-1500'. POOH with or. Nippled down BOP and 4-1/2" casing head. at 100'. Nippled up wellhead and BOP. Rigged up floor and 2-3/8" tubing equip- Squeezed with 40 sacks Class C Neat contrinued on NEXT PAGE: Agent for BCM & Associates DATE June 19, 2002

YATES PETROLEUM CORPORATION Acme Com #12 Section 20-T8S-R26E Chaves County, New Mexico

SUNDRY NOTICE CONTINUED:

cement. Displaced to 900'. WOC 4 hours. RIH with tubing - did not tag plug. Pulled up hole to 690'. Squeezed with 40 sacks Class C Neat cement, Displaced to 900'. Shut well in with 1500 psi for night. WOC. 6-14-2002 - RIH with tubing and tagged plug at 897'. POOH with packer. Rigged up wireline. Perforated 4-1/2" casing at 60'. POOH with wireline and rigged down wireline. Rigged down tubing equipment and floor. Nippled down BOP and 4-1/2" casing head. Installed 4-1/2" X 2" swedge with valve. Circulated 40 sacks Class C Neat cement down 4-1/2" casing and up to surface of 10-3/4" casing. Rigged down casing equipment and pulling unit. Cut off wellhead. Installed regulation abandonment marker. <u>PLUGGED AND ABANDONED - FINAL REPORT.</u> Plugging completed 6-13-2002.

y Klein Rus/

Agent for BCM & Associates June 19, 2002