

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division
311 S. 1st Street
Artesia, NM 88210-2834

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

YATES PETROLEUM CORPORATION

(505) 748-1471

3. Address and Telephone No.

105 South 4th St., Artesia, NM 88210

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1550' FNL & 2080' FEL of Section 17-T7S-R23E (Unit G, SWNE)

5. Lease Designation and Serial No.

NM-36648

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

China Federal Com #10

9. API Well No.

30-005-61679

10. Field and Pool, or Exploratory Area

Pecos Slope Abo

11. County or Parish, State

Chaves Co., NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Propose to plug and abandon as follows:

1. Nipple down tree. Nipple up BOP. TOOH with 2-3/8" tubing.
2. Set a CIBP at 2800'. TIH with tubing and tag CIBP.
3. Set a 25 sack Class C cement plug at 2800'.
4. Nipple down 4-1/2" casing head. Stretch 4-1/2" casing to determine freepoint. Cut casing and recover as much as possible. Keep hole loaded with plugging mud.
5. Set a 50 sack Class C cement plug from 50' below casing cut to 50' above. WOC 4 hours. Tag plug.
6. If casing was cut below 1600', set a 50 sack Class C cement plug from 1564-1464'. WOC 4 hours. Tag plug.
7. Set a 20 1/2 sack Class C cement plug at surface.
8. Install regulation abandonment marker.

NOTIFY BLM-ROSWELL (505-627-0272) AND OCD-ARTESIA (505-748-1283) 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS

14. I hereby certify that the foregoing is true and correct

Signed

Title Operations Technician

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

Title

