

Plugging Procedure
Stevens Operating Co.
O'Brien # 9
Sec. 1-9-28 Ut.E

1. Spot a 40 sx plug at 7211', woc and tag plug.
2. Find freepoint on 4 1/2" csg. Cut, pull and lay down csg.
3. Run in hole with tbg. and spot 25 sx at 5273' if the freepoint is high and the plug at 5273 will not cover the csg stub.
4. Spot stub plug if step 4 does not cover the csg. stub. Woc and tag plug.
5. Spot a 30 sx plug at 3105'.
6. Spot a 50 sx plug at 1950'. Woc and tag plug.
7. Spot a 10 sx plug at surface.
8. Clean and level location.
9. Hole shall be loaded between pluggs with mud at 25 lbs per bbl. salt-gel and brine water.