

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Geology, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-005-62696
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	LG-6677
7. Lease Name or Unit Agreement Name	
West of Eden Unit	
8. Well No.	1
9. Pool name or Wildcat	Pecos Slope Abo

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator YATES PETROLEUM CORPORATION
3. Address of Operator 105 South 4th St., Artesia, NM 88210	4. Well Location Unit Letter <u>N</u> : <u>660</u> Feet From The <u>South</u> Line and <u>1980</u> Feet From The <u>West</u> Line Section <u>14</u> Township <u>7S</u> Range <u>23E</u> NMPM Chaves County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3867.5' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to plug and abandon as follows:

1. Nipple down tree. Nipple up BOP. TOOH with 2-3/8" tubing. 35' cement on top of CIBP.
2. Set CIBP at 2950'. TIH with tubing and tag CIBP. Load hole with plugging mud.
3. Balance a 25 sack Class C cement plug at 2800'.
4. Nipple down 4-1/2" casing head. Stretch 4-1/2" casing to determine freepoint. Cut casing and lay down 4-1/2" casing.
5. Set a 35 sack Class C cement plug from 50' below casing cut to 50' above cut. WOC 3 hours. Tag plug.
6. Set a 35 sack Class C cement plug from 1078-978'. WOC 3 hours. Tag plug.
7. Set a 10 sack Class C cement plug at surface.
8. Install regulation abandonment marker.

NOTIFY OCD-ARTESIA (505-748-1283) 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE <u>Rusty Klein</u>	TITLE <u>Operations Technician</u>	DATE <u>May 11, 1998</u>
TYPE OR PRINT NAME <u>Rusty Klein</u>		TELEPHONE NO. <u>505/748-1471</u>

(This space for State Use)

APPROVED BY <u>Mike S. Kirkfield</u>	TITLE <u>Field Rep. II</u>	DATE <u>May 21, 98</u>
CONDITIONS OF APPROVAL, IF ANY:		