

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 005
30-015-62736

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name
McBride State

8. Well No. #1

9. Pool name or Wildcat

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
Hanson Operating Company, Inc.

3. Address of Operator
P.O. Box 1515, Roswell, NM 88202-1515

4. Well Location
Unit Letter C : 660 Feet From The North Line and 1980 Feet From The West Line
Section 28 Township 10S Range 27E NMPM Chaves County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3807 GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 2-15-01 Nipple down wellhead and install BOP, picked up collars and 2 3/8" tubing workstring and drill out 5 1/2" CIBP at 2400' Ran tubing to 5000'.
- 2-16-01 Lay down drill collars and went back in with tubing to 5617' and spotted 25 sxs cement plug, circulated hole with brine gel mud and pulled tubing to 4548', spotted 25 sxs plug and pull out of hole w/tubing and went back w/5 1/2" CIBP set at 2468', spotted 6 sxs cement on top of CIBP, pulled tubing to 1049' w/25 sxs
- 2-19-01 Tag plug at 829', perforated 5 1/2" casing 50' from surface and circulated 20 sxs cement plug in and out of 5 1/2" casing to surface, cut wellhead and install dry hole marker, cleaned location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Betsy Speer TITLE Prod. Analyst DATE 3-6-01
TYPE OR PRINT NAME Betsy Speer TELEPHONE NO. 505-622-7330

(This space for State Use)

APPROVED BY [Signature] TITLE Field Rep ID DATE 1-3-02
CONDITIONS OF APPROVAL, IF ANY:

Post Prod