Form 3160-5 November 1983) Formerly 9-331) DEF		IE INTERIOR	ther instructions ad side)	5. LEAS	E DESIGNATION	t 31, 1985 AND SEBIAL NO
	BUREAU OF LAND MA					CE OR TRIBE NAME
(Do not use this form fo	NOTICES AND R or proposals to drill or to d APPLICATION FOR PERMI	leepen or plug back to a	LLLJ different reservoir.	N/A		
					AGREEMENT N	AME
OIL GAS WELL WELL C	THER				OR LEASE NA	NE
YATES PETROLEUM C	ORPORATION	(505) 748-1471		Rock NB	Federal
105 South 4th St.	. Artesia, NM 8	8210	RECEIVED	9. WBLL	, NO.	
LOCATION OF WELL (Report lo			ulrements.*		D AND POOL,	DE WILDCAT
See also space 17 below.) At surface 330' FSL	& 1980' FWL, Sec	. 28-T6S-R25E	JAN 11'90	11. SEC.	S Slope	BLE. AND
			O. C. D.	e Unit	N, Sec.	28-6S-25E
14, PERMIT NO.		Show whether DF, RT, GR, et	C.) ARTESIA. OFFIC		NTY OB PARIS	
30-005-62748	3	741.9' GR		Chav	es	NM
	eck Appropriate Box T	lo Indicate Nature ol		or Other Da		
r	OF INTENTION TO:				REPAIRING	WELL
TEST WATER SHUT-OFF	- PULL OR ALTER CASE MULTIPLE COMPLETE		ATER SHUT-OFF		ALTERING	
SHOOT OR ACIDIZE	ABANDON*	SE	HOOTING OR ACIDIZING	x	ABANDONM	ENT*
	CHANGE PLANS		other) Producti	on Casin	lg, Perfo	rate X
REPAIR WELL						
(Other) 7. DESCRIBE PROPOSED OR COMPL proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond,	a directionally drilled. give TD 12-18-89. Ra e set 4100', floa 450 sx 65/35 C	subsurface locations and an 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s	./2" 9.5# J-55)57'. Cemente salt and 1/4#	tes, including rtical depths ST&C ca ed w/500 Cellosea	estimated da for all market ssing set gals Exc ll(yield	te of starting an rs and zones pert e 4100'. e110 gel, 1.39,
(Other) 7. DESCRIBE PROPOSED OR COMPL proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd	a directionally drilled. give 1 TD 12-18-89. Ra 2 set 4100', floa 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w 2 d perforations 3 perforations 351	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an rs and zones pert ello gel, 1.39, and sealers.
(Other) 7. DESCRIBE PROPOSED OR COMPL. proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd	a directionally drilled, give TD 12-18-89. Ra e set 4100', floa , 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w ed perforations 3	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an rs and zones pert ello gel, 1.39, and sealers.
(Other) 7. DESCRIBE PROPOSED OR COMPL. proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd	a directionally drilled. give 1 TD 12-18-89. Ra 2 set 4100', floa 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w 2 d perforations 3 perforations 351	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an rs and zones pert ello gel, 1.39, and sealers.
(Other) 7. DESCRIBE PROPOSED OR COMPL. proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd	a directionally drilled. give 1 TD 12-18-89. Ra 2 set 4100', floa 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w 2 d perforations 3 perforations 351	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an rs and zones pert ello gel, 1.39, and sealers.
(Other) 7. DESCRIBE PROPOSED OR COMPL. proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd	a directionally drilled. give 1 TD 12-18-89. Ra 2 set 4100', floa 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w 2 d perforations 3 perforations 351	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an rs and zones pert ello gel, 1.39, and sealers.
(Other) 7. DESCRIBE PROPOSED OR COMPL proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd	a directionally drilled. give 1 TD 12-18-89. Ra 2 set 4100', floa 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w 2 d perforations 3 perforations 351	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an rs and zones pert ello gel, 1.39, and sealers.
(Other) proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd	a directionally drilled. give 1 TD 12-18-89. Ra 2 set 4100', floa 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w 2 d perforations 3 perforations 351	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an rs and zones pert ello gel, 1.39, and sealers.
(Other) 7. DESCRIBE PROPOSED OR COMPL. proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd	a directionally drilled. give 1 TD 12-18-89. Ra 2 set 4100', floa 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w 2 d perforations 3 perforations 351	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an re and zones pert: 4100'. ello gel, 1.39, and sealers. 0# gelled
(Other) 7. DESCRIBE PROPOSED OR COMPL. proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd	a directionally drilled. give 1 TD 12-18-89. Ra 2 set 4100', floa 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w 2 d perforations 3 perforations 351	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an rs and zones pert ello gel, 1.39, and sealers.
(Other) 7. DESCRIBE PROPOSED OR COMPL proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd KCL wat	a directionally drilled give 1 TD 12-18-89. Ra 2 set 4100', floa 450 sx 65/35 C 5 PM 21-19-89. B ated 3510-3532' w ed perforations 3 perforations 351 cer, 54 tons CO2	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 $\pi/23$.42" holes 3510-3532' w/200 0-3532' via tub	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	5 ST&C ca cd w/500 Cellosea minutes	estimated da for all market sing set gals Exc l(yield s, float	te of starting an re and zones pert: 4100'. ello gel, 1.39, and sealers. 0# gelled
 (Other) 17. DESCRIBE PROPOSED OR COMPL proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd KCL wat 18. I hereby certify that the for SIGN Manufactor 	egoting is true and correct	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s Sumped plug to 1 a/23 .42" holes 3510-3532' w/200 .0-3532' via tub and 52000# 20/4	./2" 9.5# J-55 b57'. Cemente alt and 1/4# .300 psi for 3 (1 SPF). 0 gals 7½% ac	sapletion Rep ites, including rical depths ST&C ca ed w/500 Cellosea minutes rid and 3 ng w/2541	estimated da for all market sing set gals Exc l(yield s, float	<pre>center of starting an res and zones pert 4100'. ello gel, 1.39, and sealers. 0# gelled</pre>
(Other) 17. DESCRIBE PROPOSED OR COMPL proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd KCL wat	egoting is true and correct	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 n/23 .42" holes 5510-3532' w/200 .0-3532' via tub and 52000# 20/4	Completion or Reco and give pertinent da measured and true ver ./2" 9.5# J-55 057'. Cemente salt and 1/4# .300 psi for 3 (1 SPF). 00 gals 7½% ac oing and casin 40 sand.	ST&C ca ST&C ca d w/500 Cellosea minutes cid and 3 ng w/2541	ACCEPTER ACCEPT	-90
(Other) 17. DESCRIBE PROPOSED OR COMPL proposed work. If well is nent to this work.)* TD 4100'. Reached Regular guide shoe 500 gals Surebond, wt 14.2). PD 8:45 casing held okay. 12-26-89. Perfora 12-28-89. Acidize Frac'd KCL wat 18. I hereby certify that the for SIGNO MALE.	egoting is true and correct	subsurface locations and in 97 joints 4-1 at collar set 40 w/.7% CF1, 5# s sumped plug to 1 n/23 .42" holes 5510-3532' w/200 .0-3532' via tub and 52000# 20/4	Completion or Reco and give pertinent da measured and true ver ./2" 9.5# J-55 057'. Cemente salt and 1/4# .300 psi for 3 (1 SPF). 00 gals 7½% ac oing and casin 40 sand.	ST&C ca ST&C ca d w/500 Cellosea minutes cid and 3 ng w/2541	ACCEPTER ACCEPT	<pre>center of starting an res and zones pert 4100'. ello gel, 1.39, and sealers. 0# gelled</pre>

Title 18 U.S.C. Section 1001, makes it a crime tor any person knowingly and willfully to make to an definition ecouries of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.