

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-005-62773
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	LG-7990
7. Lease Name or Unit Agreement Name	
Wolf AHF State	
8. Well No.	1
9. Pool name or Wildcat	
Wolf Lake San Andres, South	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
3874' GR	

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:	OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator	YATES PETROLEUM CORPORATION
3. Address of Operator	105 South 4th St., Artesia, NM 88210
4. Well Location	Unit Letter A : 660 Feet From The North Line and 660 Feet From The East Line Section 13 Township 9S Range 27E NMMPM Chaves County
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
3874' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to plug and abandon as follows:

1. Nipple down wellhead. TOOH with rods. Nipple up BOP. TOOH with tubing.
2. Wireline run gauge ring to 2410'. Set a CIBP at 2410' and cap with 35' of cement. WOC.
3. TIH and tag CIBP at 2410'. Load casing with 10# brine gel mud.
4. Set a 25 sack Class C cement with 2% CaCl2 plug from 1300-1150'. WOC 2 hours. Tag plug.
5. Set a 25 sack Class C cement with 2% CaCl2 plug from 1000-850'.
6. Set a 10 sack Class C cement plug at surface.
7. Install regulation abandonment marker.

NOTIFY OCD-ARTESIA (505-748-1283) 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Operations Technician DATE July 12, 1999  
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY mae Streefield TITLE Field Rep. II DATE 2/15/99  
CONDITIONS OF APPROVAL, IF ANY: