

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

45F
DP

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

OCT 26 '90

WELL API NO. 30-005-62795
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LG 5246

SUNDRY NOTICES AND REPORTS ON WELLS O. C. D. (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Lease Name or Unit Agreement Name Pathfinder AFT State
2. Name of Operator YATES PETROLEUM CORPORATION	8. Well No. 9
3. Address of Operator 105 South 4th St., Artesia, NM 88210	9. Pool name or Wildcat Diablo Fusselman Associated
4. Well Location Unit Letter <u>N</u> : <u>660</u> Feet From The <u>South</u> Line and <u>2200</u> Feet From The <u>West</u> Line Section <u>21</u> Township <u>10S</u> Range <u>27E</u> NMPM Chaves County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>3822' GR</u>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: Perforate & Treat <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-5-90. Drilled out DV tool at 4011'. Cleaned out to 6395'. Circulated hole clean. Spot 500 g. 20% NEFE acid. Perforated 6372, 74, 76, 78 (16 holes-4 SPF - .40" holes).
10-9-90. Swabbed well. Dump 500 gals 15% NEFE acid down tubing. Made 5 swab runs. Well started flowing. Turn to production for testing.
10-18-90. Load well and set RBP at 6352', tested to 1000 psi, OK. Perforated 6295-6314' w/20 - .42" holes (1 SPF). Set packer 6233'. Acidized perforations 6295-6314' w/1500 gals 15% NEFE acid + 40 ball sealers.
10-19-90. Moved RBP to 6390-6394' and packer to 6342-6351', blast jts 6282-6322', sliding sleeve 6280-6282', 194 jts 2-7/8" tubing, 14' subs, 12' KB. Ran 2.3" gauge ring to sliding sleeve at 6280'. Open sliding sleeve at 6280'. Set plug in bottom of sliding sleeve. Made four swab runs and well kicked off upper zone. Pulled plug and closed sliding sleeve.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Juanita Goodlett TITLE Production Supervisor DATE 10-23-90
TYPE OR PRINT NAME Juanita Goodlett TELEPHONE NO. 505/748-1471

(This space for State Use)

ORIGINAL SIGNED BY
MIKE WILLIAMS
SUPERVISOR, DISTRICT II

OCT 30 1990

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY: