

DISTRICT I
P.O. Box 1900, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Las Brisas Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-005-63006
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	V-227

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: oil well <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Lease Name or Unit Agreement Name Lucky Strike State
2. Name of Operator United Drilling, Inc.	8. Well No. 1
3. Address of Operator P.O. Box 2488, Roswell NM 88202	9. Pool name or Wildcat Wildcat - San Andres
4. Well Location Unit Letter <u>J</u> : <u>2310</u> Feet From The <u>South</u> Line and <u>1650</u> Feet From The <u>East</u> Line Section <u>27</u> Township <u>10S</u> Range <u>26E</u> NMEM Chaves County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) <u>3684'</u> K.B. <u>3688'</u>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <u>Drilling and attempt completion</u> <input checked="" type="checkbox"/>		OTHER: _____	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-29-94 Drill 12-1/4" hole. Set 300' of 8-5/8" 24# casing. Circulate cement.
 3-30-94 Drill 7-7/8" hole to 1700'. Ran 4-1/2" 10.5# casing. Cement with 110 sacks Lite, 250 sacks of Premium Plus
 3-29-94 Perforate P-2 from 1650' to 1630' - 2 shots/ft.
 3-30-94 Acidized P-2 zone with 2000 gal. 20% NEFE acid. Balled zone off.
 3-31-94 Swabbed well.
 4-1-94 Swabbed well; Recovered sulfur water.
 4,2,3-94 Well shut in.
 4-4-94 Set CIBP at 1609'. Perforate 1586' to 1596' - 2 shots/ft., perforate 1560' to 1570' - 2 shots/ft. Acidized with 4000 gal. of 20% NEFE acid. Balled zone off. Swabbed well.
 4-5-29 Swabbed well dry. No oil or water.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signature: Angel Salazar TITLE: Vice President DATE: 4-6-94

Signature: Angel Salazar TITLE: _____ DATE: _____