

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
1450	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT - A" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER		7. Unit Agreement Name
2. Name of Operator U. S. Operating, Inc.		8. Farm or Lease Name Good State
3. Address of Operator 2709 North Big Spring Street; Midland, Texas 79701		9. Well No. 1
4. Location of Well UNIT LETTER <u>M</u> <u>660</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>6</u> TOWNSHIP <u>4 N</u> RANGE <u>20 E</u> N.M.P.M.		10. Field and Pool, or Wildcat Wildcat
15. Elevation (Show whether DF, RT, GR, etc.) 5167 GL		12. County De Baca

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set Cast Iron Bridge Plug (CIBP) at 4500', above all perforations in 5-1/2" casing, and dump 20' of cement on CIBP.
** 35'*
2. Shoot off 5-1/2" casing at estimated depth of 3100' and spot 100' cement plug inside and outside of 5-1/2" stub.
3. Shoot off 8-5/8" casing at estimated depth of 1900' and spot 100' cement plug inside and outside of 8-5/8" stub.
** + tag*
4. Pull 10-3/4" casing landed at 1390' but not cemented. Shoot off if necessary and spot 100' cement plug inside and outside 10-3/4" stub.
5. Spot 100' cement plug at 1200', 700' and 400'.
** 355-455 + tag*
6. Set 20' surface plug and dry hole marker.
7. Work is scheduled to start the first week in December, 1980.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Adam Harrison Jr TITLE Drilling Superintendent DATE 11-11-80

APPROVED BY W. A. Gressett TITLE SUPERVISOR, DISTRICT II DATE NOV 26 1980

CONDITIONS OF APPROVAL, IF ANY:

Fill hole w/ mud and as noted above

Not a M.O.C. or different use to witness

Plugging