

Frank O. Cox
Mc Clain Ranch # 1
Sec 15-2S-28E- Ut.M

1. Perforate 4 1/2 csg. @ 2370' & 400'.
2. Run in hole with tbg. & tag CIBP @ 2730'.
3. Spot a 30sx. plug @ 2680'. WOC & tag plug.
4. Pull up hole to 2370' & squeeze 25sx of cement behind csg. leaving 25sx inside of csg. WOC & tag plug.
5. Pull up hole to 400' & squeeze & circulate cement to surface behind 4 1/2 csg. & leave csg full to surface.
6. Set P&A marker, clean & level location.
7. Mud shall be placed between plugs @ 25lb. per/bbl. of brine.